



# Doña Ana County

AMERICANS WITH DISABILITIES ACT  
SELF-EVALUATION  
AND  
TRANSITION PLAN  
DECEMBER 2017



## Table of Contents

<b>1.0 Summary</b> .....	<b>4</b>
1.1 Doña Ana County .....	4
1.2 Americans with Disabilities Act Overview .....	5
<b>2.0 Self-Evaluation</b> .....	<b>9</b>
2.1 Facilities Audit.....	10
2.2 Facility Self-Evaluation Findings.....	12
2.3 Review of Doña Ana County ADA Grievance Procedure .....	12
2.4 Review and update of all policies and practices that govern the administration of the County’s programs, activities, and services.....	12
2.5 Audit of County Programs, Activities, and Services .....	14
2.6 Public Outreach.....	23
2.7 Staff Training.....	24
2.8 Public Meetings.....	25
2.9 Public Transportation.....	25
2.10 Emergency Evacuation .....	26
2.11 Employment.....	26
2.12 Website Accessibility.....	28
2.13 Review of all County-Owned Roads .....	28
2.14 Contract Language.....	29
2.15 Voting Convenience Centers .....	29
<b>3.0 Transition Plan</b> .....	<b>30</b>
3.1 ADA Coordinator .....	30
3.2 Public Review and Comment.....	32
3.3 Priorities for Barrier Removal.....	32
3.4 Proposed Solutions for Barrier Removal .....	33
3.5 Estimating .....	33
3.6 Barrier Removal Summary Conclusions.....	33
3.7 Fire Stations .....	34
3.8 Facilities .....	35
3.9 Conclusion.....	36

## Appendices

Appendix A.....State of New Mexico Map of Counties  
Appendix B.....Doña Ana County Organizational Chart  
Appendix C.....Code of Doña Ana County, Chapter 45: Human Resources  
Appendix D.....Doña Ana County Maps by District  
Appendix E.....JGMS Physical Barriers Report  
Appendix F.....Doña Ana County ADA Grievance Procedure  
Appendix G.....Doña Ana County ADA Notice to the Public  
Appendix H.....Doña Ana County Audit of Programs, Activities, and Services  
Appendix I.....Doña Ana County Self-Evaluation Public Outreach  
Appendix J.....Doña Ana County ADAAC Notification Distribution List  
Appendix K.....Job Accommodation Network (JAN) Snap Tool Results  
Appendix L .....Doña Ana County Road Inventory 2017  
Appendix M.....Doña Ana County Contract for Goods and Services (Sample)  
Appendix N.....Doña Ana County 2018 List of Voting Convenience Centers



Doña Ana County

*"Character Counts"*

845 N. Motel Blvd. Las Cruces, New Mexico 88007 (575) 647-7210

## **Doña Ana County Board of County Commissioners**

**Billy G. Garrett, District 1 County Commissioner**

**Ramon S. Gonzalez, District 2 County Commissioner**

**Benjamin L. Rawson, District 3 County Commissioner**

**Isabella Solis, District 4 County Commissioner, Chair**

**John L. Vasquez, District 5 County Commissioner, Vice-Chair**

**Chuck McMahon, Interim County Manager**

**Vincent S. Pokluda, Assistant County Manager**

**Robert Armijo, Interim Assistant County Manager**

**Meg Haines, ADA Coordinator**

**845 N. Motel Blvd.**

**Las Cruces, NM 88007**

**Voice (575) 647-7210**

**Fax (575) 525-5888**

**TTD (575) 525-5951**

**EEO@donaanacounty.org**



## 1.0 Summary

### 1.1 Doña Ana County

Doña Ana County is a political subdivision of the state of New Mexico and was formally recognized by the New Mexico state legislature in 1852.<sup>1</sup> As a political subdivision, Doña Ana County derives its authority from the New Mexico Constitution and laws adopted by the legislature of the state New Mexico.<sup>2</sup> The laws provide the framework for county government, describe the powers conferred on the county and its various elected officials, and specify the functions of the county government and each elected official.<sup>3</sup> A map of the State of New Mexico identifying all counties has been included. (*Appendix A*)

The political and corporate powers of the county government are exercised by a Board of County Commissioners.<sup>4</sup> The Board of County Commissioners (Board) of Doña Ana County (County) consists of five members, all of who are elected according to state law. The powers of a county government may be categorized as legislative, executive, and administrative.<sup>5</sup> Some of its more broadly defined powers include managing county revenues, overseeing county property, creating and maintaining the county's infrastructure (roads, highways, bridges, waste water systems and airports), planning and zoning, public works, providing for health and welfare, conducting elections, law enforcement, detention, and personnel administration<sup>6</sup>. An organizational chart for Doña Ana County has been included. (*Appendix B*)

Doña Ana County is a large employer in the southern region of the state of New Mexico. Therefore, providing the framework for and maintaining a policy concerning the employment relationship is highly desirable. The Board established a human resources policy by ordinance for the express purpose of establishing a merit system for all phases of the employment process, including the "general regulation of County employees."<sup>7</sup> (*Appendix C*) The human resources policy ordinance mandates fair treatment and equal employment opportunity without regard to protected class. Under the ordinance, the Board vests the authority to administer a human resources system in the Human Resources Director under the supervision of the County Manager and with the consent of the Board.

---

<sup>1</sup> Historical Records Survey sponsored by the New Mexico Historical Records Survey, undated, referring to L.N.M., 1851, p. 120.

<sup>2</sup> The New Mexico County Commissioner Handbook, The NM EDGE County College, 2016 Ed., page 5.

<sup>3</sup> *Ibid.* at pp 6-8.

<sup>4</sup> The New Mexico County Commissioner Handbook. The NM EDGE County College. 2016 Ed. Page 6. *See also* New Mexico Statutes Annotated, 1978, Section 4-38-1 (1953).

<sup>5</sup> *Ibid.* at page 33-34.

<sup>6</sup> The New Mexico County Commissioner Handbook. The NM EDGE County College. 2016 Ed. Page 34.

<sup>7</sup> Doña Ana County, N.M. Ordinance 235-2008 (April 8, 2008) *codified at* Doña Ana County, N.M., Code of Doña Ana County, Ch. 45.

## 1.2 *Americans with Disabilities Act Overview*

The Americans with Disabilities Act (ADA) of 1990 is a civil rights statute that prohibits discrimination against individuals with disabilities. The legislation was enacted in response to congressional findings that discrimination persists in critical areas of society such as employment, housing, public accommodations, education, transportation, communication, recreation, institutionalization, health services, voting, and access to public services. (42 U.S.C. Section 12101 (a) (3).) The ADA was intended as a comprehensive national mandate to eliminate discrimination against individuals with disabilities. (42 U.S.C. Section 12101 (b) (1).) The goals of the ADA “are to assure equality of opportunity, full participation, independent living, and economic self-sufficiency” for individuals with disabilities. (42 U.S.C. Section 12101 (a) (7).)

The ADA was amended by President George W. Bush in September 2008, (hereinafter referred to as the ADA or the Act) with a statutory effective date of January 1, 2009. The effect of the amendment was to broaden the scope of protections afforded individuals with disabilities. The spirit of the law is one of inclusion. To that end, public entities, such as Doña Ana County, are obligated to ensure accessibility and usability of their programs, activities, and services so that individuals with disabilities have the opportunity to enjoy, participate in, or benefit from a public entity’s programs, activities, and services in the most integrated setting possible.

The Act is comprised of five (5) separate titles as follows:

Title I - Employment

Title II - Public Services

Title III - Public Accommodations and Services Operated by Private Entities

Title IV - Telecommunications (Now codified at 47 U.S.C. Section 225.)

Title V - Miscellaneous Provisions

Title I protects individuals with disabilities from employment discrimination in regard to pre-employment processes and procedures; hiring, promotion, or discharge; compensation; training; and other terms, conditions, or privileges of employment. (42 U.S.C. Section 12112 (a).) It is an employer’s duty to make every effort to provide an effective accommodation for an applicant during the pre-employment process or for a current employee during the employment relationship. An individual with a disability must be given the same consideration for employment as individuals without disabilities. As long as an individual is qualified for an employment opportunity, the individual cannot be denied the opportunity simply because of a disability.

Title II prohibits a public entity from excluding an individual with a disability from benefiting from or participating in a public entity's services, programs, or activities or being subjected to discrimination. (42 U.S.C. Section 12132.) The duty to provide an effective accommodation is extended to a public entity's affiliate agencies or agencies that provide services on behalf of the public entity. Examples of public services covered by the ADA include:

- Public transportation
- Government facilities
- Public schools and universities
- Recreation and state parks

Title III ensures that an individual with a disability will be provided full and equal enjoyment of a public accommodation's goods, services, facilities, privileges, advantages, or accommodations. (42 U.S.C. 12182 (a).) Examples of public accommodations include:

- Public gathering places (restaurants, bars, movie theaters, etc.)
- Places of lodging (hotels, motels, inns)
- Retail stores
- Social service centers

Title IV, the Telecommunications Act of 1934, requires that telephone providers, manufacturers, and carriers must ensure that telecommunication services, equipment, and functions are accessible to and useable by individuals with disabilities.

Title V of the ADA contains supplemental regulations that are not explicitly covered in other parts of the ADA. These topics include (but are not limited to):

- **Other Federal & State Laws:** The ADA does not invalidate or limit other federal or state laws addressing the civil rights of individuals with disabilities. In fact, the ADA permits federal agencies and states to provide greater protection for individuals with disabilities than what the ADA provides.
- **State Immunity:** States are prohibited from asserting immunity against a violation of the requirements of the ADA, thus, ensuring that individuals with disabilities have legal recourse in either state or federal court.
- **Retaliation:** This provision protects individuals who engage in a protected activity related to the ADA. Protected activities include opposing an act or practice made unlawful by the ADA, filing a charge of discrimination under the ADA, or aiding in a proceeding related to the ADA. The section also prohibits threatening, intimidating, coercing, or harassing any individual who has made or been granted an accommodation request pursuant to or sought the protection of the ADA.

- **Attorney's Fees:** At the discretion of a judge, the prevailing party to a lawsuit is entitled to reasonable attorney's fees, litigation expenses, and costs.
- **Technical Assistance:** Federal agencies delegated enforcement authority are also delegated the responsibility to provide technical assistance to entities covered under the ADA.

The federal government takes a central role in enforcing the standards set forth in the ADA on behalf of individuals with disabilities. (42 U.S.C. Section 12101 (b) (3).) Title I enforcement powers have been delegated to the Equal Employment Opportunity Commission. Title II, Part A, enforcement powers have been delegated to the Department of Justice.

### **Program Accessibility Requirements**

A public entity violates the ADA when an individual with a disability is excluded from participating in or denied the benefit of any of its programs, activities, or services or is subjected to discrimination because the public entity's facilities are inaccessible or unusable. (28 C.F.R. Section 35.149.) The programs, activities, or services include those provided by or made available by a public entity. (28 C.F.R. 35.102.) Public entities are mandated to operate **each** program, activity, or service so that it is readily accessible and usable by individuals with disabilities. (28 C.F.R. Section 35.150.) The accessibility and usability standard by which to measure a public entity's programs, activities, and services is referred to as program accessibility.

There are five (5) broadly-defined barriers to accessibility. They are:

- **Attitudinal.** Attitudinal barriers are based on assumptions, stereotypes, ignorance, or fear.
- **Physical.** Architectural barriers include physical building structures and outdoor spaces.
- **Technological.** Technological barriers occur when a technological design or software or hardware makes using the technology difficult for an individual with a disability.
- **Communications.** Informational barriers prevent people from communicating with each other.
- **Organizational.** Organizational barriers occur when an organization's policies or operational practices discriminate against individuals with disabilities.

A public entity, as an employer and an organization operating public services, has an opportunity to dispel attitudinal barriers. Through supervisory and employee training and granting citizens' accommodation requests, a public entity can provide education on its obligations under the law and information concerning reasonable accommodations.

The Department of Justice adopted physical structure accessibility design standards, **2010 ADA Standards for Accessible Design (2010 Standards)**. The **2010 Standards** set minimum scoping and technical requirements for newly designed and constructed or altered state and local government facilities after March 15, 2012. The 2010 Standards is comprised of the Title II regulations for new construction and alterations, 28 C.F.R. Section 35.151, and the **2004 ADA Accessibility Guidelines (ADAAG) codified at 36 C.F.R. Part 1191**. The scoping and technical requirements address accessibility to sites, facilities, buildings, and interior elements.

Public entities are integrating the use of technology both as a means of communicating information and as a way to provide programs, activities, and services. During the development and implementation of any technology, public entities must be mindful of the end user. Care must be taken to ensure that technology does not frustrate an individual's access to a public entity's programs, activities, or services.

Communication, whether presented aurally or visually, must be available in alternative formats that permit the effective exchange of information for individuals with disabilities. Methods of effective communication may require providing any number of auxiliary aids or services and may include modification of equipment or devices. (28 C.F.R. Section 35.104.)

A public entity has a duty to make reasonable modifications to its policies, practices, and procedures to ensure access to its services, programs, and activities unless the modification would fundamentally alter the nature of the service, program, or activity. (28 C.F.R. Section 35.130 (b) (7) (i).)

Program accessibility may be achieved by either structural or non-structural methods. Structural methods include altering existing facilities or acquiring or constructing new facilities. A public entity may prefer to choose non-structural methods to achieve program accessibility. Non-structural methods include but are not limited to acquiring or redesigning equipment, using assistive aids, or providing services in an alternative format. (Technical Assistance Manual II-5.2000.) When determining and selecting a method of providing program access, the County will give priority to the method that will result in the most integrated setting appropriate to encourage interaction among all users, including individuals with disabilities.

### **Requirements of a Transition Plan**

The federal regulation implementing the ADA in state and local government services sets forth specific requirements for an acceptable transition plan. The elements of the plan should include:

- The name of the individual responsible for the plan's implementation;

- A list of the physical barriers preventing or limiting accessibility to the public entity's facilities;
- A detailed description of the methods to be used to make the facilities accessible;
- A schedule for taking the steps necessary to achieve program accessibility compliance;
- A schedule for providing curb ramps, if applicable; and
- Opportunity for interested parties to participate in the development of the plan.

## 2.0 Self-Evaluation

Doña Ana County's goal is to ensure full compliance with the ADA. The County believes that in order to provide services to all, the County's programs, activities and services must be accessible. Doña Ana County is committed to making changes to remove any barriers to access.

28 CFR Part 35 § 35.105 Self-evaluation. (a) A public entity shall, within one year of the effective date of this part, evaluate its current services, policies, and practices, and the effects thereof, that do not or may not meet the requirements of this part and, to the extent modification of any such services, policies, and practices is required, the public entity shall proceed to make the necessary modifications.

28 CFR Part 35 § 35.105 Self-evaluation. (c) A public entity that employs 50 or more persons shall, for at least three years following completion of the self-evaluation, maintain on file and make available for public inspection.

As a public entity, Doña Ana County periodically reviews policies and procedures. While reviewing policies and procedures, the County determined that it would conduct another self-evaluation to update the ADA Transition Plan.

On November 8, 2011, through resolution 2011-72, the Board of County Commissioners of Doña Ana County re-established the Doña Ana County Advisory Committee on the Americans with Disabilities Act (ADAAC) which had previously been established through resolution 2001-74 on August 14, 2001. The advisory committee has been focusing its efforts on planning and executing the self-evaluation of the County's programs, activities, and services. The committee has been typically meeting once per month and public input has been encouraged.


Doña Ana County has completed this self-evaluation of all County facilities, including the public right-of-way, current services, policies, and practices. Information obtained through the self-evaluation will be used to update Doña Ana County's ADA Transition Plan.


The self-evaluation included the following:

- 1) Facilities Audit- ADA Checklists were completed for all County owned buildings that are open to the public;
- 2) Review and update of the Doña Ana County ADA grievance procedure;
- 3) Review and update of all policies and practices that govern the administration of the County's programs, activities, and services;
- 4) Identification of current County programs, activities, and services;
- 5) Soliciting feedback from the community, especially persons with disabilities, and advocacy groups in identifying and offering corrective measures to ensure accessibility.
- 6) Review of all County-owned roads.

These areas will be documented in detail below by explaining the process taken and the information obtained. Details of barriers identified will then be addressed in the transition plan for correction.

## 2.1 Facilities Audit

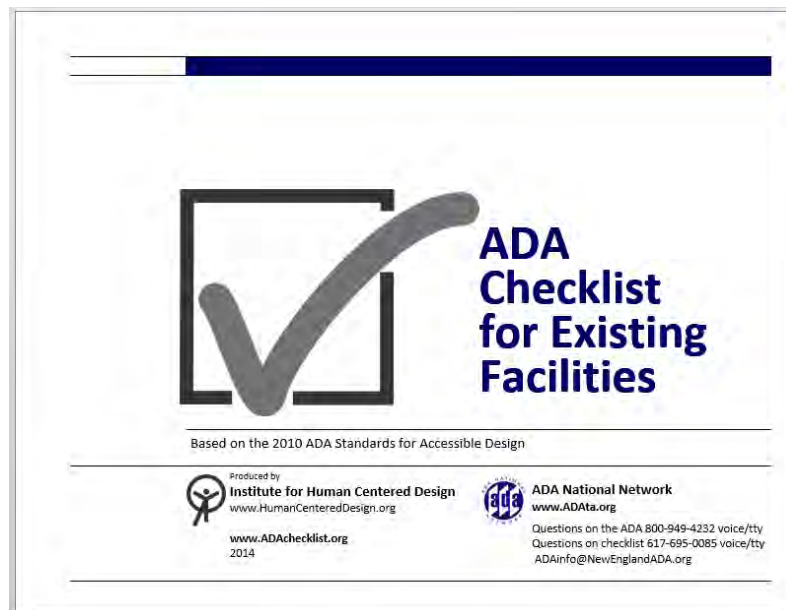

Doña Ana County contracted with J.G. Management Systems, Inc. (JGMS) to conduct ADA checklists on County buildings. The checklists were based on the 2010 ADA Standards for Accessible Design. 

There were a total of sixty-eight ADA Checklists completed on facilities with public access between October 13, 2015 and January 24, 2016. Maps are included by district identifying the facilities. (*Appendix D*)

The list of facilities that received the accessibility audit included:

- Chamberino Fire Station New
- Chaparral Fire Station
- Fairacres Fire Station
- Fire Administration
- Fire Station 11
- Fire Station 14
- Fire Station 2
- Fire Station 5-1
- Fire Station 6
- Fire Station 8
- La Mesa Fire Station
- La Mesa Fire Station Old
- La Union Fire Station
- Las Alturas Fire Station
- Mesquite Fire Station
- Organ Fire Station
- Santa Teresa Fire Station 14
- Santa Teresa Hazmat
- South Valley Fire Station
- Talavera Fire Station
- Berino Ball Park Restroom
- Adult Detention Center
- Animal Control Office
- Butterfield Community Center
- Chaparral Community Center
- Chaparral Community Health
- Chaparral Restroom & Concession Stand
- Colquit Park Building
- Colquit Park Restrooms Building
- Crisis Triage Center
- DASO Training Facilities
- DASO- Doña Ana Public Health
- De La O Restroom
- De La O Saloon/Visitor Center
- Del Cerro Community Center
- Delores Wright Education Center
- Doña Ana Ball Field Concession/Restrooms
- Doña Ana Boxing Facility
- Doña Ana Community Center
- East Mesa Public Health
- Fairgrounds- Administrative Office
- Fairgrounds- Restroom Building West
- Fairgrounds- Restroom New
- Fleet Building
- Gazebo
- Government Center/Radio & Fleet Shop
- Judicial Complex
- Juvenile Detention Center
- La Mesa Community Center
- La Mesa Concession Stand & Restroom
- La Pinon Office
- Maintenance Shop
- Mesquite Community Center
- Mesquite Concession & Restroom
- Organ Community Center
- Placitas Community Center
- Public Building A West
- Public Health Building
- Radium Springs Community Center
- Rincon Community Center
- Sheriff's Substation
- Speedway Restroom
- SVC – Community Health Center
- SVC – Senior Center
- SVC – Sheriff's Substation
- Vector Control
- Veterans Administration
- West Speedway Restroom



## *2.2 Facility Self-Evaluation Findings*

The ADA Checklists for Existing Facilities based on the 2010 ADA Standards for Accessible Design are divided into three sections:

- Approach & Entrance
- Access to Goods & Services
- Toilet Rooms

JGMS compiled the findings in a report which identified barriers to access. (Appendix E) The barriers; as well as proposed solutions, and estimated cost will be included in the Transition Plan.

## *2.3 Review of Doña Ana County ADA Grievance Procedure*

The Doña Ana County Americans with Disabilities Act Advisory Committee (ADAAC) reviewed the County's current ADA grievance procedure and proposed version on February 20, 2014, at a regularly scheduled ADAAC meeting. County staff had attended a National ADA Symposium and received a Department of Justice approved format which led Doña Ana County to review and revise the grievance procedure. The ADAAC approved the proposed version along with the existing grievance form. (Appendix F) As the procedure indicates, the grievance form is available upon request. However, **"Failure to use this form in no way compromises the grievance procedure"**.

## *2.4 Review and update of all policies and practices that govern the administration of the County's programs, activities, and services*

The ADAAC reviewed the County's current Americans with Disabilities Act Notice to the Public and a proposed version on February 20, 2014, at a regularly scheduled ADAAC meeting. The ADAAC approved the proposed version which is currently available to the public. (Appendix G)

Doña Ana County Board of County Commissioners adopted a human resources policy ordinance that mandates fair treatment and equal employment opportunity and prohibits discrimination or harassment.<sup>8</sup> Under the ordinance, the Board vests the authority to administer a human

---

<sup>8</sup> Doña Ana County, N.M., Code of Doña Ana County (The Code of Doña Ana County), Human Resources, Ch. 45, Sections 45-2. B. and 45-5 (2011) at <http://www.ecode360.com/DO2860>.

resources system in the Human Resources Director under the supervision of the County Manager and with the consent of the Board.<sup>9</sup>

The Human Resources Policies and Procedures express and define the County's commitment to equal employment opportunities; a workplace free of discrimination; and an environment free of retaliation.<sup>10</sup> The last amendment to the Human Resources Policies and Procedures manual was on August 23, 2016.

***The Human Resources Policies and Procedures Manual, Section 2-1. Equal Employment Opportunity*** states:

"The County shall provide equal employment opportunities to all individuals and shall not discriminate against any individual on the basis of protected class as defined by Federal and State law including: race, color, age, religion, sex, sexual orientation, gender identity, national origin, ancestry, physical or mental disability or medical condition, or any other legally protected status. This anti-discrimination policy applies to all phases of the employment process and includes a prohibition of retaliation against anyone who has asserted his/her rights under this policy.

All people with disabilities shall be free from unlawful discrimination and provided equal opportunity in accordance with the Americans with Disabilities Act (ADA). The County does not discriminate on the basis of disability in employment or in the admission and access to its programs, activities, or services. This policy applies equally to employees of the County and members of the general public who access public services through County departments and related agencies."

***The Human Resources Policies and Procedures Manual, Section 2-2. Discrimination*** describes the County's commitment to maintaining an environment which is free from all forms of unlawful discrimination. The policy describes the prohibition against unlawful discrimination based on "race, color, religion, gender identity, sexual orientation, sex, national origin, age, disability, and political affiliation."

***The Human Resources Policies and Procedures Manual, Section 2-3. Discrimination and Harassment Procedures*** describes the process by which an individual may file a complaint of discrimination or harassment with the County, the Equal Employment Opportunity Commission, and/or the New Mexico Human Rights Division.

---

<sup>9</sup> Doña Ana County, N.M., Code of Doña Ana County (The Code of Doña Ana County), Human Resources, Ch. 45, Sections 45-6 (2011) at <http://www.ecode360.com/DO2860>.

<sup>10</sup> Doña Ana County Human Resources Policies and Procedures Adopted May 28, 2008, Amended December 9, 2014, Sections 2-1, 2-2, 2-3.

## 2.5 Audit of County Programs, Activities, and Services

In January 2017, the Doña Ana County ADA Coordinator sent out a program departmental survey to department heads to fill out and identify their programs, activities, and services. The ADA Coordinator along with the guidance of the ADAAC created the survey questions. A total of twenty-three surveys were completed. The survey answers were compiled and were reviewed during a regularly scheduled ADAAC meeting. The ADAAC members and guests from the public were invited to comment and share suggestions.

The complete survey with all responses is attached. (Appendix H) The following are questions from the survey in which there were suggestions from the ADA Coordinator and feedback from the ADA Advisory Committee:

**Survey Question: A2. Does your department have a process for responding to requests for accommodation that would allow people with disabilities to participate in your program?**

### Responses:

- Voting machines are ADA accessible. Voters can bring someone to assist. Curb-side voting is available. *Clerk's- Bureau of Elections*
- Refer person to EEO Specialist/ADA Coordinator. *Human Resources*
- Typically our front desk staff and compliance monitors after some interaction with offenders are able to identify if they have special needs (intake questionnaire). *HHS- Court Compliance*
- Our staff works to meet the needs, and if unable to we contact the ADA Coordinator. *HHS- Program Operations*
- We consult with ADA Coordinator and/or Risk Management if we need assistance. *HHS- Court Compliance*
- All persons are open to receive law enforcement services within the county of Doña Ana. *Sheriff's Office- Operations*
- Interpreter services will be provided. Service animals allowed. *Public Works- Airport*

### Recommendation(s):

1. Provide written procedures to Detention Center Officers and Sheriff's Deputies if they do not already exist.

2. ADA Coordinator will send out an email to all employees advising them of the ADA Office Webpage and the County notices and services provided.

**Survey Question: A3. Have you received any complaints regarding physical/program access for people with disabilities?**

**Responses:**

- Yes, Project HOME, safe taxi transportation for people who have been drinking was asked if we can accommodate disability so we added a handi-van to each night of service. *HHS- Court Compliance*
- Yes, Compliance officers have voiced that not all cubicles are wheel-chair accessible. *HHS- Court Compliance*
- Yes, at the end of County Senior Resource and Informational Fair, we received some concerns that the vendor tables were too close together making it difficult for people with mobility challenges. We're taking all suggestions received in the post event evaluations into consideration including the spacing of the tables to improve future events. *County Manager- Community & Constituent Services Office*

**Recommendation(s):**

1. ADA Coordinator will send out the email mentioned above and will mention the ADA public grievance process. Additionally, ADA Coordinator will request that any complaints handled by the department or program directly be communicated to ADA Coordinator.

**Survey Question: A4. Have you received any complaints regarding communication issues for people with disabilities?** All responded with "no".

**Recommendation(s):**

1. ADA Coordinator will send out the email mentioned above and will mention the ADA public grievance process. Additionally, ADA Coordinator will request that any complaints handled by the department or program directly be communicated to ADA Coordinator.

**Survey Question: B1. How do you notify all persons (employees, applicants, participants, beneficiaries, volunteers, visitors, and other interested parties including those with visual and/or hearing disabilities) of their right to participate in your programs regardless of their disability?**

**Responses:**

- Through the application process; on the website; with each meeting notice. *Human Resources*

- We have not made any attempt at outreach. *Airport*
- Our office does not provide programs. *Office of Emergency Management*
- The courts determine our participants regardless of any disability. *HHS- Court Compliance*
- We don't notify them but we take anyone that the courts order to our office. *HHS- Court Compliance*
- Verbally. *Community Development*
- On Request. *Fire Administration*
- Not sure how to answer this question. The public notification of our events and programs are done by the Public Information Office. *County Manager- Community & Constituent Services Office*
- We allow persons to participate in everything that we do at the centers. If there is a person that needs assistance, the center staff will call and we will help provide assistance to the resident. *HHS- Outreach & Education*
- We provide all pertinent information to our Public Information Office and they take care of this for us. *Flood Commission*
- Notices are advertised on all county information. *Facilities, Parks & Vector Control*
- Local Media Notices include disclosures. *Treasurer's*
- Local Paper. *Finance*
- The events are public community events such as festivals. I am not aware of any notices. *Clerk's- Recording & Filing*
- Public and social media. *Sheriff's Office- Operations*
- We have boilerplate language. *Public Information Office*
- Newspaper, mailers and posting on the County website. *Utilities*
- Mandatory orientation new employees. *Probate*
- We have information about ADA voters in our election official training. *Clerk's- Bureau of Elections*
- Training offered by EEO Specialist/ADA Coordinator. *Human Resources*
- HR Training. *Engineering*

- The maintenance worker refers all requests to me. I have only one. *Public Works-Airport*

**Recommendation(s):**

1. ADA Coordinator will send out information to all departments of required wording that needs to be included on all communication notices for public programs, activities, and services.

**Survey Question: B2. Do you include the following statement on your County sponsored meeting or event agendas?**

**NOTE:** Doña Ana County will ensure effective communication with individuals with disabilities and will, upon request, provide auxiliary communication aids and services to afford those individuals equal opportunity for participation in Doña Ana County sponsored meetings, events, or activities. Any request should be made to the Americans with Disabilities Act Coordinator, in writing, or by phone, **at least two business days** prior to the event at which accommodation is needed. If you have any questions regarding examples of reasonable accommodations, please contact the ADA Coordinator, at 525-5884 (voice) or 525-2951 (TTY), 845 N. Motel Blvd., Las Cruces, NM 88007.

**Responses:**

- Yes- *Human Resources*
- Do not sponsor any public programs- *Airport*
- Yes- *Community & Constituent Services*
- Yes- *HHS- Outreach and Education*
- Yes- *Facilities, Parks & Vector*
- Yes- *Grants*
- Yes- *Treasurer's*
- Yes- *Public Information Office*

**Recommendation(s):**

1. ADA Coordinator will send out information to all departments of required wording that needs to be included on all communication notices for public programs, activities, and services.
2. Periodically hold training for supervisors on what constitutes a program, activity, and service.
3. For airport, train on what constitutes services, activities, and programs.

**Survey Question: B3. How do you notify all persons about how and with whom to file a disability discrimination complaint?**

**Responses:**

- Would direct them to the process in policy or to the ADA Specialist- *Human Resources*
- Hasn't happened/ Refer to HR and/or ADA Coordinator- *Engineering*
- We have never received a disability discrimination complaint- *Airport*
- We refer them to the County ADA Coordinator- *Office of Emergency Management*
- We don't as far as I know- *HHS- Court Compliance*
- I am not aware that we make this notification- *HHS- Court Compliance*
- Haven't been asked- *Animal Control & Codes*
- HR Orientation; attending the course is a requirement- *Fire*
- If our office received such a complaint, we would refer the person to Meg Haines, ADA/EEO Specialist, in the HR Dept. – *Community & Constituent Services*
- Staff would refer the complaint to me and I would refer them to HR- *HHS- Outreach & Education*
- We have not had to do this. I assume HR would assist with this- *Flood*
- Public Notice- *Facilities, Parks & Vector Control*
- If I am ever confronted with these questions, I refer them to HR- *Grants*
- Printed disclosures- *Treasurer's*
- If I ever receive a complaint I would call HR and ask whom is the ADA compliance rep and notify them and ask for guidance- *Clerk's- Recording & Filing*
- N/A- *Sheriff's Office- Operations*
- We refer them to HR and the ADA Coordinator- *Public Information Office*
- Never had to, but I would refer them to our HR ADA Coordinator- *Utilities*

**Recommendation(s):**

1. ADA Coordinator will send out the email mentioned above and will mention the ADA public grievance process. Additionally, ADA Coordinator will request that any complaints handled by the department or program directly be communicated to ADA Coordinator.

**Survey Question: C3. Does anyone on your staff have experience working with people with disabilities? Please describe.**

**Responses:**

- We have had a couple of situations in the past with a hearing impaired individual and more often with someone in a wheelchair or mobile device. With the hearing impaired we were able to work with ADA Coordinator to obtain services and with those with mobility issues we have a couple of cubicles that are wheelchair accessible and we use those if needed- *HHS- Court Compliance*
- Yes- *Sheriff's Office*
- Yes. Staff work with peers in the mental health programs and assists people in accessing state services- *HHS- Program Operations*
- Yes. Past HR experience- *Animal Control & Codes Enforcement*
- Yes. Providing medical care to individuals- *Fire Administration*
- Yes. There are many people whom we encounter during the course of our lives that may have visible or invisible disability. I'm not aware of all my staffs experience in this area; I can say that in my prior employment, I collaborated with the Superior Alliance for Independent Living (SAIL) on numerous constituent cases; I also reached out to Sally Conway at the U.S. Department of Justice, who I consider an ADA guru- *Community & Constituent Services*
- Yes. In my previous employment, our mission was to hire individuals with disabilities and help them to have a productive life- *Grants*
- Yes. We have a handicap station that is manned at all times by a member of the staff to attend to people with disabilities- *Treasurer's*
- Yes. All of our officers receive the required state amount of training in dealing with people- *Sheriff's Operations*
- Yes. One of my staff has experience- *Public Information & Special Projects*
- Yes. Some of our customers have disabilities, our payment window is wheelchair accessible- *Utilities*

**Recommendation(s):**

1. Provide sensitivity training.

**Survey Question: C4. Does your department emergency evacuation plan reflect assisting any people with disabilities? Please describe.**



**Responses:**

- Yes. If elevators are reasonably believed to not be imperiled by fire, and the electrical system is not compromised, the elevator may be used to evacuate the handicapped to the first floor. If the elevators are not available, the individual will need to be helped down the stairs in the safest means possible- *Office of Emergency Management*
- Yes. Newly hired staff, typically document technicians, that run the front desk are oriented in the process of evacuating the lobby area during an emergency situation and to assist anyone that may have a difficult time understanding or being able to evacuate in a timely manner. The emergency devices such as fire extinguishers, AED and stairway assistance devices are pointed out in the area- *HHS- Court Compliance*
- I do not know. We recently moved into the Government Center. Staff was trained on what door to go out and where to meet during a fire drill or other emergency evacuation- *Animal Control and Codes Enforcement*
- Yes. Facilities Staff response to emergency when it comes to the buildings- *Facilities, Parks & Vector Control*
- No. I believe there should be a plan posted adjacent to the emergency exit plan- *Grants*
- Yes. Take them to the assigned area- *Payroll and Accounts Payable*
- Yes. As prescribed by County- *Sheriff's Office Operations*
- No. We would create a plan in the event a person with disabilities were on our staff and subject to participation in a departmental evacuation- *Public Information & Special Projects*
- Yes. The department doesn't have a specific plan, we have a County plan that we follow- *Utilities*

**Recommendation(s):**

1. Disabled Occupants - If a disabled occupant is unable to exit the stairs from the second floor, they should wait for emergency response personnel at the Disabled Rescue Area. This area is located between the stairways on the second floor in the rotunda and has been identified by our fire department. Transporting of disabled individuals up or down stairwells should be avoided unless imminent life-threatening conditions exist. A more comprehensive plan for the government center is in the process of being prepared.

**Survey Question: D1. If there are forms that are required for the admission process to the program(s), please attach them.**

**Responses:**

- Ride Along procedures and application.doc- *Animal Control & Codes Enforcement*

**Recommendation(s):**

1. For the ACO & Codes ride along application, include required wording that needs to be included on all communication notices for public programs, activities, and services.

**Survey Question: D7. Does your department organize special events or do you help facilitate special events?**

**Responses:**

- Have gone to County-sponsored information fairs- *Probate*
- Equipment Roadeo skills test (only open to government entities)- *Engineering & Roads*
- Emergency Action Planning for special events- *Office of Emergency Management*
- Roadside cleanups with school groups- *Animal Control & Codes Enforcement*
- Some fire districts host special events- *Fire Administration*
- Most of the events we plan, I guess, are considered special. They are mentioned above in question number seven- *Community & Constituent Services*
- When we have public meeting to discuss projects we work with the facilities department to obtain the meeting space- *Flood*
- We assist with Community & Constituent services events that are open to the public- *Grants*
- Public meetings with the Sheriff- *Sheriff's Operations*

**Recommendation(s):**

1. Ensure all departments that organize special events are aware of ADA accessibility requirements. Request departments contact ADA Coordinator prior to event.

**Survey Question: D8. Does your department contract with others to offer special events on County property?**

**Responses:**

- Air shows, aircraft display, cross-county run- *Airport*
- Medical providers offer classes and some services at community centers- *HHS Program Operations*

**Recommendation(s):**

1. Ensure all departments that contract with others are aware of ADA accessibility requirements. Request departments contact ADA Coordinator prior to event.

**Survey Question: D9. How do you ensure staff and outside organizations are aware of their obligations to facilitate participation of individuals with disabilities in these special events held on County property?**

**Responses:**

- Again, mandatory new employee orientation should cover this- *Probate*
- Training by ADA Coordinator and HR Policy- *Human Resources*
- War Eagle Air museum is primary sponsor of events and they are aware of ADA regulations- *Airport*
- Through County training- *Office of Emergency Management*
- For our division/program, courts mandate individuals to our program and we make accommodations as we see fit depending on the individual- *HHS- Court Compliance*
- Verbally- *Animal Control & Codes Enforcement*
- We do not- *Fire Administration*
- We have never been asked to do this- *Flood*
- Training- *Facilities, Parks & Vector Control*
- Information is delivered prior to the start of an event- *Grants*
- Yearly training- *Sheriff's Operations*
- The County offers training- *Public Information & Special Projects*
- No process is used- *Utilities*

**Recommendation(s):**

1. Continue ADA training at new hire orientation and continue periodic training.

**Survey Question: E1. & E2. Does your department allow the public to use electronic equipment such as copy machines, personal computers, etc? If yes, how do you ensure that the equipment is accessible to individuals with disabilities?**

**Responses:**

- We have public computers available. We have never had any complaints but this is good to get trained on and make sure it is accessible- *HHS- Outreach & Education*

- Title companies use the copier. The public use computers provided to them in our records room (vault). We also have a customer service desk outside the vault to assist- *Clerk's Recording & Filing*

**Recommendation(s):**

1. Ensure these areas are aware of the obligation to provide accessibility when requested.

**Overall Findings:**

- Overall, employees understand to contact the ADA Coordinator for any specific requests or complaints.
- Continue periodic training to ensure DAC's programs, activities, and services are accessible.
- Conduct sensitivity training for the Detention Center and the Sheriff's Office.
- Periodically remind staff of the required wording to notify the public that they can request an accommodation.

## 2.6 Public Outreach

During the self-evaluation process, Doña Ana County accepted comments from the public in identifying any barriers that might exist for persons with disabilities to access county-sponsored facilities or programs. The comment period was open from April 24, 2017, through May 12, 2017. Comments were solicited from the public through a press release and an ad placed in the Las Cruces Bulletin (weekly newspaper) sent out by the Office of Public Information & Special Projects. The ADA Coordinator also sent out letters to individuals, agencies, and advocates for disability rights. (Appendix I)

Two comments were received in reference to the solicitation:

1. From the Las Cruces office of the New Mexico Commission for the Deaf and Hard of Hearing. The response included information on replacing TTY/TDD phones with video phones; setting up Video Remote Interpreter (VRI) services; ensuring assistive listening devices (ALDs) are offered for any consumers who come in; and having Communication Access Real-time Translation (CART) services.

**Recommendation(s):**

- The County is in the process of researching the possibility of replacing TTY/TDD phones in the Detention Center and in the Sheriff's Office with video phone.
- The County is also in the process of researching the possibility of having a video phone set up in Human Resources for emergency interpretation instances.

- The County has ALDs available in the Commission Chambers in the Government Center and now has signs at the entrance of the building and the entrance to the Commission Chambers letting the public know.
- The County is working with Information Technology (IT) personnel for ALD options for off-site public meetings.

2. From a Doña Ana County citizen addressing transportation in the County. “Accessibility to County owned facilities or programs is only relevant if you can get there. Since there is no paratransit available in the County, and for that matter no transportation of any kind in most of the County, for some residents of the County it doesn't matter that you can access the facility if you have no way to get there.” “Why doesn't the County provide on demand, dial a ride service?”

**Recommendation(s):**

- See Section 2.9 Public Transportation section below.

Additional public outreach: The ADA Coordinator for Doña Ana County is part of the ADA Celebration committee. The committee’s membership is on a volunteer basis and many local government agencies participate in the planning of the annual celebration based on the anniversary of the signing of the original law enacting the Americans with Disabilities Act. The celebration is held on or around July 26. On July 26, 2017, the Doña Ana County ADAAC had a table at the ADA Celebration and explained to citizens the intent of the ADAAC. During the event, participants were asked if they would like to be notified of upcoming ADAAC meetings and when the revised transition plan was available for review. (*Appendix J*) There were a total of four individuals who indicated interest and were added to the distribution list.

## *2.7 Staff Training*

The ADA does not require any specific training for the ADA Coordinator or staff of a public agency. However, Doña Ana County management knows that on-going compliance with the ADA and similar Federal and State laws can only be done with educating staff on their responsibilities and the rights of individuals with disabilities.

The ADA Coordinator and back-up ADA staff have attended the ADA National Symposium. The ADA Coordinator attends annual Equal Employment Opportunity Commission seminars which typically cover case law regarding the ADA. The ADA Coordinator is a certified professional in human resources (PHR), a SHRM Certified Professional (SHRM-CP), and a Certified Program Planner (CPP).

The ADA Coordinator provides employee and supervisor training. This training is performed periodically. The most recent supervisor training was conducted in January 2017 and employee training was conducted in February 2017. The training has recently been made available on-

line for employees to watch if they cannot attend in-person. The ADA Coordinator also provided a short training for all County employees on service animals in August 2017.

**Recommendation(s):**

- Based on the program departmental survey mentioned above, more training needs to be done in specific areas and will be addressed in the transition plan.
- Continue development of ADA Coordinator to include becoming a certified ADA Coordinator.

## ***2.8 Public Meetings***

Public meetings are typically held on a routine basis within the County. As mentioned above in the program departmental survey, the County needs to ensure that persons with disabilities are not being excluded from programs, activities, or services.

The following boards/committees hold regular meetings open to the public:

- Board of County Commissioners
- Planning and Zoning Commission
- Doña Ana County ADA Advisory Committee
- Jetport Advisory Board
- Doña Ana County Development Review Committee
- Doña Ana County Labor Management Relations Board

Ensuring staff have the correct wording is important in order to properly advertise events and to let the public know they can request an accommodation. Signs should be posted at the front of buildings that hold public meetings letting participants know that assistive listening devices (ALDs) are available.

## ***2.9 Public Transportation***

Doña Ana County does not provide transportation to programs, activities, and services. Nor does the County have a public transit system. The South Central Regional Transit District (SCRTD) provides commuter bus services to Otero, Sierra, and Doña Ana County. Doña Ana County currently provides some funding to SCRTD. Based on 49 CFR Part § 37.121 Requirement for comparable complementary paratransit service (c), requirements for complementary paratransit do not apply to commuter bus, commuter rail, or intercity rail systems. SCRTD is considered commuter bus service and does not offer paratransit services.

In January 2017, Assistant County Manager Vincent S. Pokluda researched several possibilities regarding providing a paratransit system. At that point in time, it was found that SCRTD did not have the capacity or the resources to investigate this or branch out. The County did not have the resources to enter a Joint Powers Agreement (JPA) with other government entities.

**Recommendation(s):**

- The County can continue to look into various areas of funding to potentially offer paratransit services to residents.
- The local ambulance service might be another option to offer medical transit.
- A non-profit agency may want to review this opportunity.

### *2.10 Emergency Evacuation*

The Doña Ana County/City of Las Cruces Office of Emergency Management (OEM) is responsible for the coordination of all hazard emergency efforts allowing Doña Ana County to mitigate against, prepare for, respond to, and recover from any type of natural or human-caused disaster. The OEM office serves as the liaison between the State and local government subdivisions. The OEM office is responsible for maintaining the County's All Hazard Emergency Operations Plan (AHEOP). The AHEOP was final January 20, 2011 and is currently still in use; however, the plan is in the process of being updated and should be approved in early 2018.

Alerting the public to an emergency is an important component of emergency management. The Mesilla Valley Regional Dispatch Authority (MVRDA) was created in 1989 through a Joint Powers Agreement between the City of Las Cruces and Doña Ana County, becoming the first consolidated dispatch center in the State of New Mexico. MVRDA provides dispatch and emergency communication functions for all emergency response agencies of the City of Las Cruces, City of Sunland Park, City of Anthony, Town of Mesilla, Village of Hatch, and Doña Ana County. In the event of a natural or man-made disaster, Mesilla Valley Regional Dispatch Authority will perform in the role of the Emergency Communications Network for disaster response, relief, and recovery.

**Recommendation(s):**

- It is recommended that during OEM's training exercises that individuals with disabilities be invited to participate or provide comment. Doña Ana County and the City of Las Cruces both have ADA Advisory Committees. Information should be passed on to these committees when training exercises will be performed.

### *2.11 Employment*

Title I protects individuals with disabilities from employment discrimination in regard to pre-employment processes and procedures; hiring, promotion, or discharge; compensation; training; and other terms, conditions, or privileges of employment. (42 U.S.C. Section 12112 (a).) It is an employer's duty to make every effort to provide an effective accommodation for an applicant during the pre-employment process or for a current employee during the employment relationship. An individual with a disability must be given the same consideration for employment as individuals without disabilities. As long as an individual is qualified for an employment opportunity, the individual cannot be denied the opportunity simply because of a disability.

As of July 1, 2016, Doña Ana County implemented a new on-line applicant tracking system called iCIMS. Doña Ana County is an Equal Employment Opportunity Employer. It is our policy to abide by all federal and state laws prohibiting employment discrimination solely on the basis of a person's race, color, creed, national origin, religion, age, gender, marital status, disability, gender identity, sexual orientation or any other unlawful criteria, except where a reasonable Bona Fide Occupational Qualification exists.

Doña Ana County will make reasonable accommodation(s) for the known physical or mental limitations of an applicant with a disability, upon request, unless the accommodation(s) would cause an undue hardship on the operation of the County. The County has the ADA Office web address on the application process page of the job opportunities webpage and has the Human Resources main phone line listed for assistance.

As part of the self-evaluation process, Doña Ana County had the applicant tracking system checked using the Job Accommodation Network (JAN) SNAP Tool. JAN's SNAP process is: 1) Self assess your online systems with your selected team, 2) **No** is not an answer to accessibility modifications, 3) **Accept** challenges from all types of users (internal and external), and 4) **Prioritize** accessibility first with support from top management.<sup>11</sup>

The following URL's were sent to JAN to access using the SNAP Tool: <https://careers-donaanacounty.icims.com> and <https://internal-donaanacounty.icims.com>. The SNAP Tool results are dated April 18, 2017. (Appendix K) Out of the 15 steps that are part of the SNAP Tool, 14 out of 15 elements passed online accessibility recommendations. One element failed online accessibility recommendations, Step #12, does the site allow users to skip repetitive content? The result indicated that the skip link is present and visible when focused, but leads back to main content of site, not of current page.

### **Recommendation(s):**

---

<sup>11</sup> Job Accommodation Network (JAN), <https://askjan.org/media/webpages.html>. Technical Series: Tips for Designing Accessible Websites Including Self-Assessment SNAP Tool. By Beth Loy, Ph.D., and Lyssa Rowan, B.S.



- Contact vendor, iCIMS, and request evaluation of this element to fix on-going.

### *2.12 Website Accessibility*

Doña Ana County's website that is used to convey information to the public is <https://donaanacounty.org>. All Doña Ana County departments are represented under this website.

Doña Ana County's Information Technology department's web team utilized the Web Accessibility Evaluation Tool (WAVE) to check for any errors.



The following errors/alerts were found:

- ALT tag capability to the rotating banner images was missing and has been added.
- There is a missing "label" tag to the search textbox. This will be looked in to.
- There are a couple of redundant links (footer links at the bottom of the page).
- There are "small text alerts", but it is based on the Meta data but text in links is fine.

#### **Recommendation(s):**

- Continue to utilize WAVE on the department webpages to ensure on-going accessibility.

### *2.13 Review of all County-Owned Roads*

Title II of the ADA (28 CFR §35.150 (d) (2)) requires public entities that have responsibility over streets, roads, or walkways incorporate a schedule for providing curb ramps or other sloped areas where pedestrian walks cross curbs, giving priority to walkways serving entities covered by the Act.

As mentioned above in section 2-2 Facility Self-Evaluation Findings, ADA checklists were conducted at County facilities. The checklist evaluates the approach and entrance to each facility. Findings from the checklists are documented in appendix E.

There are approximately 1328 miles of roadway that are maintained by Doña Ana County. Approximately 563 miles are paved roadway and 765 are unpaved roadway. The majority of County maintained roads are unpaved. (Appendix L) Under the ADA, there are no provisions for an entity to provide walkways where none are currently provided.

The County currently does not have a curb ramp study; however, any subdivisions that are approved are required to meet ADA standards.

**Recommendation(s):**

- Contract with IMS to put together an evaluation of curb ramps and walk ways for all County maintained roads and rights-of-way based on the video that has already been taken.

***2.14 Contract Language***

28 CFR 35.130 (b) (5) states: “A public entity, in the selection of procurement contractors, may not use criteria that subject qualified individuals with disabilities to discrimination on the basis of disability.” Doña Ana County does not use criteria that would subject qualified individuals with disabilities to discrimination on the basis of disability. (Appendix M) Appendix M is a sample contract that is included in all bids and RFPs and is the contract that is executed for all procurements.

***2.15 Voting Convenience Centers***

Doña Ana County currently has forty voting convenience centers. (Appendix N) ADA voting center checklists were conducted on all voting convenience centers in 2011. State statute also requires that not less than thirty days prior to any election at which the building is intended for use as a polling place, the county clerk or the clerk’s designated representative shall physically inspect each such facility to determine its suitability for precinct polling places and its capability of handling heavy voter traffic in the most expeditious manner with a maximum efficiency and minimum discomfort of the voter. In the event the building is found to meet these standards, the county clerk shall certify for the record its acceptability.

Training is conducted for election staff prior to every primary and general election. A component of the training includes voting accessibility. In this training, election staff are asked to spot check their area on a daily basis and look for any obvious problems regarding accessibility. Staff are asked to make minor changes as necessary to ensure accessibility. Additionally, the County Clerk’s office has temporary ramps that can be used, and they can assist with any signs that need to be made. The election staff are also given the ADA Coordinator’s contact information.

Prior to the 2018 June Primary election, the County Clerk’s office, along with assistance from the ADA Coordinator will conduct the 2016 ADA Checklist for Polling Places at all voting convenience centers within Doña Ana County. This will be noted on the next update of the Transition Plan.

### 3.0 Transition Plan

Doña Ana County last revised the transition plan on August 14, 2015. It is the County's intent to be in compliance with the ADA and to continue reviewing access to County programs, activities, and services.

28 CFR Part 35.150 Existing Facilities (d) (3) Transition plan states: "The plan shall, at a minimum –

(i) Identify physical obstacles in the public entity's facilities that limit the accessibility of its programs or activities to individuals with disabilities;

(ii) Describe in detail the methods that will be used to make the facilities accessible;

(iii) Specify the schedule for taking the steps necessary to achieve compliance with this section and, if the time period of the transition plan is longer than one year, identify steps that will be taken during each year of the transition period; and

(iv) Indicate the official responsible for implementation of the plan.

In 2011, Doña Ana County started the process of conducting a self-evaluation. The process continued until 2017. Based on the self-evaluation, an extensive revision to the transition plan has been completed.

The transition plan includes information and recommendations that were compiled in the self-evaluation plan; as well as, comments from the public both at the self-evaluation process and based on the draft of the transition plan. The transition plan is a document that will be updated periodically as information becomes available.

#### 3.1 ADA Coordinator

28 CFR Part 35 § 35.107 (a) Designation of responsible employee. A public entity that employs 50 or more persons shall designate at least one employee to coordinate its efforts to comply with and carry out its responsibilities under this part, including any investigation of any complaint communicated to it alleging its noncompliance with this part or alleging any actions that would be prohibited by this part. The public entity shall make available to all interested individuals the name, office address, and telephone number of the employee or employees designated pursuant to this paragraph.

The duties and responsibilities of Doña Ana County's ADA Coordinator include the following:

- Performs professional, administrative, analytical and employee relations work of moderate difficulty in developing and implementing the County equal opportunity policy;

- Point of contact for Doña Ana County and the general public for ADA and processes requests for reasonable accommodations and modifications under the Americans with Disabilities Act and participates in the training and applicant processing functions of the Human Resources Department;
- Interprets equal employment and discrimination/harassment policies and related Federal and State regulations;
- Conducts prompt and thorough investigation of external discrimination and/or harassment complaints;
- Develops official position statements to respond to complaints received from the EEO/ADA and/or HRD;
- Participates on behalf of the County in EEO/HRD/ADA mediations;
- Act as internal point of contact for employees wishing to discuss EEO/HRD/ADA issues;
- Identifies needs and develops and implements and/or contracts with outside providers for DAC county-wide training on EEO/HRD/ADA and other Human Resources issues in the workplace;
- Schedules refresher training needs for all employees and volunteers;
- Participates in new employee orientation to provide EEO/HRD/ADA training and explains processes;
- Processes requests for reasonable accommodations and/or reasonable modifications under the Americans with Disabilities Act ;
- Completes and updates the ADA Transition Plan as required by regulations; and
- Researches available materials, supplies and services and makes recommendations for use to promote accessibility in accordance with the ADA.

Ms. Meg Haines, PHR, SHRM-CP, CPP, serves as the EEO Specialist/ADA Coordinator for Doña Ana County. Information pertaining to Ms. Haines as the County's ADA Coordinator can be found on the Doña Ana County Website ([www.donaanacounty.org](http://www.donaanacounty.org)) under the ADA Office and under the Human Resources Department. To contact Ms. Haines:

**Meg Haines, EEO Specialist/ADA Coordinator**

**845 N. Motel Blvd.**

**Las Cruces, NM 88007**

**Voice (575) 647-7210**

**Fax (575) 525-5888**

**TTD (575) 525-5951**

[EEO@donaanacounty.org](mailto:EEO@donaanacounty.org)  
[megh@donaanacounty.org](mailto:megh@donaanacounty.org)

### *3.2 Public Review and Comment*

28 CFR Part 35 § 35.150 (d) (1) Transition Plan. In part states: "...A public entity shall provide an opportunity to interested persons, including individuals with disabilities or organizations representing individuals with disabilities, to participate in the development of the transition plan by submitting comments. A copy of the transition plan shall be made available for public inspection.

The Transition Plan was available for public review and comment from November 29, 2017 through December 14, 2017. Public comments received were considered and incorporated into the final Transition Plan as appropriate.

The Transition Plan is available to review on the ADA Office Website; as well as, a hard copy is available in the Human Resources Office to review upon request.

### *3.3 Priorities for Barrier Removal*

A ranking system was used by Doña Ana County and J.G. Management Systems (JGMS) to determine which capital improvements identified required immediate attention and those that can be implemented in the out years.

**Low Priority:** Typically a low priority barrier does not prohibit the access of facilities and/or services for disabled persons. Alternative means of access or assistance is typically available. There are minimal, if any dangers posed to users by barriers with this priority.

**Medium Priority:** A medium priority barrier partially restricts the access of disabled persons into facilities and/or services. This type of barrier makes access somewhat difficult and may even create a danger to the user. Where medium priority barriers exist, alternative means of access may or may not be available.

**High Priority:** A high priority barrier prohibits the access of facilities and/or services for disabled persons, resulting in potential safety hazards to all users. Where these barriers exist, alternative means of access is typically not available. High priority barriers are typically identified at access walks, entry doors, curb ramps, transaction counters, and restrooms.

### *3.4 Proposed Solutions for Barrier Removal*

Upon analysis of the ADA Checklists, JGMS' team of experienced planners determined feasible solutions for barrier removal. Feasible solutions for barrier removal are solutions that would not create an undue hardship to the County. Proposed solutions are recommended for single items, as well as items in similar locations that have been grouped together. All items that have been reviewed and provided with a solution are for fixed items only. However, the County will make every effort to remove non-fixed items, such as furniture, stored items, and loose mats to provide the appropriate clearances for access.

The existing accessible parking areas throughout the County were assessed utilizing the ADA Checklist and did not take into account local ordinances or codes. According to the State of New Mexico Code 66-1-4.1.B NMSA1978, "Access aisle[s] shall have the words "NO PARKING" in capital letters, each of which shall be at least one foot high and at least two inches wide, placed at the rear of the parking space so as to be close to where an adjacent vehicle's rear tires would be placed". Based on this local requirement, if work is required at accessible parking areas that are not currently compliant, it has been noted that this requirement be met. DAC may have existing accessible parking areas throughout the County that are in compliance with the ADA Standards, but that do not comply with this local code. DAC will make every effort to ensure that this local code requirement is applied to all accessible parking areas under its jurisdiction.

### *3.5 Estimating*

Identified barriers, grouped into feasible projects were estimated utilizing RSMeans and other industry standard costing data. Estimates were developed with the data provided on the ADA Checklists. Based on the data from the ADA Checklists and the Planner/Estimator's previous experience, estimates were developed for work items expected to remove the noted barriers. Due to the limited information as well as the unknown structural elements, Architectural Engineering fees were included at 16% of the total Maximum Allowable Construction Cost (MACC). This allows for the appropriate planning of work items.

### *3.6 Barrier Removal Summary Conclusions*

The assets and locations identified by DAC are organized by Fire and Facilities Departments that provide full or partial public access. A compilation of the identified barriers; as well as proposed solutions, and estimated cost is available in Appendix E. The charts below break down cost by low, medium, and high priority.

### 3.7 Fire Stations

The DAC Fire Department oversees 16 districts and operates out of 19 Fire Stations, covering approximately 3,804 square miles. The stations respond to fires, rescue incidents, automobile accidents, and medical emergencies. The stations provide partial public access to meeting rooms and facilities and were included in the ADA Checklist assessments for compliance. The following table is a cost summary for barrier removal by priority level.

Table 1: Fire Stations Priority Level Costs

Building	Low	Medium	High	Grand Total
Chamberino Fire Station New	\$ 5,359.17	\$ 967.28	\$ -	\$ 6,326.45
Chaparral Fire Station	\$ 551.54	\$ 2,906.60	\$ -	\$ 3,458.14
Fairacres Fire Station	\$ 1,146.44	\$ 1,872.39	\$ 2,196.53	\$ 5,215.36
Fire Administration	\$ 324.69	\$ 3,072.68	\$ -	\$ 3,397.37
Fire Station 11	\$ 1,042.74	\$ 3,380.50	\$ -	\$ 4,423.24
Fire Station 14	\$ 4,634.06	\$ 216.70	\$ -	\$ 4,850.76
Fire Station 2	\$ 4,242.65	\$ 5,470.31	\$ 3,819.00	\$ 13,531.96
Fire Station 5-1	\$ 323.48	\$ 6,105.15	\$ -	\$ 6,428.63
Fire Station 6	\$ 440.12	\$ 431.24	\$ -	\$ 871.36
Fire Station 8	\$ 819.03	\$ 6,380.85	\$ -	\$ 7,199.88
La Mesa Fire Station	\$ 178.94	\$ -	\$ -	\$ 178.94
La Mesa Fire Station Old	\$ 4,911.45	\$ 5,493.15	\$ 3,585.83	\$ 13,990.43
La Union Fire Station	\$ 3,483.87	\$ -	\$ -	\$ 3,483.87
Las Alturas Fire Station	\$ 3,093.00	\$ -	\$ -	\$ 3,093.00
Mesquite Fire Station	\$ 998.16	\$ 2,052.29	\$ 3,178.72	\$ 6,229.17
Organ Fire Station	\$ -	\$ 295.01	\$ 10,608.30	\$ 10,903.31
Santa Teresa Fire Station 14	\$ 5,035.60	\$ 1,891.16	\$ 4,942.41	\$ 11,869.17
Santa Teresa Hazmat	\$ 936.76	\$ 1,901.63	\$ -	\$ 2,838.39
South Valley Fire Station	\$ 679.83	\$ 5,882.93	\$ -	\$ 6,562.76
Talavera Fire Station	\$ -	\$ 7,550.54	\$ -	\$ 7,550.54
<b>Total</b>	<b>\$ 38,201.53</b>	<b>\$ 55,870.41</b>	<b>\$ 28,330.79</b>	<b>\$ 122,402.73</b>

### 3.8 Facilities

The DAC Facilities Department is responsible for all county buildings, parks, ballparks, community centers, health centers, and the Southern New Mexico State Fairgrounds and Rodeo. The buildings included in this report provide full or partial public access. The following table is a cost summary for barrier removal by priority level.

Building	Low	Medium	High	Grand Total
Berino Ball Park Restroom	\$ 141.18	\$ 9,176.00	\$ -	\$ 9,317.18
Adult Detention Center	\$ 6,112.38	\$ 11,847.01	\$ 7,734.23	\$ 25,693.62
Animal Control Office	\$ 828.30	\$ 4,217.89	\$ -	\$ 5,046.19
Butterfield Community Center	\$ 3,067.55	\$ -	\$ -	\$ 3,067.55
Chaparral Community Center	\$ 2,750.12	\$ -	\$ -	\$ 2,750.12
Chaparral Community Health	\$ 2,366.13	\$ 3,632.56	\$ -	\$ 5,998.69
Chaparral Restroom and Concession Stand	\$ 1,011.56	\$ 878.08	\$ 1,899.75	\$ 3,789.39
Colquit Park Building	\$ 404.12	\$ 1,280.24	\$ 6,799.99	\$ 8,484.35
Colquit Park Restrooms Building	\$ -	\$ 2,219.27	\$ 2,920.77	\$ 5,140.04
Crisis Triage Center	\$ 949.18	\$ -	\$ -	\$ 949.18
DASO Training Facilities	\$ 1,181.47	\$ -	\$ 4,104.75	\$ 5,286.22
Daso-Doña Ana Public Health	\$ 3,735.68	\$ 759.65	\$ -	\$ 4,495.33
De La O Restroom	\$ 420.04	\$ 433.40	\$ -	\$ 853.44
De La O Saloon/Visitor Center	\$ 388.72	\$ 330.53	\$ 126.36	\$ 845.61
Del Cerro Community Center	\$ 5,773.39	\$ -	\$ -	\$ 5,773.39
Delores Wright Education Center	\$ 539.02	\$ 473.70	\$ 2,000.30	\$ 3,013.02
Doña Ana Ball Field Concession/Restrooms	\$ 6,282.95	\$ -	\$ 6,167.98	\$ 12,450.93
Doña Ana Boxing Facility	\$ 510.75	\$ -	\$ -	\$ 510.75
Doña Ana Community Center	\$ 5,190.06	\$ 1,395.21	\$ -	\$ 6,585.27
East Mesa Public Health	\$ 2,977.62	\$ 2,135.36	\$ -	\$ 5,112.98
Fairgrounds - Administration Office	\$ 101.56	\$ 11,665.52	\$ 5,827.92	\$ 17,595.00
Fairgrounds - Restroom Building West	\$ 1,463.71	\$ -	\$ -	\$ 1,463.71
Fairgrounds - Restroom New	\$ 1,144.09	\$ -	\$ -	\$ 1,144.09
Fleet Building	\$ 429.62	\$ -	\$ -	\$ 429.62
Gazebo	\$ -	\$ 5,267.01	\$ -	\$ 5,267.01
Government Center/Radio & Fleet Shop	\$ 5,905.17	\$ 10,627.20	\$ -	\$ 16,532.37
Judicial Complex	\$ 4,402.64	\$ 2,197.60	\$ 10,988.90	\$ 17,589.14



Building	Low	Medium	High	Grand Total
Juvenile Detention Center	\$ 2,245.05	\$ 4,971.38	\$ -	\$ 7,216.43
La Mesa Community Center	\$ 1,128.53	\$ -	\$ -	\$ 1,128.53
La Mesa Concession Stand and Restroom	\$ 135.84	\$ 2,477.88	\$ 7,036.07	\$ 9,649.79
La Pinon Office	\$ 3,977.29	\$ 3,845.24	\$ -	\$ 7,822.53
Maintenance Shop	\$ 3,656.91	\$ 6,338.31	\$ -	\$ 9,995.22
Mesquite Community Center	\$ 1,234.96	\$ 482.46	\$ -	\$ 1,717.42
Mesquite Concession & Restroom	\$ 3,698.00	\$ 18,172.52	\$ -	\$ 21,870.52
Organ Community Center	\$ 1,330.89	\$ 4,197.74	\$ -	\$ 5,528.63
Placitas Community Center	\$ 1,577.23	\$ 986.68	\$ -	\$ 2,563.91
Public Building A West	\$ 1,423.60	\$ 3,615.94	\$ -	\$ 5,039.54
Public Health Building	\$ 19,318.22	\$ -	\$ -	\$ 19,318.22
Radium Springs Community Center	\$ 2,911.59	\$ -	\$ -	\$ 2,911.59
Rincon Community Center	\$ 588.43	\$ -	\$ -	\$ 588.43
Sheriff's Substation	\$ 1,060.46	\$ 3,326.68	\$ 2,642.71	\$ 7,029.85
Speedway Restroom	\$ 5,696.23	\$ 6,182.69	\$ 1,579.75	\$ 13,458.67
SVC - Community Health Center	\$ 1,176.73	\$ -	\$ -	\$ 1,176.73
SVC - Senior Center	\$ 3,546.54	\$ 1,849.11	\$ -	\$ 5,395.65
SVC - Sheriff's Substation	\$ 603.69	\$ 3,602.31	\$ -	\$ 4,206.00
Vector Control	\$ 6,224.40	\$ -	\$ -	\$ 6,224.40
Veterans Administration	\$ 1,327.81	\$ -	\$ -	\$ 1,327.81
West Speedway Restroom	\$ 3,178.00	\$ 1,012.78	\$ -	\$ 4,190.78
<b>Total</b>	<b>\$ 124,117.41</b>	<b>\$ 129,597.95</b>	<b>\$ 59,829.48</b>	<b>\$ 313,544.84</b>

### 3.9 Conclusion

The County is committed to making changes to remove any barriers to access. Based on the number of items, the fiscal impact, and the time needed to make changes, Doña Ana County will be phasing the schedule for taking the steps necessary to achieve compliance over the next few fiscal years. A five year plan will be created to take the necessary steps for barrier removal. Tracking will also take place in the County's asset management system.

High priority/high public usage areas will generally be looked at first. However, the transition plan is a working document and as issues come up, they will be addressed. Additionally, there are many low cost barriers that can be taken care of as the Facilities and Parks department handles routine maintenance. For example, a community center might be missing a van

accessible sign or to meet State statute, a parking lot may need one access aisle painted with the words “NO PARKING”, which can be done with minimal resources.

Curb ramps of street crossings, pedestrian routes, and public right-of-way are an important part of accessibility to people with disabilities. The Engineering/Road department will incorporate a schedule for the evaluation of curb ramps and walk ways for all County maintained roads and public right-of way.


Doña Ana County will continue to accept feedback from the public for the Transition Plan. The Transition Plan is a living document and will be periodically reviewed and updated as barriers to accessibility are corrected and as new information becomes available. Doña Ana County staff will present annual updates to the Board of County Commissioners on the five year plan.

## **Appendix A**


### **State of New Mexico Map of Counties**



# DONA ANA COUNTY, NM



October 27, 2017

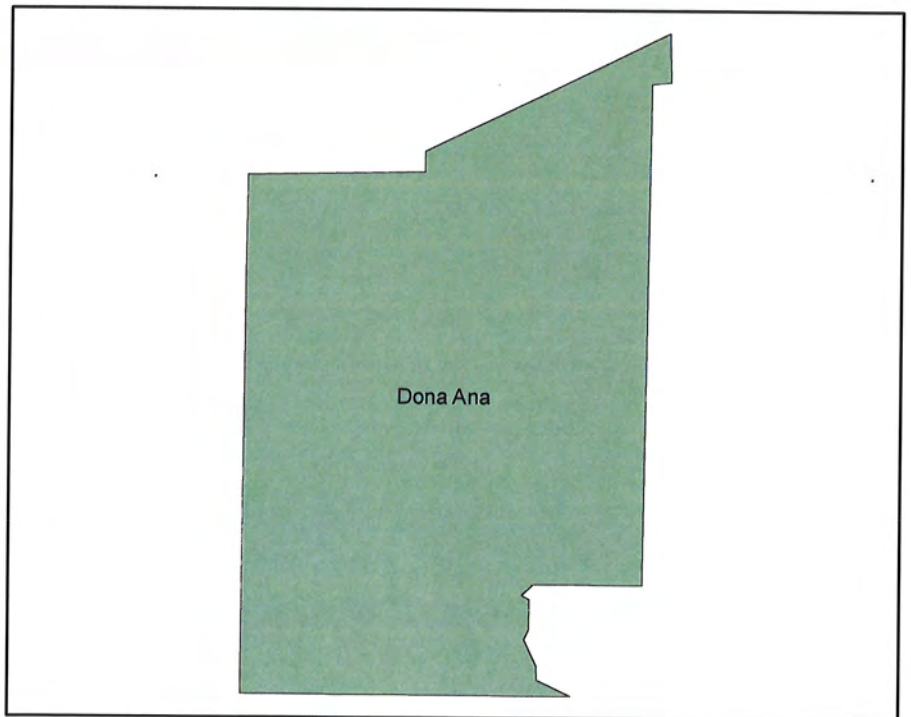


**SOURCE OF DATA & DISCLAIMER:**  
1. The data provided is provided as is, without warranty of any kind, either expressed or implied, including but not limited to implied warranties of fitness for a particular purpose. 2. The data provided was digitized from paper maps that were at a variety of scales ranging from 1":100' to 1":1200'. The positional location of the parcels may not be accurate. In no event shall Dona Ana County or any of its employees be liable for damages whatsoever including direct, indirect, incidental, consequential, loss of business profit or special damages, even if Dona Ana County has been advised of the possibility of such damages. Any and all modifications of the data are the responsibility and liability of the purchasers. Resale of hard copy derived from the data must be verified by the selling agent not the County of Dona Ana.

## **Appendix B**

# **Doña Ana County Organizational Chart**



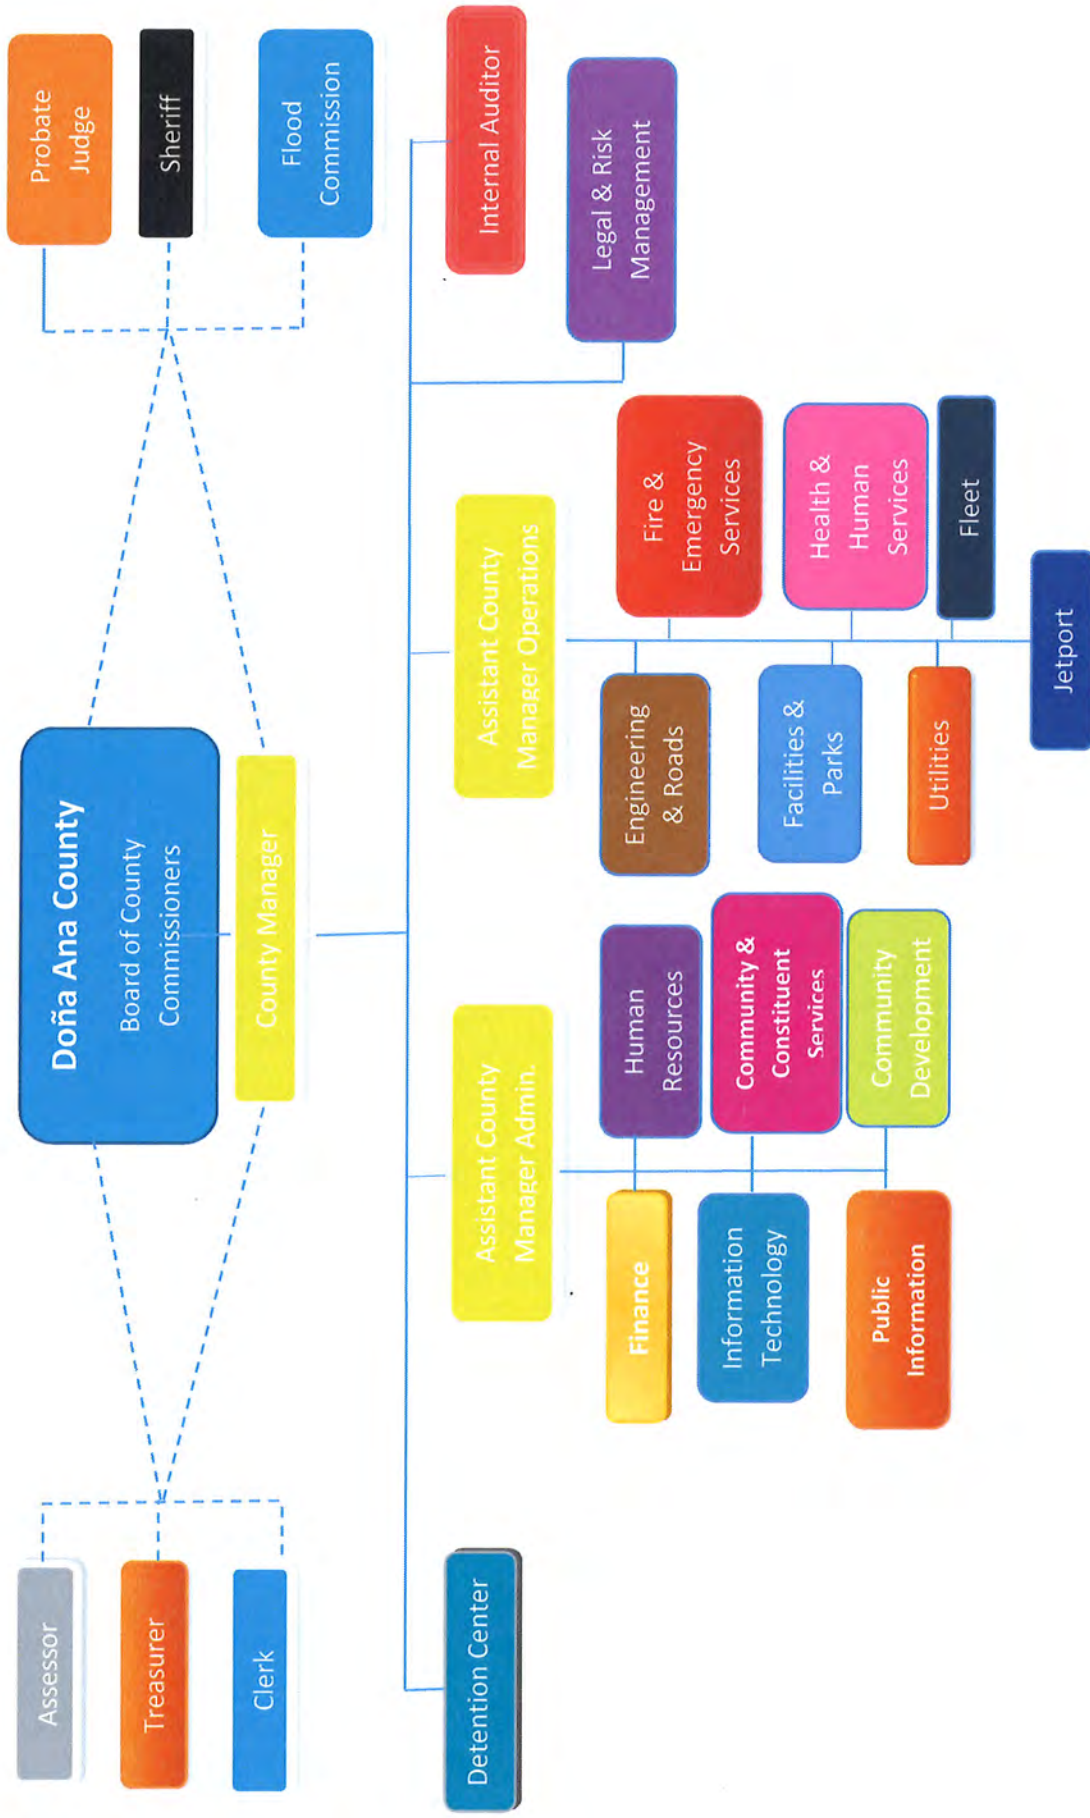

## **Appendix C**

### **Code of Doña Ana County Chapter 45: Human Resources**

Code of Doña Ana County

Part I: Administrative Legislation

Chapter 45: Human Resources

§ 45-1. Short title.

This chapter may be cited as the "Doña Ana County Human Resources Policies."

§ 45-2. Purpose and policy.

- A. The purpose of this chapter is to establish a merit system for hiring, promotion, discharge and general regulation of County employees, elected officials, volunteers and other County agents. All rules and regulations drawn pursuant to this chapter shall be promulgated by resolution of the Board of County Commissioners except as otherwise provided.
- B. Decisions affecting the employment relationship will be made based on merit principles designed to recruit, hire and advance employees on the bases of ability, knowledge and skill; provide equitable and adequate compensation; retain employees on the basis of performance and separate employees whose inadequate performance cannot be corrected; assure fair treatment and equal employment opportunity in all aspects of personnel administration without regard to political affiliation or protected class; and assure that employees are not coerced to support or oppose particular candidates or electoral issues.
- C. Positions having similar duties and responsibilities will be classified and compensated on an equitable basis, consistent with any compensation plan adopted by the Board of County Commissioners. Seniority or experience may justify reasonable deviation in the level of compensation between two employees in the same pay range. *Editor's Note: Amended at time of adoption of Code (see Ch. 1, General Provisions, Art. I).*
- D. Consideration shall be given to the rights and interests of employees, consistent with the best interest of the public, the County as a body politic and corporate, and consistent with all state and federal laws relating to the employment relationship.

§ 45-3. Applicability.

This chapter applies to all classified and unclassified County employees, whether or not subject to a collective bargaining agreement (CBA), to the extent that this chapter does not conflict with the CBA; elected officials; volunteers and other County agents. To the extent that this chapter does conflict with the CBA, the CBA will govern. The rights afforded by this chapter to unclassified employees, volunteers, and other County agents are more limited in scope than those afforded to classified employees, which will be expressly set forth in the Human Resources Policies authorized by this chapter. *Editor's Note: The Human Resources Policies are available in the offices of the Human Resources Department.*



**§ 45-4. Binding effect.**

It is the express intent of the Board of County Commissioners that the provisions outlined herein and the Human Resource Policies to be adopted pursuant to the authority granted herein will be binding on the operations of the Human Resources Department and other County departments relating to hiring, promotion, discharge, and general human resources management.

**§ 45-5. Equal opportunity employer; discrimination and harassment prohibited.**

- A. The County is an equal opportunity employer. Discrimination by any employee is expressly prohibited. If such discriminatory acts occur, the person committing these acts is subject to dismissal from County employment or other appropriate disciplinary action.
- B. It is declared unlawful:
- (1) For any employee to give preference to, or to discriminate against, any person because of political affiliation, race, religion, age, national origin, color, sex, disability or any other legally protected status, unless based upon a bona fide occupational qualification.
  - (2) For any employee or applicant to be appointed, promoted, removed, or in any way favored or discriminated against because of race, sex, color, national origin, disability, age, political or religious affiliations or any other legally protected status.
  - (3) For any employee to harass any employee, especially when such conduct has the effect of interfering with an individual's work performance or has the effect of creating a hostile or offensive work environment. No employee shall make such conduct a condition of employment or use refusal to participate in such conduct a basis for employment decisions.

**§ 45-6. Administration of human resources system.**

- A. Under the supervision of the County Manager, the Human Resources Director will administer the Doña Ana County Merit System set forth in this chapter, consistent with the Human Resources Policies to be adopted in accordance herewith, and in accordance with all future approved directives and administrative instructions.
- B. The Human Resources Director will ensure that employment decisions, including, but not limited to, recruitment, selection, promotion, reassignment, corrective action, compensation and other conditions or privileges of employment, are based on the individual's ability to perform the essential functions of the job.
- C. The Human Resources Director, under the supervision of the County Manager, will continue to establish programs to develop, implement, and maintain procedures for the conditions of employment, evaluation of work performance, employee conduct, leave usage, and other aspects of human resources management for County employees, in compliance with applicable laws and policies.

D. The Human Resources Director, under the supervision of the County Manager, will continue to establish programs to develop, implement, and maintain the County's compensation plan, including a salary schedule reflecting the pay ranges for each job classification and other pay policies.

**§ 45-7. Classification of employees and County agents.**

A. All paid positions in the County service are divided into classified and unclassified categories, except those held by elected officials, volunteers, including members of boards, commissions, committees, etc., appointed by County Commissioners or County staff, which are not included in either category.

B. Classified positions.

(1) A classified position is a regular, approved position. Employees in classified positions are covered by the Human Resources Policies and can be separated from the County only through the processes outlined in the Human Resources Policies after the employee has completed his/her initial probationary period.

(2) The classified service is comprised of all County employees except those who are specifically placed in the unclassified category by the terms of this chapter. The classified service also includes the Assistant County Manager and department directors for whom the County Manager is authorized to negotiate individual contracts specifying conditions of employment, excluding termination of employment which shall be governed by the Human Resources Policies adopted pursuant to this chapter.

C. Unclassified positions.

(1) Unclassified positions are comprised of the following: *Editor's Note: Amended at time of adoption of Code (see Ch. 1, General Provisions, Art. 1).*

(a) The County Manager, chief deputies of elected officials, and the Undersheriff and the Executive Secretary to the Sheriff.

(b) The Executive Secretary to the Sheriff, probationary, and other temporary employees as defined in the Human Resources Policies adopted pursuant to this chapter.

(2) Employees in unclassified positions are in an "at-will" status and serve at the pleasure of the County. These employees are not covered by the employment, discipline, and grievance provisions of Human Resources Policies but are governed by the other provisions.

D. The specific terms and conditions of a classified or unclassified employee's employment are governed first by this chapter, and then by either the express terms of the Human Resources Policies adopted pursuant to this chapter, or by the terms of any employment contract. In the event of a conflict between an employment contract and the Human Resources Policies, the terms of the employment contract shall prevail.

**§ 45-8. Human Resources Policies.**

*Editor's Note: The Human Resources Policies are available in the offices of the Human Resources Department.*

A. The Human Resources Director, with approval from the County Manager and the Board of County Commissioners by resolution, shall establish, maintain, and publish Human Resources Policies to facilitate implementation and maintenance of, and compliance with, the policies expressed within this chapter. The Human Resources Policies will be reviewed periodically and may be modified or discontinued at any time by the Board of County Commissioners by resolution. The Human Resources Policies shall not constitute a contract of employment.

*Editor's Note: Amended at time of adoption of Code (see Ch. 1, General Provisions, Art. I).*

B. The procedures authorized to be implemented include, but are not limited to, the classification of all County positions based on the duties, authority and responsibilities of each position; provisions for reclassification, assignment, transfer, and layoff of any person whenever warranted by changed circumstances; methods for determining the qualifications of candidates for appointment or promotion; policies and procedures regulating corrective action, up to and including termination, of employees; the hours of work and attendance; regulations and provisions for benefits; policies regarding training and other programs; and other practices and procedures, including interpretation of applicable provisions of the policies necessary to administer same.

C. Elected officials and department directors are authorized to promulgate operational policies and procedures specific to their department functions, subject to the review and approval by the County Manager, and provided such policies and procedures do not conflict with the terms of this chapter or the Human Resources Policies.

**§ 45-9. Compensation plan.**

A. The compensation plan shall consist of wages; salaries, and all other benefits of value to an employee that result in a cost to the County.

B. The Human Resources Director, with approval from the County Manager and the Board of County Commissioners by resolution, will establish, maintain, and publish a compensation plan. The compensation plan shall group all positions into classes, based on duty, responsibility, authority, and other qualifications required for satisfactory performance. Experience, education, licenses, certifications, skills, and other specifications shall be established for each class.

C. The compensation plan will include a salary schedule consisting of pay grade ranges containing a minimum and maximum salary or grade and step range for each job, and factors for determining the appropriate rate of pay for each.

D. The compensation plan may provide for periodic cost-of-living adjustments, merit increases, longevity, and other benefits that the Board of County Commissioners deems appropriate.

E. The compensation plan, including the salary schedule, is subject to the availability of funds and the financial condition of the County.

**§ 45-10. County Manager authority.**

- A. The County Manager is the Chief Executive Officer of County government and is authorized to run County operations pursuant to policy established by the Board of County Commissioners.
- B. The County Manager is charged with:
- (1) The exclusive authority to employ and discharge all County employees pursuant to this chapter and the Human Resources Policies adopted pursuant to this chapter.
  - (2) Recommending revisions to the personnel policies.
  - (3) Recommending the organizational structure and salary plan for the work force.
  - (4) Appointing a designee or designees to act on his behalf in carrying out these responsibilities.
  - (5) Formulating and implementing personnel rules, regulations and directives to carry out the intent of this chapter as long as said rules, regulations and directives are not in conflict with any personnel rules enacted by the Board of County Commissioners.
  - (6) Exercising discretion to review an individual's salary and compare it with other incumbents in comparable positions and salary grades, and to adjust a salary in the interest of parity or equity.
  - (7) Exercising discretion to offer an applicant a salary in excess of a salary grade, or in excess of an advertised amount, in order to ensure employment of a qualified candidate or acknowledge special credentials in excess of requirements.
  - (8) Exercising discretion to transfer or reassign any employee within the organization to permit the best use of skills, experience, and education for the benefit of the organization.

**§ 45-11. Violations.**

Any employee who violates or attempts to violate this chapter, the Human Resources Policies, or the compensation plan adopted pursuant hereto, shall be subject to disciplinary action, up to and including termination, depending upon the severity of the infraction. *Editor's Note: Former Section 12, Prohibition of political activity, which immediately followed this section, was repealed 6-9-2009.*

**§ 45-12. Conflict of interest.**

No employee shall engage in any business or transaction or accept private employment or other public employment which is functionally or physically incompatible with the proper discharge of the employee's job responsibilities. All employees, volunteers, and other County agents shall comply with applicable state statutes prohibiting financial conflicts and requiring disclosure, as well as comply with other applicable ethical standards set forth in the Human Resources Policies.



**§ 45-13. Preservation of confidentiality.**

Doña Ana County employees, elected officials, volunteers, and other County agents may have access to confidential information in the course of their duties. This information may relate to Doña Ana County personnel matters, internal investigations, restricted computerized data, attorney work papers or other legally privileged information, and/or contract or financial negotiations. Unauthorized disclosure of confidential information could be very detrimental to the individuals involved and/or Doña Ana County. Unless required by the job, at no time should an employee, elected official, volunteer, or other County agent disclose confidential information or remove it from the County's premises. The negligent or intentional disclosure of confidential information is grounds for discipline, up to and including termination, depending upon the severity of the infraction.

**§ 45-14. Dispute resolution.**

- A. It is the County's policy to provide its employees and certain volunteers the opportunity to present work-related complaints through dispute resolution or grievance procedures, and to appeal management decisions. The Human Resources Policies may provide distinct methods designed to resolve complaints and disputes in a prompt and efficient manner.
- B. All actions taken at any stage of the grievance or complaint resolution processes shall be characterized by frankness, courtesy, and respect for the dignity of each individual involved without retaliation for having brought the issue to the attention of management.
- C. The Human Resources Department shall provide training and support to supervisors and department directors/elected officials regarding processing of employee grievances and complaints.

**§ 45-15. Prohibition against strikes and slow downs.**

It is unlawful for any person to authorize or impliedly consent to a strike or slow down by one or more employees of the County of Doña Ana. It is unlawful for any employee of the County of Doña Ana to strike, or to cause, instigate, encourage, support, or participate in a strike, slow down, or sick out. A violation of this section shall constitute just cause for termination.

**§ 45-16. Gender neutrality; headings.**

The use of the singular masculine pronoun used in this chapter and in the Human Resources Policies authorized therein shall refer also to the feminine gender, and shall include the singular and plural, and the context of this chapter and the Human Resources Policies shall be read accordingly. The paragraph headings of this chapter and procedural guidelines are inserted only for reference and in no way define, limit, or describe the scope or intent of the section, nor affect its terms and provisions.

**[HISTORY: Adopted by the Board of County Commissioners of Doña Ana County 4-8-2008 by Ord. No. 235-08. Amendments noted where applicable.]**



**GENERAL REFERENCES**

## **Appendix D**

# **Doña Ana County Maps by District**

# DOÑA ANA COUNTY COMMISSION DISTRICT I ADA FACILITIES

1. Adult and Juvenile Detention Centers
2. Mesquite Ballpark Concession and Restroom
3. La Mesa Ballpark Concession and Restroom
4. Del Cerro Community Center
5. Fairacres Fire Station 12
6. Fairgrounds, Speedway and DASO Training Facilities
7. Fire Administration
8. Government Center
9. Judicial Complex
10. La Mesa Community Center
11. La Mesa Fire Station 4
12. La Mesa Fire Station Old
13. La Pinon Office
14. Mesquite Community Center
15. Mesquite Fire Station 10
16. Berino Ballpark Restroom
17. South Valley Fire Station 13

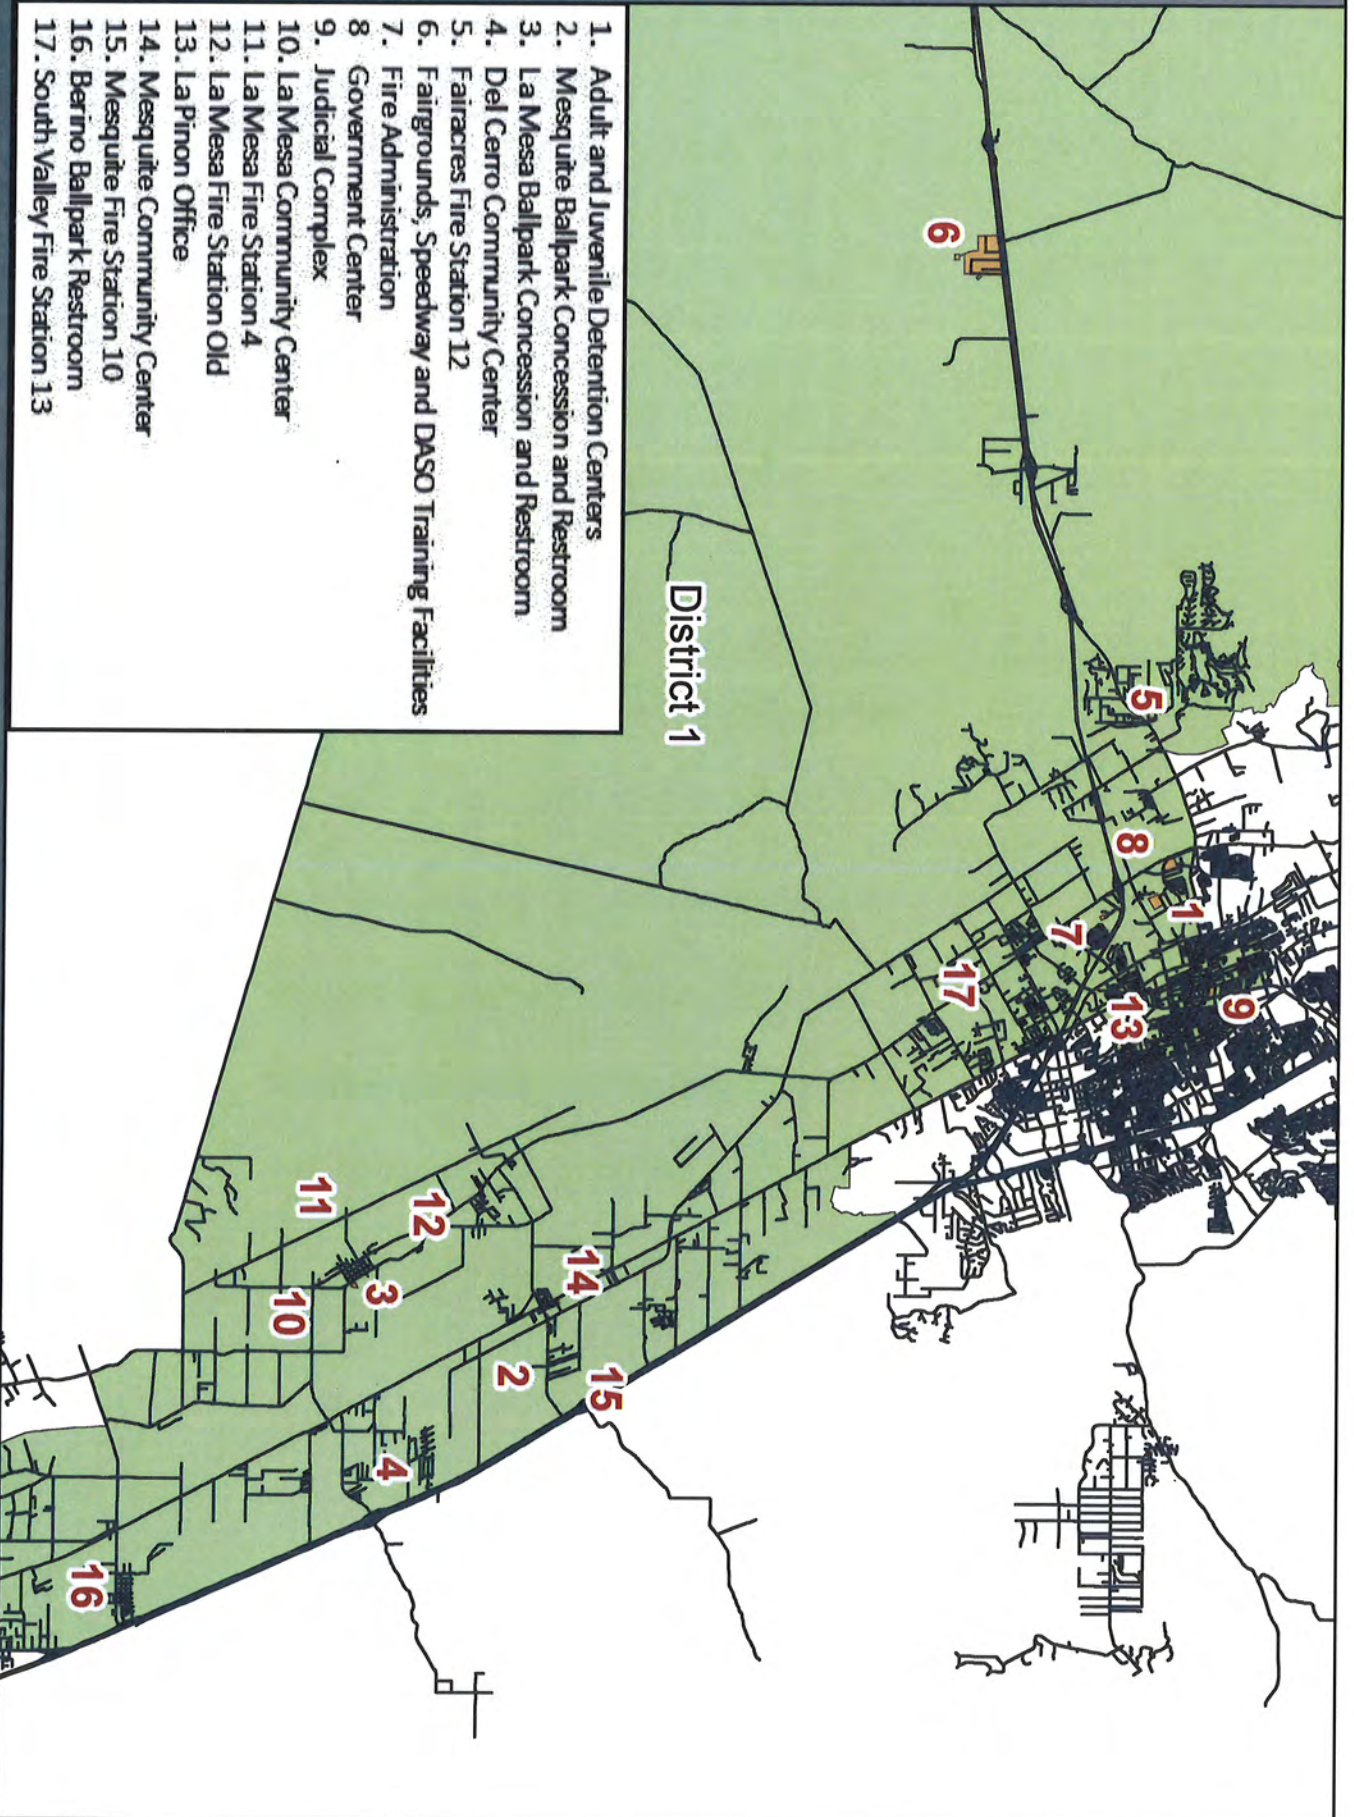


October 27, 2017

SOURCE: DONA ANA ORIGINATOR. Responsibility for the accuracy of the information is not assumed by the County of Dona Ana. The data provided was obtained from public data that was not a result of a survey conducted by the County of Dona Ana. No warranty is made for the accuracy of the information. The County of Dona Ana County or any of its employees is liable for any damages, including consequential damages, arising from the use of the information. The County of Dona Ana County has been advised of the potential risks of the information and has agreed to provide the information. The County of Dona Ana County is not responsible for any damages, including consequential damages, arising from the use of the information. The County of Dona Ana County has been advised of the potential risks of the information and has agreed to provide the information.





# DOÑA ANA COUNTY COMMISSION DISTRICT 2 ADA FACILITIES

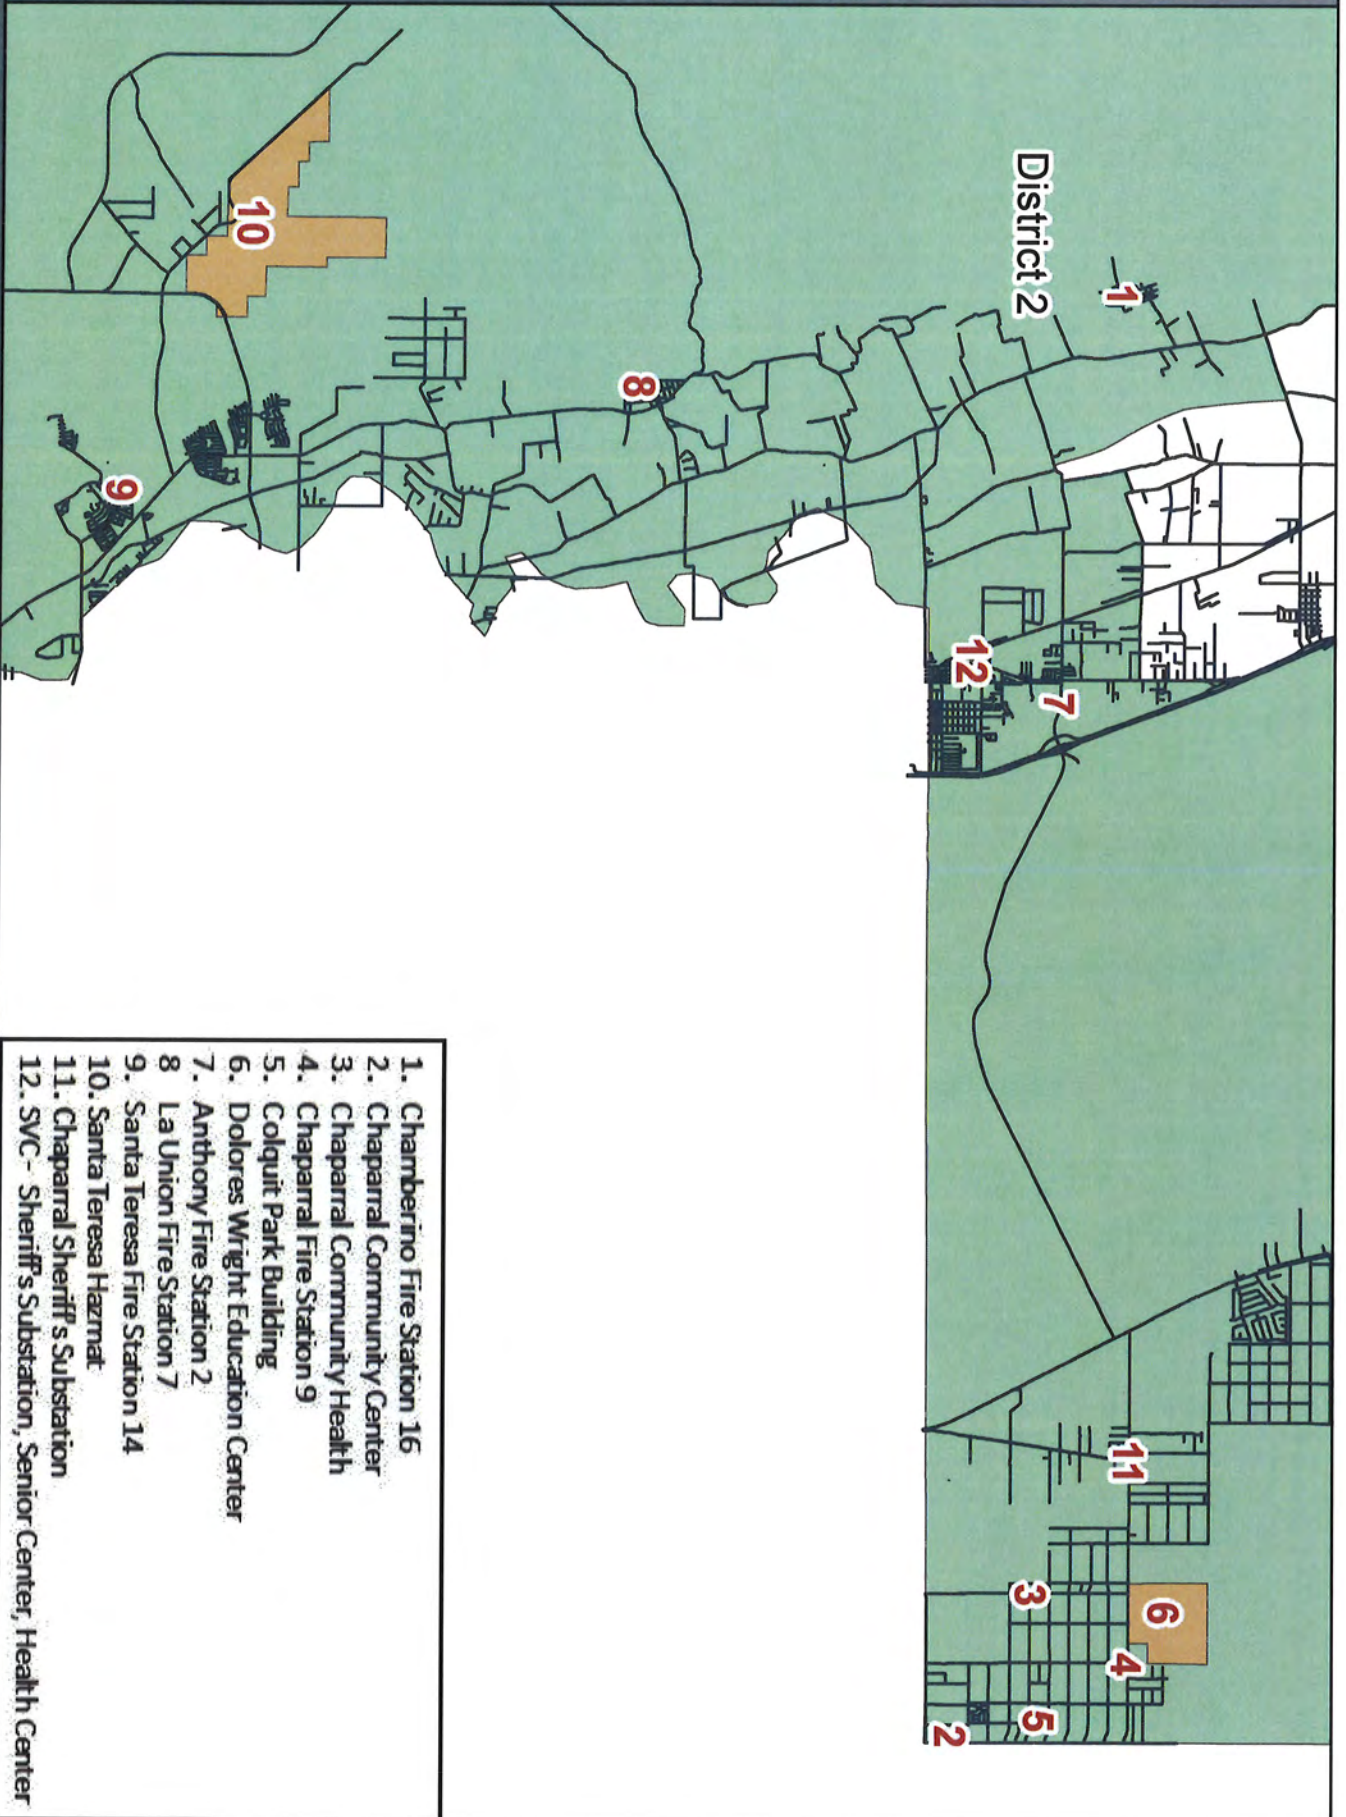

1. Chamberino Fire Station 16
2. Chaparral Community Center
3. Chaparral Community Health
4. Chaparral Fire Station 9
5. Colquit Park Building
6. Dolores Wright Education Center
7. Anthony Fire Station 2
8. La Union Fire Station 7
9. Santa Teresa Fire Station 14
10. Santa Teresa Hazmat
11. Chaparral Sheriff's Substation
12. SVC - Sheriff's Substation, Senior Center, Health Center



October 27, 2017




**DISCLAIMER:** The information on this map was prepared by the County of Doña Ana and is provided for informational purposes only. The County of Doña Ana does not warrant the accuracy, completeness, or timeliness of the information. The County of Doña Ana is not responsible for any errors or omissions, or for any consequences arising from the use of the information. The County of Doña Ana is not liable for any damages, including but not limited to, direct, indirect, or consequential damages, arising from the use of the information. The County of Doña Ana is not responsible for any actions taken by any person based on the information. The County of Doña Ana is not responsible for any actions taken by any person based on the information. The County of Doña Ana is not responsible for any actions taken by any person based on the information.







# DOÑA ANA COUNTY COMMISSION DISTRICT 4 ADA FACILITIES

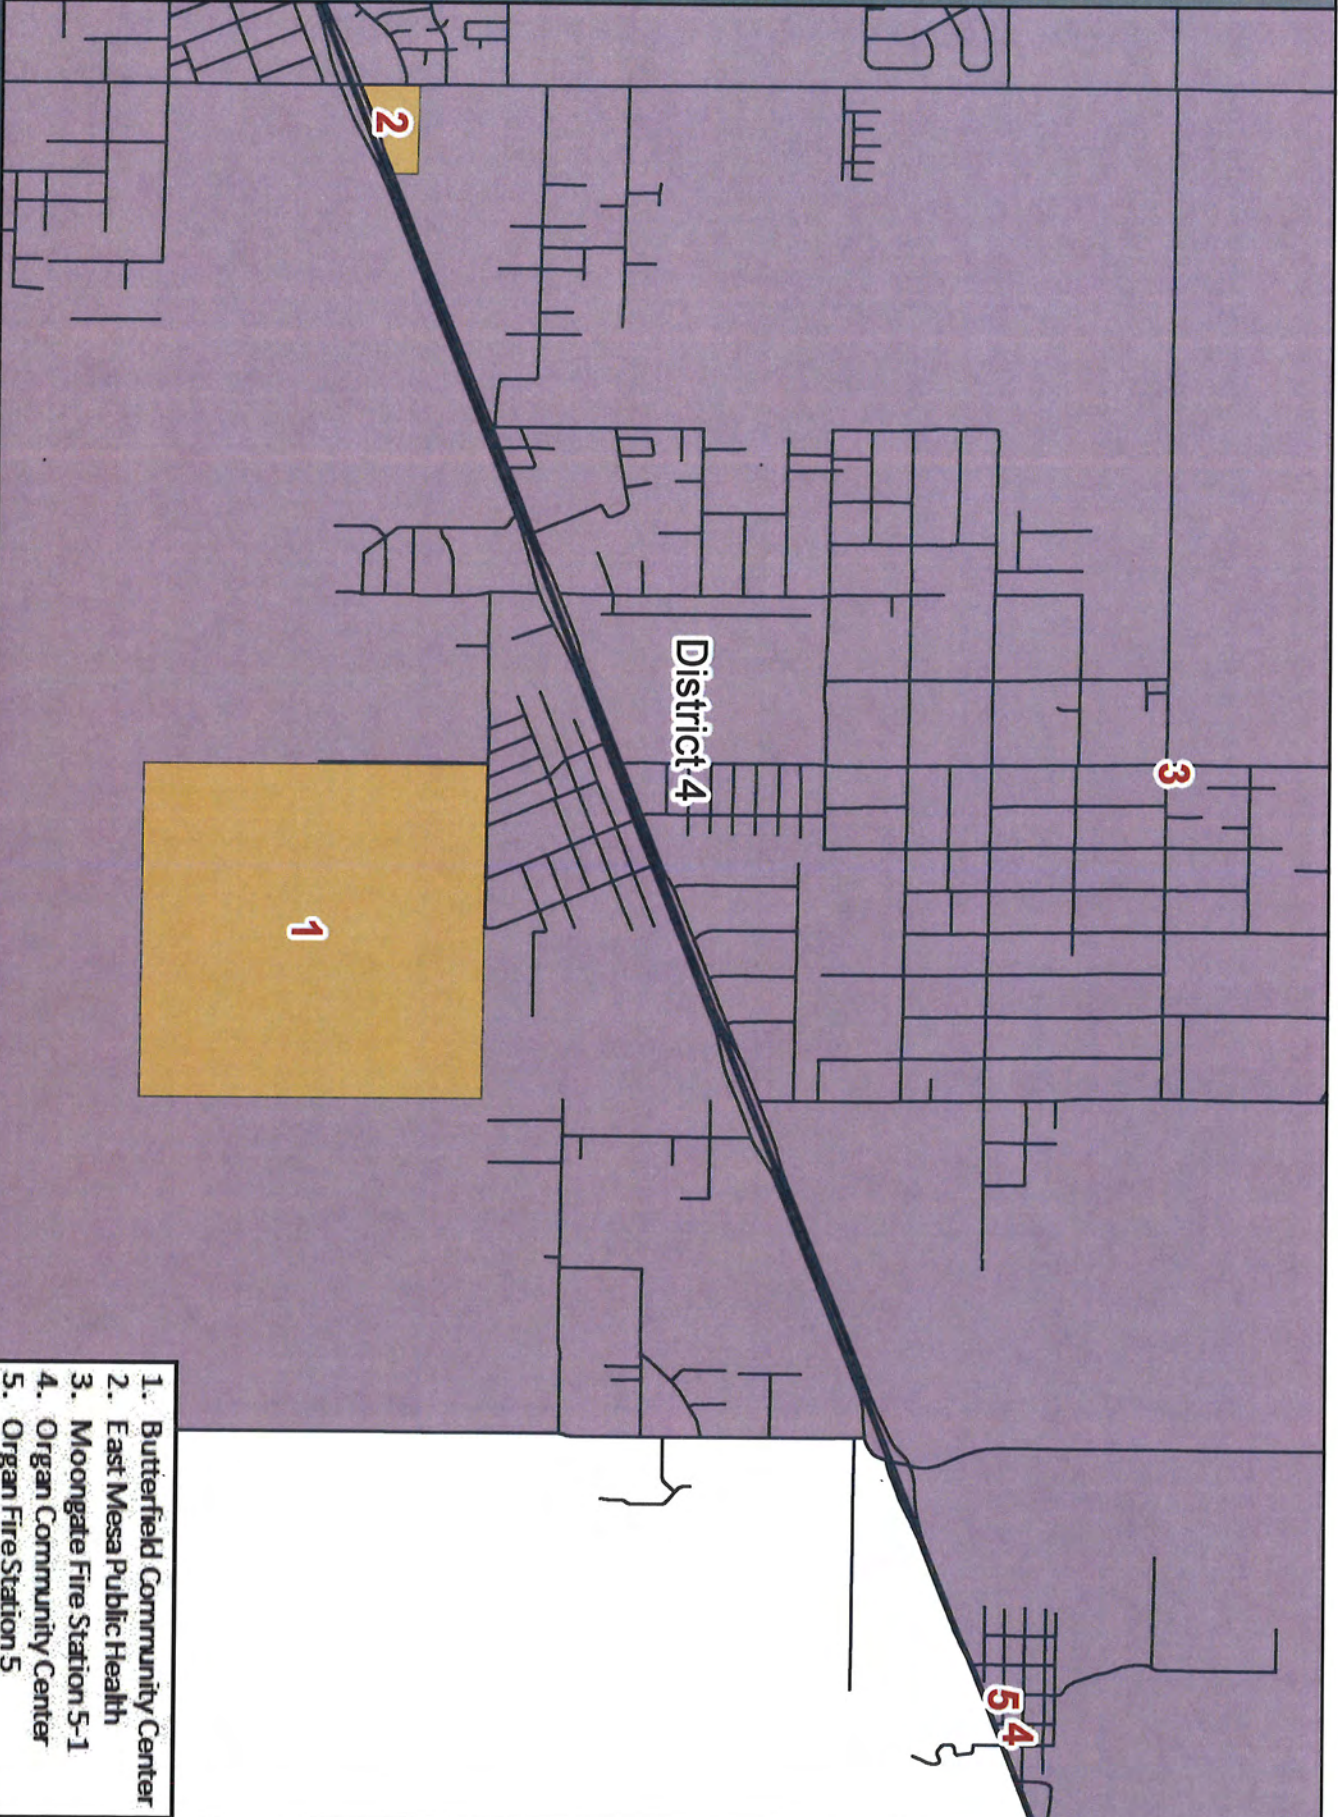

October 27, 2017

1. Butterfield Community Center
2. East Mesa Public Health
3. Moongate Fire Station 5-1
4. Organ Community Center
5. Organ Fire Station 5

SOURCE OF DATA & DISCLAIMER:  
The data provided is provided as is, without warranty of any kind, and/or expressed or implied. The data provided was obtained from public maps that were in a variety of formats. The data provided was digitized from paper maps that were in a variety of formats. The data provided was digitized from paper maps that were in a variety of formats. The data provided was digitized from paper maps that were in a variety of formats. In no event shall Doña Ana County or any of its employees be liable for any damages, including direct, indirect, incidental, consequential, or punitive damages, arising from the use of this data. The user assumes all responsibility for the use of this data. The user assumes all responsibility for the use of this data. The user assumes all responsibility for the use of this data.





## **Appendix E**

# **JGMS Physical Barriers Report**




**State of New Mexico, Doña Ana County**  
**Asset/Location: Chamberino Fire Station New, Chamberino, NM**


<b>Assessors</b> Antonio Florencio Ortega		
<b>Inspection Date</b> October 2015		
<b>Department</b> Fire	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	\$4,746.27	
<b>Priority 2:</b>	\$0.00	
<b>Priority 3:</b>	\$1,580.18	
<b>Priority 4:</b>	\$0.00	


**General Information**


The New Chamberino Fire Station, located at 301 Medina Avenue, Chamberino, NM, was built in 1990. It is a volunteer-type Fire Station that is locally run with firefighters and non-firefighting volunteers that provide services to DAC Fire District #16. This 4,758 SQFT, single-story building consists of three restrooms, a meeting room, kitchen, lounge area, office space, and an apparatus bay.


**Approach & Entrance**
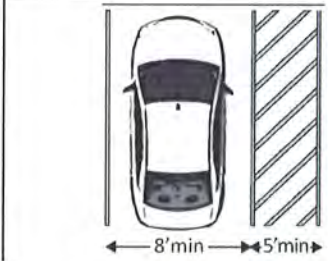
<b>ADA Standard Reference:</b>	208.2.4	
<b>Estimated Cost:</b>	\$68.67	
<b>Priority Level:</b>	Low	
<b>Barrier Description/Proposed Solution:</b> The existing "van accessible" space is not identified. An estimate has been developed for the installation of a "van accessible" sign at the designated "van accessible" space.		
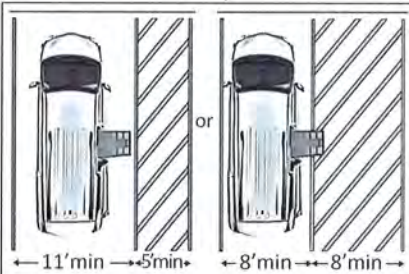
<b>ADA Standard Reference:</b>	502.2, 502.3	
<b>Estimated Cost:</b>	\$408.68	
<b>Priority Level:</b>	Low	
<b>Barrier Description/Proposed Solution:</b> The existing access aisle is 18' long by 4.6' wide. ADA Standards require that accessible spaces are at least 8' wide with an access aisle at least 5' wide. For this estimate, it is suggested that an access aisle measuring 18' long by 8' wide (144 S.F.) be painted. This estimate includes the removal of the existing access aisle paint and the installation of new paint. Access aisles should be painted with blue paint and include text that indicates "NO PARKING".		

<b>ADA Standard Reference:</b>	<b>502.4</b>	
<b>Estimated Cost:</b>	<b>\$3,999.10</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The existing access aisle slope is 3:48 in all directions. ADA Standards require that the slope of the accessible parking space and access aisle be no steeper than 1:48 in all directions. It is recommended that the surface be regraded. An estimate has been developed for the demolition of the existing paving and curbing and its reconstruction.		


<b>ADA Standard Reference:</b>	<b>216.6</b>	
<b>Estimated Cost:</b>	<b>\$83.16</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The existing entrance requires a directional sign that indicates the location of the nearest accessible entrance. An estimate has been developed for the installation of a new tactile text with Braille sign.		

<b>ADA Standard Reference:</b>	<b>404.2.7</b>	
<b>Estimated Cost:</b>	<b>\$186.66</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The existing entrance door knob is noncompliant. ADA Standards require that the door is equipped with hardware that is operable with 1 hand and does not require tight grasping, pinching or twisting of the wrist. It is suggested that a pull plate replace the door knob and an automatic door opener be added. An estimate has been developed for the installation of a new pull plate and automatic door opener.		


#### **Access to Goods & Services**


Accessibility barriers were not identified for this category.

#### **Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>216.8, 703</b>	
<b>Estimated Cost:</b>	<b>\$220.64</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> This facility has 3 restrooms; 1 which is accessible. A directional sign indicating the location of the accessible restroom should be installed at the inaccessible restrooms. 3 tactile text with Braille signs require installation. An estimate has been developed for the work item noted.		

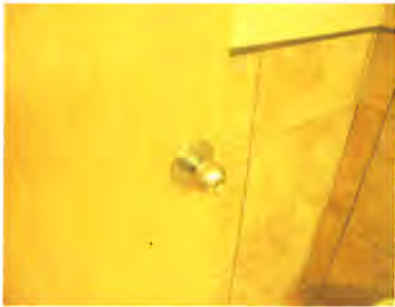

<b>ADA Standard Reference:</b>	<b>404.2.7</b>	
<b>Estimated Cost:</b>	<b>\$559.98</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The hardware on the existing restroom doors are comprised of knob type lockset. It is recommended that the locksets be replaced with lever type locksets to comply with the requirements of this section. An estimate has been developed the item noted.		
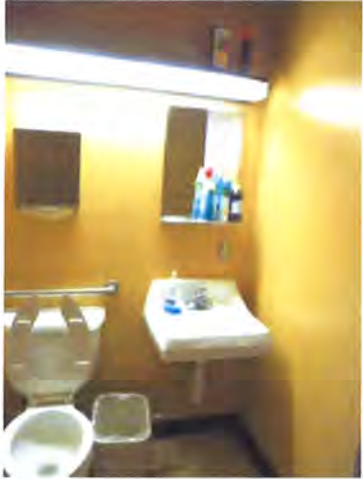
<b>ADA Standard Reference:</b>	<b>603.3, 603.4, 604.5.1, 604.5.2, 606.5</b>	
<b>Estimated Cost:</b>	<b>\$799.56</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> Several work items in the existing accessible restroom are required for compliance with the referenced sections. The existing mirror and towel dispenser require relocation to the required mounting height (603.3). The existing coat hook requires adjustment to proper mounting height of 15"-48" (603.4). The lavatory pipes require insulation to protect against contact (606.5). The existing accessible restroom lacks grab bars and requires the installation on a 36" rear grab bar and a 42" sidewall grab bar (604.5.1, 604.5.2). An estimate has been developed for the work items listed.		

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**

**Asset/Location: Chaparral Fire Station, Chaparral, NM**

<b>Assessors</b> Michael Black		
<b>Inspection Date</b> October 2015		
<b>Department</b> Fire	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$189.74</b>	
<b>Priority 2:</b>	<b>\$2,798.25</b>	
<b>Priority 3:</b>	<b>\$470.15</b>	
<b>Priority 4:</b>	<b>\$0.00</b>	

**General Information**

The Chaparral Fire Station, located at 500 E. Lisa, Chaparral, NM, was built in 1990. It is a volunteer-type Fire Station that is locally operated, and provides service to DAC Fire District #9. This 6,484 SQFT, single-story building consists of a meeting room, restrooms, kitchen, lounge area, office space, and an apparatus bay.

**Approach & Entrance**

<b>ADA Standard Reference:</b>	<b>216.6</b>
<b>Estimated Cost:</b>	<b>\$ 189.74</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> Entrances that are inaccessible do not have directional signs indicating the location of the nearest accessible entrance, and accessible entrances do not have signs with the International Symbol of Accessibility. Install 2 new signs for directional and identification purposes.	




**Access to Goods & Services**

<b>ADA Standard Reference:</b>	<b>404.2.7</b>
<b>Estimated Cost:</b>	<b>\$2,798.25</b>
<b>Priority Level:</b>	<b>Medium</b>
<b>Barrier Description/Proposed Solution:</b> The hardware on the existing interior doors is comprised of knob type lock sets. It is recommended that the lock sets be replaced with lever type sets to comply with the requirements of this section. An estimate has been developed for the item noted.	




**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>604.5.1, 604.5.2</b>
<b>Estimated Cost:</b>	<b>\$291.21</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> The existing grab bars in the Men's accessible stall do not comply with the requirements of this section. The sidewall grab bar requires relocation to the appropriate mounting height and the rear wall grab bar needs to be replaced with the appropriate sized bar. An estimate has been developed for the items noted.	

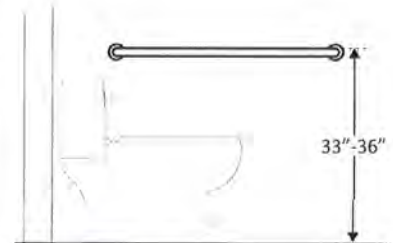

<b>ADA Standard Reference:</b>	<b>703.3</b>
<b>Estimated Cost:</b>	<b>\$70.59</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> The existing restroom door sign does not have Braille. An estimate has been developed for the installation of 1 new tactile text with Braille sign.	

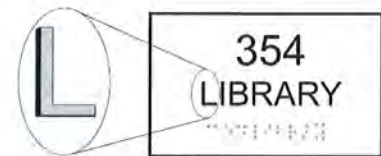



<b>ADA Standard Reference:</b>	<b>404.2.8.1, 404.2.9</b>	
<b>Estimated Cost:</b>	<b>\$108.35</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing Women’s restroom door takes a considerable amount of effort to open (more than 5 lbs of force) and closes in less than 5 seconds. An estimate has been developed for the adjustment of the door closer.</p>		

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**

**Asset/Location: Fairacres Fire Station, Las Cruces, NM**

<b>Assessors</b> Michael Black		
<b>Inspection Date</b> November 2015		
<b>Department</b> Fire	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$3,180.87</b>	
<b>Priority 2:</b>	<b>\$106.58</b>	
<b>Priority 3:</b>	<b>\$1,927.91</b>	
<b>Priority 4:</b>	<b>\$0.00</b>	

**General Information**

The Fairacres Fire Station, located at 5208 Quesenberry, Las Cruces, NM, was built in 1991. It is an all-hazard fire, rescue, and emergency medical service, and is a volunteer-type Fire Department that provides services to Doña Ana County Fire District #12, an area adjacent and west of Las Cruces, New Mexico. The Fair Acres Fire Station specifically protects the communities of Fairacres, Mesilla Hills, Old Picacho and Picacho Hills. It is a single-story building consisting of 4,833 SQFT, and consists of a meeting room, restrooms, kitchen, lounge area, office space and an apparatus bay.

**Approach & Entrance**

<b>ADA Standard Reference:</b>	<b>208.2.4, 502.2, 502.3, 502.6</b>	
<b>Estimated Cost:</b>	<b>\$807.61</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing parking lot has 13 parking spaces; 1 which is an ADA handicap parking space. An access aisle has not been provided; it is recommended that the existing parking space to the right of the handicap space be converted to a “van accessible” space and the existing space be converted into an access aisle. Access aisles should be painted with blue paint and include text that indicates “NO PARKING”. A new sign should be installed indicating the space as “van accessible”.</p>		

<b>ADA Standard Reference:</b>	405.3, 406.1, 406.3	
<b>Estimated Cost:</b>	\$2,196.53	
<b>Priority Level:</b>	High	
<b>Barrier Description/Proposed Solution:</b> The existing curb ramp has a slope of 1:7. ADA Standards require that the running slope of the curb ramp be no steeper than 1:12. An estimate has been developed for the construction of a new curb ramp adjacent to the access aisle.		

<b>ADA Standard Reference:</b>	303.2, 404.2.5, 404.2.8	
<b>Estimated Cost:</b>	\$70.15	
<b>Priority Level:</b>	Low	
<b>Barrier Description/Proposed Solution:</b> There is a 1" concrete step up to the threshold of the door. ADA Standards require that a step be no more than 1/2" high with the top 1/4" beveled and no steeper than 1:2. An estimate has been developed for the installation of a threshold.		

<b>ADA Standard Reference:</b>	404.2.8	
<b>Estimated Cost:</b>	\$106.58	
<b>Priority Level:</b>	Low	
<b>Barrier Description/Proposed Solution:</b> The entry door closes in less than 5 seconds. An estimate has been developed to adjust the door closer.		


**Access to Goods & Services**


<b>ADA Standard Reference:</b>	404.2.9	
<b>Estimated Cost:</b>	106.58	
<b>Priority Level:</b>	Low	
<b>Barrier Description/Proposed Solution:</b> The entry door takes a considerable amount of effort to open (more than 5 lbs of force). An estimate had been developed to adjust the door closer.		


**Toilet Rooms**

<b>ADA Standard Reference:</b>	404.29, 404.2.8.1	
<b>Estimated Cost:</b>	\$216.70	
<b>Priority Level:</b>	Medium	
<b>Barrier Description/Proposed Solution:</b> The restroom doors take a considerable amount of effort to open (over 5 lbs of force) and close in less than 5 seconds. An estimate has been developed to adjust the door closers.		

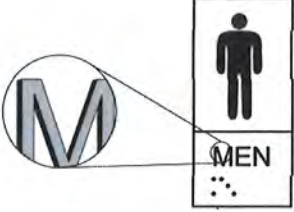

<b>ADA Standard Reference:</b>	703.5	
<b>Estimated Cost:</b>	\$288.10	
<b>Priority Level:</b>	Medium	
<b>Barrier Description/Proposed Solution:</b> The restrooms require the installation of new signs. An estimate has been developed for the installation of 3 new tactile text with Braille signs. The sign at the main restroom should indicate the direction of the accessible restroom.		

<b>ADA Standard Reference:</b>	404.2.7	
<b>Estimated Cost:</b>	\$559.98	
<b>Priority Level:</b>	Medium	
<b>Barrier Description/Proposed Solution:</b> The hardware on the existing restroom doors is comprised of knob type lockets. An estimate has been developed to remove and replace the knob type lockets with lever type locksets.		

<b>ADA Standard Reference:</b>	308.2, 603.3, 603.4, 604.5.1, 604.5.2, 606.4	
<b>Estimated Cost:</b>	\$863.13	
<b>Priority Level:</b>	Low	
<b>Barrier Description/Proposed Solution:</b> Several work items in the existing accessible restroom are required for compliance with the referenced sections. The existing mirror requires relocation to the required mounting height (603.3). An additional coat hook requires installation (603.4). The lavatory pipes require insulation to protect against contact (606.5). The paper towel dispenser requires vertical adjustment (308.2). The existing sidewall and rear wall grab bars need to be replaced with an appropriate 42" and 36" bar (604.5.1, 604.5.2). The flush control on the water closet requires relocation to the open side of the unit (604.6).		

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**


**Asset/Location: Fire Administration, Las Cruces, NM**


<b>Assessors</b> Antonio Florencio Ortega		
<b>Inspection Date</b> October 2015		
<b>Department</b> Fire	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	\$2,737.14	
<b>Priority 2:</b>	\$106.58	
<b>Priority 3:</b>	\$553.65	
<b>Priority 4:</b>	\$0.00	

**General Information**


The Fire Administration Office, located at 1490 Portland Drive, Las Cruces, NM, was built in 2009. This facility houses administrative staff that oversees the operations, prevention, and training of DAC Fire and Emergency Services, as well as the Hazardous Materials Response Team in coordination with 16 district chiefs. This 12,000 SQFT, single-story building consists of a meeting room, kitchen, office areas, restrooms and an apparatus bay.

**Approach & Entrance**

<b>ADA Standard Reference:</b>	<b>208.2.4, 502.2, 502.3, 502.6</b>	
<b>Estimated Cost:</b>	<b>\$2,485.75</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The existing accessible parking requires reconfiguration to comply with the requirements of the referenced sections. Work items to include: restriping for 2 “van accessible” spaces that align with the entrance and installation of 2 new ADA parking signs. Access aisles should be painted with blue paint and include text that indicates “NO PARKING”.		


<b>ADA Standard Reference:</b>	<b>302.1</b>	
<b>Estimated Cost:</b>	<b>\$251.39</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The sidewalk has a 4"x6" channel without a culvert. ADA Standards require that the concrete route is stable, firm and slip-resistant. An estimate has been developed for the installation of a new sidewalk culvert to allow for a stable and firm surface.		


**Access to Goods & Services**

<b>ADA Standard Reference:</b>	<b>404.2.4</b>	
<b>Estimated Cost:</b>	<b>\$106.58</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The existing door in the hallway creates an obstruction. ADA Standards require that there is a front approach to the pull side of the door and that there is at least 18” of maneuvering clearance beyond the latch, with at least 60” of clear depth. An estimate has been developed for the removal of the door in the hallway to provide for a clear path.		



**Toilet Rooms**

<b>ADA Standard Reference:</b>	703.2, 703.3, 703.4.1, 703.4.2	
<b>Estimated Cost:</b>	\$228.96	
<b>Priority Level:</b>	Medium	
<b>Barrier Description/Proposed Solution:</b> 3 door signs are noncompliant; the sign in the hallway leading to the restroom and both signs at the restrooms. An estimate has been developed for the installation of 3 new tactile text with Braille signs.		

<b>ADA Standard Reference:</b>	603.3, 604.5.1, 604.5.2	
<b>Estimated Cost:</b>	\$324.69	
<b>Priority Level:</b>	Low	
<b>Barrier Description/Proposed Solution:</b> Several work items in the existing accessible restroom are required for compliance with the referenced sections. The existing mirror requires relocation to the required mounting height (603.3). The existing sidewall grab bar needs to be replaced with an appropriate 42" bar (604.5.1). The rear wall grab bar requires horizontal adjustment (604.5.2). An estimate has been developed for the work items listed.		

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**


**Asset/Location: Fire Station 11, Garfield, NM**


<b>Assessors</b> Michael Black		
<b>Inspection Date</b> October 2015		
<b>Department</b> Fire	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	\$2,933.66	
<b>Priority 2:</b>	\$0.00	
<b>Priority 3:</b>	\$1,489.58	
<b>Priority 4:</b>	\$0.00	

**General Information**

Fire Station 11, located at Highway 187, Garfield, NM, was built in 1986. It is a volunteer-type Fire Station that is locally operated, and provides service to DAC Fire District #11. This 5,616 SQFT, single-story building consists of a meeting room, office space, kitchen, restrooms and an apparatus bay.

**Approach & Entrance**


<b>ADA Standard Reference:</b>	<b>208.2.4, 208.3.1, 502</b>	
<b>Estimated Cost:</b>	<b>\$2,685.01</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The existing accessible parking requires reconfiguration to comply with requirements of the referenced sections. The parking area has a drainage swale that goes through the access aisle creating a slope greater than 1:48. The access aisle does not adjoin an accessible route. There is not a sign with the International Symbol of Accessibility and "van accessible" denotation installed. The accessible stall is not located at the closest route to the entrance. Access aisles should be painted with blue paint and include text that indicates "NO PARKING". An estimate has been developed to reconfigure the parking to comply with the requirements of the referenced sections.		


<b>ADA Standard Reference:</b>	<b>404.2.4</b>	
<b>Estimated Cost:</b>	<b>\$248.65</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> At the existing entry door the threshold has a 2" step. An estimate has been developed for the installation of a threshold ramp.		

**Access to Goods & Services**


Accessibility barriers were not identified for this category.


**Toilet Rooms**


<b>ADA Standard Reference:</b>	<b>216.8, 703</b>	
<b>Estimated Cost:</b>	<b>\$211.77</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> This facility has 2 restrooms; 1 which is accessible. A sign indicating accessibility is required to comply with the referenced sections. An estimate has been developed for the installation of a new tactile text with Braille sign.		

<b>ADA Standard Reference:</b>	<b>404.2.4</b>	
<b>Estimated Cost:</b>	<b>\$218.56</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> Each of the restroom doors has a built-up threshold that is greater than 1.5". This creates a tripping hazard and blocks wheelchair access. An estimate has been developed to remove the built-up threshold and install new tile to match.		

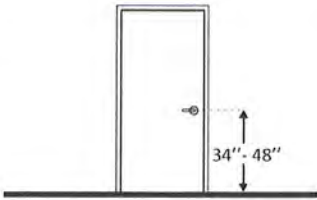

<b>ADA Standard Reference:</b>	404.2.7	
<b>Estimated Cost:</b>	\$373.32	
<b>Priority Level:</b>	Low	
<b>Barrier Description/Proposed Solution:</b> The existing restroom doors have knob type locksets and require lever type locksets. An estimate has been developed for the removal and replacement of the knob type locksets to lever type locksets.		

<b>ADA Standard Reference:</b>	604.2	
<b>Estimated Cost:</b>	\$239.09	
<b>Priority Level:</b>	Low	
<b>Barrier Description/Proposed Solution:</b> The distance of the water closet in the noncompliant restroom is greater than the maximum 18" to the centerline. Making the other available restroom accessible would not require the relocation of this unit; however, an estimate for the relocation of the water closet has been developed.		

<b>ADA Standard Reference:</b>	604.5.1, 604.5.2	
<b>Estimated Cost:</b>	\$446.84	
<b>Priority Level:</b>	Medium	
<b>Barrier Description/Proposed Solution:</b> The grab bars in both restrooms require adjustments to comply with the requirements of this section.		

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**

**Asset/Location: Fire Station 14, Doña Ana, NM**

<b>Assessors</b> Michael Black		
<b>Inspection Date</b> October 2015		
<b>Department</b> Fire	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	\$4,038.83	
<b>Priority 2:</b>	\$0.00	
<b>Priority 3:</b>	\$811.93	
<b>Priority 4:</b>	\$0.00	

**General Information**


Fire Station 14, located at 601 Doña Ana School Road, Doña Ana, NM, was built in 1986. It is a volunteer-type Fire Station that is locally operated, and provides service to DAC Fire District #1. This 5,836 SQFT, single-story building consists of a meeting room, office space, kitchen, restroom, and an apparatus bay.

**Approach & Entrance**


<b>ADA Standard Reference:</b>	208.3.1 , 502.3.3 , 502.4
<b>Estimated Cost:</b>	\$3,616.68
<b>Priority Level:</b>	Low
<b>Barrier Description/Proposed Solution:</b> The existing accessible parking has a slope that exceeds 1:48 and the markings are faded. An estimate has been developed for the removal and replacement of the existing asphalt, correction of the slopes, and re-painting of the pavement markings. The space is currently third from the entry. It is recommended that during reconfiguration of the parking, the space be placed at a location closest to the accessible route. Access aisles should be painted with blue paint and include text that indicates "NO PARKING".	



<b>ADA Standard Reference:</b>	502.6
<b>Estimated Cost:</b>	\$313.80
<b>Priority Level:</b>	Low
<b>Barrier Description/Proposed Solution:</b> The existing ADA accessible parking sign is mounted below the allowable mounting height. An estimate has been developed to replace the sign with a new sign that is mounted at the correct height and designated as a "van accessible" space.	

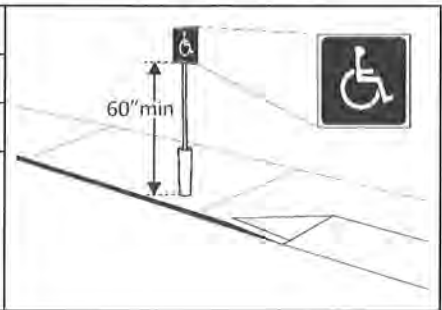

<b>ADA Standard Reference:</b>	404.2.8.1, 404.2.9
<b>Estimated Cost:</b>	\$108.35
<b>Priority Level:</b>	Medium
<b>Barrier Description/Proposed Solution:</b> The existing entry door takes a considerable amount of effort to open (more than 5 lbs of force) and close in less than 5 seconds. An estimate has been developed to adjust the door closer.	

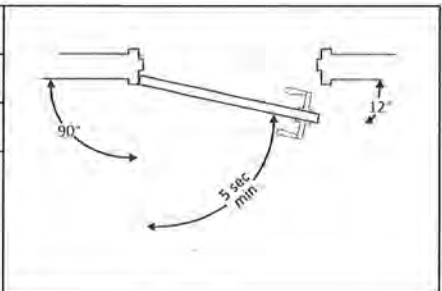


**Access to Goods & Services**


Accessibility barriers were not identified for this category.


**Toilet Rooms**


<b>ADA Standard Reference:</b>	603.4
<b>Estimated Cost:</b>	\$29.30
<b>Priority Level:</b>	Low
<b>Barrier Description/Proposed Solution:</b> The coat hook that is provided is installed above the maximum height. An estimate has been developed for the installation of a new coat hook.	

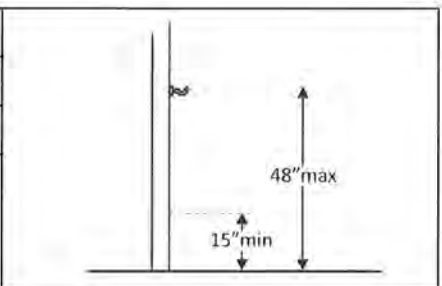




<b>ADA Standard Reference:</b>	<b>604.2</b>	
<b>Estimated Cost:</b>	<b>\$239.09</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The centerline of the water closet exceeds the maximum distance from the side wall. An estimate has been developed to adjust the water closer to meet the requirements of this section.		

<b>ADA Standard Reference:</b>	<b>604.5.1, 604.5.2</b>	
<b>Estimated Cost:</b>	<b>\$223.42</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The existing grab bars in the accessible restroom do not comply with the requirements of this section. An estimate has been developed to adjust the sidewall and rear wall grab bars to the appropriate mounting requirements.		


<b>ADA Standard Reference:</b>	<b>216.8, 703.3</b>	
<b>Estimated Cost:</b>	<b>\$211.77</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> This facility has 2 restrooms; 1 which is accessible and marked as the "Women's" restroom. Both restrooms require new ADA compliant signs. An estimate has been developed for the installation of new tactile text with Braille signs.		
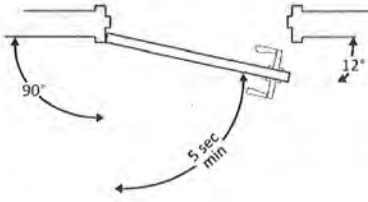
<b>ADA Standard Reference:</b>	<b>404.2.8.1, 404.2.9</b>	
<b>Estimated Cost:</b>	<b>\$108.35</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The existing Women's restroom door closes in less than 5 seconds. An estimate has been developed to adjust the door closer.		

**Additional Access**

Accessibility barriers were not found for this category.


State of New Mexico, Doña Ana County  
 Asset/Location: Fire Station 2, Anthony, NM


<b>Assessors</b> Antonio Florencio Ortega		
<b>Inspection Date</b> October 2015		
<b>Department</b> Fire	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	\$4,008.74	
<b>Priority 2:</b>	\$2,448.14	
<b>Priority 3:</b>	\$3,790.37	
<b>Priority 4:</b>	\$3,284.71	

**General Information**

Fire Station 2, located at 1055 O'Hara Street, Anthony, NM, was built in 1990. It is a volunteer-type Fire Station that is locally run with firefighters and non-firefighting volunteers that provide services to DAC Fire District #2. This 4,888 SQFT, single-story building consists of restrooms, a meeting room, kitchen, lounge area, office space, and an apparatus bay.

**Approach & Entrance**


<b>ADA Standard Reference:</b>	208.2	
<b>Estimated Cost:</b>	\$3,819.00	
<b>Priority Level:</b>	High	
<b>Barrier Description/Proposed Solution:</b> The existing gravel parking lot requires several work items to be in compliance. An estimate has been developed for the following items: construction of a new concrete pad, installation of 2 new accessible spaces and access aisle, pavement markings, parking bumpers, and a new handicap sign. Access aisles should be painted with blue paint and include text that indicates "NO PARKING".		

<b>ADA Standard Reference:</b>	216.6	
<b>Estimated Cost:</b>	\$189.74	
<b>Priority Level:</b>	Low	
<b>Barrier Description/Proposed Solution:</b> Entrances that are inaccessible do not have directional signs indicating the location of the nearest accessible entrance, and accessible entrances do not have signs with the International Symbol of Accessibility. An estimate has been developed for the installation of 2 new signs for directional and identification purposes.		



**Access to Goods & Services**

<b>ADA Standard Reference:</b>	<b>307.2, 307.4</b>
<b>Estimated Cost:</b>	<b>\$ 0.00</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> Currently there is a wall mounted first aid kit, as well as a wall mounted fire extinguisher that protrude more than 4" into the circulation path with the bottom edge more than 27" AFF and the bottom leading edge lower than 80" AFF. An estimate has been developed for the relocation of the objects to the appropriate locations that do not protrude into the circulation path, but that maintain the spacing requirements set forth by other codes. This is a no cost effort.	

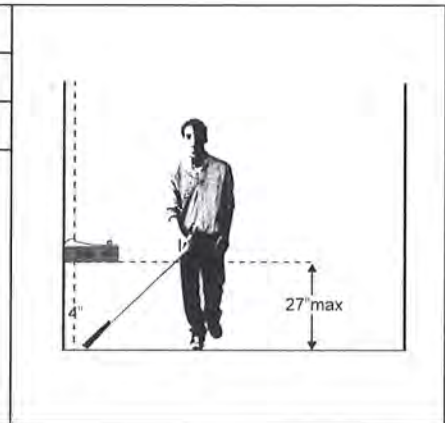


<b>ADA Standard Reference:</b>	<b>703.2, 703.3</b>
<b>Estimated Cost:</b>	<b>\$423.54</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> Existing room signs do not have raised text characters that contrast with their backgrounds and do not have Braille. An estimate has been developed for the installation of 6 new tactile text with Braille signs.	




<b>ADA Standard Reference:</b>	<b>404.2.7</b>
<b>Estimated Cost:</b>	<b>\$1,679.94</b>
<b>Priority Level:</b>	<b>Medium</b>
<b>Barrier Description/Proposed Solution:</b> The hardware on the existing interior doors is comprised of various knob type locksets. It is recommended that the knob type locksets be replaced with lever type locksets to comply with the requirements of this section. An estimate has been developed for the item noted.	



<b>ADA Standard Reference:</b>	<b>903</b>
<b>Estimated Cost:</b>	<b>\$127.96</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> The Men's locker room currently provides a bench that does not comply with the referenced section. An estimate has been developed for the removal and replacement of the bench with a new bench that does comply with the dimensions required by the ADA.	

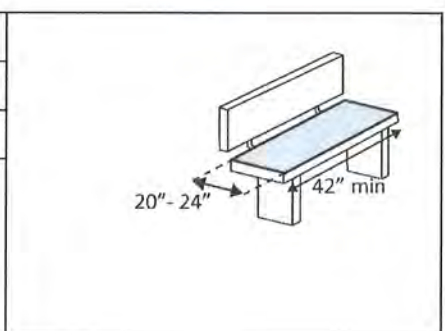

<b>ADA Standard Reference:</b>	<b>404.2.8.1</b>
<b>Estimated Cost:</b>	<b>\$216.70</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> The existing restroom doors come to a full close in less than 3 seconds. The ADA Standard requires that the door take at least 5 seconds to close from an open position of 90 degrees to a position that is 12 degrees from the latch. An estimate has been developed to adjust the door closers.	

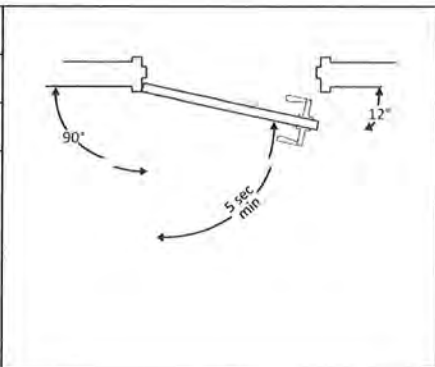

**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>603.3, 603.4, 604.2, 604.4, 604.5.1, 604.5.2, 604.8.1.1, 604.8.1.2, 606.5, 608.2.2</b>
<b>Estimated Cost:</b>	<b>\$3,790.37</b>
<b>Priority Level:</b>	<b>Medium</b>
<b>Barrier Description/Proposed Solution:</b> Several work items in the existing Men's restroom are required for compliance with the referenced sections. The mirror is mounted above the maximum height of 40" AFF (603.3). The provided coat hook is mounted above the maximum height of 54" AFF (603.4). Lavatory pipes require insulation to protect against contact (606.5). The soap dispenser is mounted above the maximum height of 48" AFF (608.2.2). The distance of the water closet is further away from the side wall than the maximum 18" (604.2). The height of the water closet is below the minimum height of 17" (604.4). The grab bars provided do not comply with the ADA requirements (604.5.1, 604.5.2). The existing toilet compartment does not comply with the minimum clear space requirements (604.8.1.1, 604.8.1.2). An estimate has been developed for the work items listed.	



**Additional Access**

<b>ADA Standard Reference:</b>	<b>602.5</b>
<b>Estimated Cost:</b>	<b>\$3,284.71</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> The existing drinking fountain does not comply with the requirements of this section. An estimate has been developed for the removal and replacement of the existing fountain with a new compliant unit.	






**State of New Mexico, Doña Ana County**  
**Asset/Location: Fire Station 5-1, East Mesa, NM**

<b>Assessors</b> Michael Black		
<b>Inspection Date</b> October 2015		
<b>Department</b> Fire	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	\$4,559.44	
<b>Priority 2:</b>	\$1,306.62	
<b>Priority 3:</b>	\$562.57	
<b>Priority 4:</b>	\$0.00	


**General Information**

Fire Station 5-1, located at 6900 Moongate Road, East Mesa, NM, was built in 1998. It is a volunteer-type Fire Station that is locally operated, and provides service to DAC Fire District #5. This 4,880 SQFT, single-story building consists of a meeting room, office space, kitchen, restrooms and an apparatus bay.

**Approach & Entrance**

<b>ADA Standard Reference:</b>	208.2.4, 502.4, 502.6	
<b>Estimated Cost:</b>	\$4,559.44	
<b>Priority Level:</b>	Medium	
<b>Barrier Description/Proposed Solution:</b> The existing accessible parking space requires several work items for compliance with the referenced sections. The slope of the space exceeds 1:48, it is not designated as "van accessible" and the sign requires appropriate mounting. It is recommended that the existing asphalt be removed and a new concrete pad be installed that is in compliance with the referenced sections. New access aisles should be painted with blue paint and include text that indicates "NO PARKING". An estimate has been developed for the work items listed.		

**Access to Goods & Services**

<b>ADA Standard Reference:</b>	404.2.7	
<b>Estimated Cost:</b>	\$1,306.62	
<b>Priority Level:</b>	Medium	
<b>Barrier Description/Proposed Solution:</b> The hardware on the existing interior doors is comprised of knob type locksets. It is recommended that the knob type locksets be replaced with lever type locksets to comply with the requirements of this section. An estimate has been developed for the item noted.		



**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>216.8, 703</b>	
<b>Estimated Cost:</b>	<b>\$211.17</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>This facility has 2 restrooms; 1 is accessible. A directional sign indicating the location of the accessible restroom should be installed at the inaccessible restroom and the sign at the accessible restroom should indicate ADA accessibility. An estimate has been developed for the installation of 2 new tactile text with Braille signs.</p>		

<b>ADA Standard Reference:</b>	<b>308.2</b>	
<b>Estimated Cost:</b>	<b>\$111.71</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing paper towel dispenser is located above the lavatory and is installed above the maximum height of 48" AFF. It is recommended that the unit be relocated to a side wall location or the height be adjusted to comply with the requirements of this section. An estimate has been developed for the item noted.</p>		

<b>ADA Standard Reference:</b>	<b>605.4</b>	
<b>Estimated Cost:</b>	<b>\$239.09</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing flush controls on the water closet are on the closed side of the unit and require relocation to the open side of the unit. An estimate has been developed for the item noted.</p>		

**Additional Access**

Accessibility barriers were not found for this category.

**State of New Mexico, Doña Ana County**

**Asset/Location: Fire Station 6, Rincon, NM**

<b>Assessors</b>		
Michael Black		
<b>Inspection Date</b>		
November 2015		
<b>Department</b>	<b>Asset Type</b>	
Fire	Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$0.00</b>	
<b>Priority 2:</b>	<b>\$216.70</b>	
<b>Priority 3:</b>	<b>\$654.66</b>	
<b>Priority 4:</b>	<b>\$0.00</b>	

**General Information**

Fire Station 6, located at 255 Harlins Street, Rincon, NM, was built in 1987. It is a volunteer-type Fire Station that is locally operated, and provides service to DAC Fire District #6. This 3,200 SQFT, single-story building consists of a meeting room, office space, kitchen, lounge area, restrooms and an apparatus bay.

**Approach & Entrance**

Accessibility barriers were not identified for this category.

**Access to Goods & Services**

<b>ADA Standard Reference:</b>	<b>404.2.8.1</b>	<p>A schematic diagram of a door. A curved arrow indicates a 90-degree swing. Another curved arrow indicates a closing time of 5 seconds. A vertical dimension line on the right indicates a height of 12 feet.</p>
<b>Estimated Cost:</b>	<b>\$216.70</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing doors to the meeting room fully close in less than 5 seconds. An estimate has been developed for the adjustment of the door closers.</p>		

**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>308.2</b>	<p>A photograph showing the interior of a restroom stall. A paper towel dispenser is mounted on the wall. The stall includes a toilet and a sink.</p>
<b>Estimated Cost:</b>	<b>\$223.42</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The paper towel dispensers in both unisex restrooms are 50" AFF. An estimate has been developed for the adjustment of the dispensers mounting height to meet the requirements of the referenced section.</p>		

<b>ADA Standard Reference:</b>	<b>604.8.1.2</b>	<p>A schematic diagram of a door with a self-closing mechanism. A curved arrow indicates the door's swing. A vertical dimension line on the right indicates a height of 12 feet.</p>
<b>Estimated Cost:</b>	<b>\$431.24</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The doors to the accessible stalls in the Men's and Women's restrooms are not self-closing. An estimate has been developed for the adjustment or replacement of the doors.</p>		

**Additional Access**

Accessibility barriers were not identified for this category.




State of New Mexico, Doña Ana County  
 Asset/Location: Fire Station 8, Radium Springs, NM


<b>Assessors</b> Michael Black		
<b>Inspection Date</b> November 2015		
<b>Department</b> Fire	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$4,759.70</b>	
<b>Priority 2:</b>	<b>\$539.37</b>	
<b>Priority 3:</b>	<b>\$1,900.81</b>	
<b>Priority 4:</b>	<b>\$0.00</b>	

**General Information**


Fire Station 8, located at 12212 Leasburg Drive, Radium Springs, NM, was built in 1991. It is a volunteer-type Fire Station that is locally operated, and provides service to DAC Fire District #8. This 5,154 SQFT, single-story building consists of a meeting room, office space, kitchen, lounge, restrooms, and an apparatus bay.

**Approach & Entrance**


<b>ADA Standard Reference:</b>	<b>208.2.4, 502.2, 502.3, 502.6</b>	
<b>Estimated Cost:</b>	<b>\$3,167.53</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The existing parking lot has 12 parking spaces; 1 which is ADA accessible. ADA Standards require that there be at least 1 "van accessible" space. The existing parking surface is chip and seal and does not provide a level surface. An estimate has been developed for the installation of a new 13'x22' concrete pad with appropriate pavement markings and ADA signs. Access aisles should be painted with blue paint and include text that indicates "NO PARKING".		


<b>ADA Standard Reference:</b>	<b>502.3</b>	
<b>Estimated Cost:</b>	<b>\$539.37</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The existing diagonal curb ramp is only accessible by entering traffic lanes. ADA Standards require that access aisles adjoin an accessible route. An estimate has been developed for the construction of a curb cut at the existing access aisles. This estimate includes demolition where the curb and access aisle meet, replacement of a new sidewalk access route, base course, and tactile warning tiles.		


**Access to Goods & Services**

<b>ADA Standard Reference:</b>	<b>404.2.7, 404.2.8</b>	
<b>Estimated Cost:</b>	<b>\$539.37</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> All interior doors are equipped with knob type locksets and require replacement with lever type locksets. An estimate has been developed for the installation of lever type locksets.		


**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>216.8</b>	
<b>Estimated Cost:</b>	<b>\$288.10</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The existing restroom signs are noncompliant. ADA Standards require that sign text characters contrast with their backgrounds. It is recommended that new signs be put up at each of the restroom entrances. An estimate has been developed for the installation of 3 new tactile text with Braille signs. In addition, signs at the main restrooms should indicate the direction of the nearest accessible restroom.		

<b>ADA Standard Reference:</b>	<b>404.2.4</b>	
<b>Estimated Cost:</b>	<b>\$254.31</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The existing lockers block the maneuvering clearances in the room. There is currently 53" of clear depth and 5" of maneuvering clearance. ADA Standards require that if there is a front approach to the pull side of the door, that there be at least 18" of maneuvering clearance beyond the latch side of the door, with an additional 60" of clear depth. An estimate has been developed to remove the lockers to create more space.		

<b>ADA Standard Reference:</b>	<b>404.2.7</b>	
<b>Estimated Cost:</b>	<b>\$539.37</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The existing restrooms are equipped with knob type locksets and require replacement with lever type locksets. An estimate has been developed for the installation of 3 new lever type locksets.		



<b>ADA Standard Reference:</b>	603.3, 603.4, 604.5.1, 604.5.2, 606.4, 606.5	
<b>Estimated Cost:</b>	\$819.03	
<b>Priority Level:</b>	Low	
<b>Barrier Description/Proposed Solution:</b> Several work items in the existing accessible restroom are required for compliance with the referenced sections. The existing mirror and towel dispenser require removal and replacement with a combined mirror and towel dispenser (603.3) The existing coat hook requires relocation to the required mounting height (603.4). The lavatories piping requires insulation to protect against contact (606.5). The faucet requires removal and replacement (606.4). Both sidewall and rear wall grab bars require installation (605.1, 605.2). The flush control on the water closet requires relocation to the open side of the unit (604.6). An estimate has been developed for the work items listed.		

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**

**Asset/Location: La Mesa Fire Station, La Mesa, NM**

<b>Assessors</b> Michael Black		
<b>Inspection Date</b> October 2015		
<b>Department</b> Fire	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	\$0.00	
<b>Priority 2:</b>	\$108.35	
<b>Priority 3:</b>	\$70.59	
<b>Priority 4:</b>	\$0.00	


**General Information**

The La Mesa Fire Station (New), located at 15765 Highway 28, La Mesa, NM, was built in 2002. It is a volunteer-type Fire Station that is locally operated, and provides service to DAC Fire District #4. This 8,800 SQFT, two-story building consists of a meeting room, restrooms, kitchen, lounge area, office space, and an apparatus bay.


**Approach & Entrance**

Accessibility barriers were not identified for this category.

**Access to Goods & Services**

<b>ADA Standard Reference:</b>	404.2.9	
<b>Estimated Cost:</b>	\$108.35	
<b>Priority Level:</b>	Low	
<b>Barrier Description/Proposed Solution:</b> The existing door into the meeting room takes a considerable amount of effort to open (more than 5 lbs of force). An estimate has been developed to adjust the door closer.		

**Toilet Rooms**

<b>ADA Standard Reference:</b>	703	
<b>Estimated Cost:</b>	\$70.59	
<b>Priority Level:</b>	Low	
<b>Barrier Description/Proposed Solution:</b> 1 of the accessible restrooms is missing a room sign. An estimate has been developed to install a new tactile text with Braille sign.		

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**


**Asset/Location: La Mesa Fire Station Old, La Mesa, NM**

<b>Assessors</b> Michael Black		
<b>Inspection Date</b> October 2015		
<b>Department</b> Fire	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	\$3,880.84	
<b>Priority 2:</b>	\$1,119.96	
<b>Priority 3:</b>	\$5,704.92	
<b>Priority 4:</b>	\$3,284.71	

**General Information**

The La Mesa Fire Station (Old), located at 117 San Miguel Street, La Mesa, NM, was built in 1987. The Old La Mesa Fire Station provides services DAC Fire District 4. This 3,854 SQFT, single-story building consists of a meeting room, restrooms, kitchen, lounge area, and office space.

**Approach & Entrance**

<b>ADA Standard Reference:</b>	208.2, 502	
<b>Estimated Cost:</b>	\$2,536.73	
<b>Priority Level:</b>	High	
<b>Barrier Description/Proposed Solution:</b> This facility does not have any identified parking spaces provided, nor does it designate any accessible spaces. It is recommended that a new concrete pad be installed to provide 2 new accessible parking spaces with an access aisle. Access aisles should be painted with blue paint and include text that indicates "NO PARKING".		




<b>ADA Standard Reference:</b>	<b>302.1, 404.2.5</b>
<b>Estimated Cost:</b>	<b>\$2,910.90</b>
<b>Priority Level:</b>	<b>High</b>
<b>Barrier Description/Proposed Solution:</b> This facility currently does not provide ADA parking or a stable accessible route to the entrance. An estimate has been developed for the installation of a new 4' sidewalk from the new ADA parking to the entrance. The existing concrete stoop at the entry door should be removed.	



<b>ADA Standard Reference:</b>	<b>404.2.7</b>
<b>Estimated Cost:</b>	<b>\$186.66</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> The existing main entry door has a knob type lockset. An estimate has been developed to remove and replace the existing knob type lockset with a lever type lockset.	




<b>ADA Standard Reference:</b>	<b>404.2.8</b>
<b>Estimated Cost:</b>	<b>\$108.35</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> The existing entry door closes in less than 5 seconds. An estimate has been developed to adjust the door closer.	

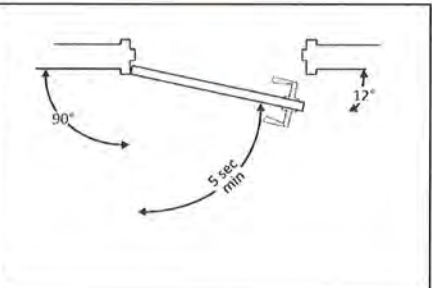


**Access to Goods & Services**


<b>ADA Standard Reference:</b>	<b>404.2.7</b>
<b>Estimated Cost:</b>	<b>\$1,119.96</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> All interior doors have knob type locksets installed. An estimate has been developed to remove and replace the existing knob type locksets with lever type locksets.	

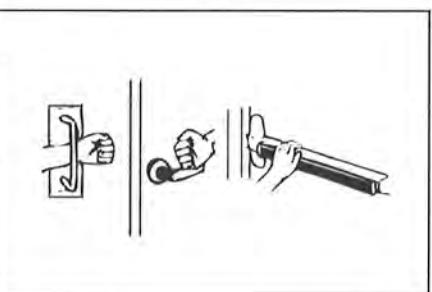


**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>703</b>
<b>Estimated Cost:</b>	<b>\$211.77</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> The existing restrooms require the installation of room signs. An estimate has been developed for the installation of new tactile text with Braille signs.	

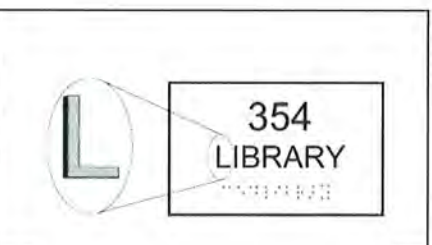


<b>ADA Standard Reference:</b>	<b>308.2, 604.4, 604.5.1, 604.5.2, 606.2</b>	
<b>Estimated Cost:</b>	<b>\$5,493.15</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The restrooms in this facility have the space to allow for compliance. Both restrooms have lavatories with set in countertops with base cabinets that should be removed and replaced with new compliant fixtures (606.2). The paper towel dispensers require adjustment (308.2). The water closets require replacement due to noncompliance (604.4). Grab bars are required to be installed in accordance with this section (604.5.1, 6.4.5.2). An estimate has been developed for the items listed.		

**Additional Access**

<b>ADA Standard Reference:</b>	<b>602.2, 602.4</b>	
<b>Estimated Cost:</b>	<b>\$3,284.71</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The existing drinking fountain does not comply with the referenced sections. An estimate has been developed for the removal and replacement of the existing fountain.		

**State of New Mexico, Doña Ana County**  
**Asset/Location: La Union Fire Station, La Union, NM**

<b>Assessors</b> Antonio Florencio Ortega		
<b>Inspection Date</b> October 2015		
<b>Department</b> Fire	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$940.08</b>	
<b>Priority 2:</b>	<b>\$0.00</b>	
<b>Priority 3:</b>	<b>\$2,543.79</b>	
<b>Priority 4:</b>	<b>\$0.00</b>	


**General Information**

The La Union Fire Station, located at 900 Tellez Road, La Union, NM, was built in 1975. It is a volunteer-type Fire Station that is locally operated, and provides service to DAC Fire District #7. This 4,534 SQFT, single-story building consists of a meeting room, restrooms, kitchen, lounge area, office space, and an apparatus bay.




**Approach & Entrance**

<b>ADA Standard Reference:</b>	<b>502.6</b>
<b>Estimated Cost:</b>	<b>\$627.60</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> There are 2 existing accessible parking signs that need to be relocated in order to comply with the requirements of this section. An estimate was developed for the installation of 2 new signs on posts.	

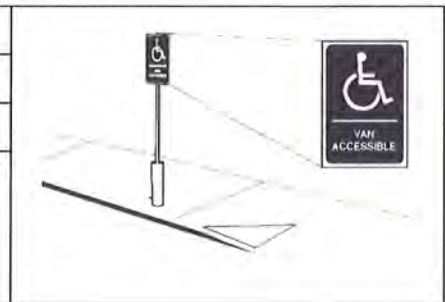

<b>ADA Standard Reference:</b>	<b>404.2.7</b>
<b>Estimated Cost:</b>	<b>\$312.48</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> The locking mechanism on the existing main entry door is above the maximum height required by this section. It is recommended that the locking mechanism be relocated to comply with the referenced section.	

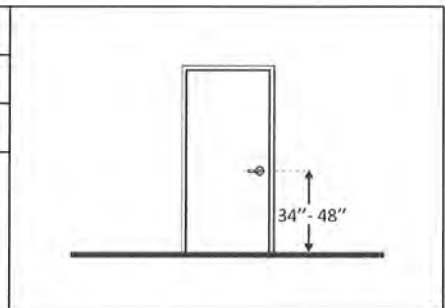


**Access to Goods & Services**

Accessibility barriers were not identified for this category.

**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>603.4</b>
<b>Estimated Cost:</b>	<b>\$29.30</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> The coat hook provided exceeds the maximum allowable height. An estimate has been developed for the installation of new coat hooks at the required mounting height.	

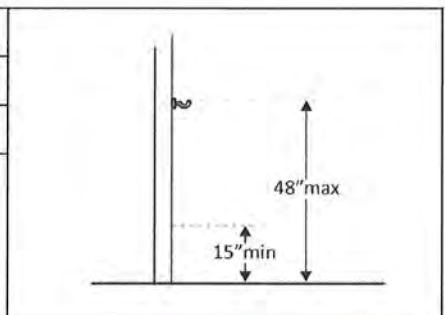

<b>ADA Standard Reference:</b>	<b>604.2, 604.5.1</b>
<b>Estimated Cost:</b>	<b>2,514.49</b>
<b>Priority Level:</b>	<b>Medium</b>

**Barrier Description/Proposed Solution:**  
The existing accessible restroom requires several work items to be in compliance. The distance of the water closet from the side wall requires adjustment (604.2). An appropriate sized sidewall grab bar requires installation at the required mounting height (604.5.1). However, the existing water closet is installed on the side of the restroom where the side wall is restricted in length by the shower enclosure. This only allows for the installation of a 24" side grab bar. The required overall length of the side wall grab bar is required to be 54" minimum. The solution would be the reconfiguration of the fixtures by flipping the location of the water closet and lavatory to the opposite walls. This will allow for the installation of the appropriate sized grab bar while maintaining the required clearances for other fixtures. An architectural design will be required. An estimate for this work has been developed.



**Additional Access**

Accessibility barriers were not identified for this category.

State of New Mexico, Doña Ana County


Asset/Location: Las Alturas Fire Station, Las Alturas, NM

<b>Assessors</b> Michael Black		
<b>Inspection Date</b> October 2015		
<b>Department</b> Fire	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	\$2,685.01	
<b>Priority 2:</b>	\$0.00	
<b>Priority 3:</b>	\$141.18	
<b>Priority 4:</b>	\$266.81	

**General Information**

The Las Alturas Fire Station, located at 4145 Cholla Road, Las Altura, NM, was built in 1986. It is a volunteer-type Fire Station that is locally operated, and provides service to DAC Fire District #15. This 4,782 SQFT, single-story building consists of a meeting room, restrooms, kitchen, lounge area, office space, and an apparatus bay.

**Approach & Entrance**


<b>ADA Standard Reference:</b>	502.2, 502.3.3, 502.6	
<b>Estimated Cost:</b>	\$2,685.01	
<b>Priority Level:</b>	Low	
<b>Barrier Description/Proposed Solution:</b> The accessible parking provided does not comply with the following requirements of the referenced sections. The accessible space and access aisle do not meet the required measurements (502.2). The paint is faded and does not discourage parking in the access aisle (502.3.3). The slope of the space and access aisle exceeds 1:48 and the handicap parking sign is not mounted at the correct height (502.6). Access aisles should be painted with blue paint and include text that indicates "NO PARKING". An estimate has been developed to reconfigure the parking to comply with the requirements of the referenced sections.		

**Access to Goods & Services**


Accessibility barriers were not identified for this category.



**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>216.8, 703.4.2</b>	
<b>Estimated Cost:</b>	<b>\$141.18</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> This facility has 2 restrooms; 1 which is accessible. A directional sign indicating the location of the accessible restroom should be installed at the inaccessible restroom. The sign installed at the accessible restroom requires horizontal relocation. An estimate has been developed for the installation of 2 new tactile text with Braille signs.		

**Additional Access**
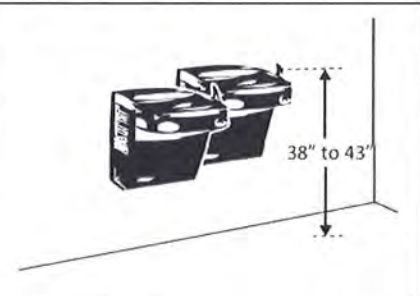
<b>ADA Standard Reference:</b>	<b>602.7</b>	
<b>Estimated Cost:</b>	<b>\$266.81</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The existing drinking fountain is not mounted at the required height as specified by this section. An estimate has been provided for the adjustment of the unit.		

**State of New Mexico, Doña Ana County**

**Asset/Location: Mesquite Fire Station, Mesquite, NM**

<b>Assessors</b> Michael Black		
<b>Inspection Date</b> October 2015		
<b>Department</b> Fire	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$3,917.78</b>	
<b>Priority 2:</b>	<b>\$539.37</b>	
<b>Priority 3:</b>	<b>\$1,679.92</b>	
<b>Priority 4:</b>	<b>\$46.05</b>	

**General Information**

The Mesquite Fire Station, located at Highway 228, Mesquite, NM, was built in 1991. It is a volunteer-type Fire Station that is locally operated, and provides service to DAC Fire District #10. This 4,758 SQFT, single-story building consists of a meeting room, office space, kitchen, restrooms, and an apparatus bay.

**Approach & Entrance**

<b>ADA Standard Reference:</b>	<b>208.2</b>
<b>Estimated Cost:</b>	<b>\$3,178.72</b>
<b>Priority Level:</b>	<b>High</b>
<b>Barrier Description/Proposed Solution:</b> The existing parking lot requires several work items to be in compliance. An estimate has been developed for the following items: removal and replacement of the existing asphalt, parking striping for a new “van accessible” space and access aisle, installation of a new curb ramp, and a new handicap sign. Access aisles should be painted with blue paint and include text that indicates “NO PARKING”.	



<b>ADA Standard Reference:</b>	<b>216.6</b>
<b>Estimated Cost:</b>	<b>\$166.32</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> This facility has 2 entrances. A directional sign needs to be installed indicating the direction of the main accessible entrance and a sign needs to be installed at the accessible entrance indicating ADA accessibility. An estimate has been developed for the installation of the signs.	



<b>ADA Standard Reference:</b>	<b>404.2.7</b>
<b>Estimated Cost:</b>	<b>572.74</b>
<b>Priority Level:</b>	<b>Medium</b>
<b>Barrier Description/Proposed Solution:</b> The existing entry door requires minor work items to be in compliance with the referenced section. The existing door is equipped with a knob type lockset and requires replacement to a lever type lockset. The door also closes in less than 5 seconds and the door closer be adjusted. An estimate has been developed for the work items noted.	



**Access to Goods & Services**

<b>ADA Standard Reference:</b>	<b>404.2.7</b>
<b>Estimated Cost:</b>	<b>\$539.37</b>
<b>Priority Level:</b>	<b>Medium</b>
<b>Barrier Description/Proposed Solution:</b> The existing doors at the entry, kitchen, and office currently have knob type locksets installed and require replacement with lever type locksets. An estimate has been developed for the installation of 3 lever type locksets.	





**Toilet Rooms**

<b>ADA Standard Reference:</b>	216.8, 703.2, 703.3, 703.4.1, 703.4.2	
<b>Estimated Cost:</b>	\$288.10	
<b>Priority Level:</b>	Medium	
<p><b>Barrier Description/Proposed Solution:</b>                  The existing restroom signs are noncompliant. ADA Standards require that sign text characters contrast with their backgrounds. It is recommended that new tactile text and Braille signs be put up at each of the restroom entrances. An estimate has been developed for the installation of 3 new tactile text with Braille signs. In addition, there should be a sign at the main restroom that indicates the direction of the nearest accessible restroom.</p>		

<b>ADA Standard Reference:</b>	404.2.7	
<b>Estimated Cost:</b>	\$403.62	
<b>Priority Level:</b>	Medium	
<p><b>Barrier Description/Proposed Solution:</b>                  The existing restrooms door knobs are comprised of knob type locksets and require replacement with lever type locksets. An estimate has been developed for the installation of 3 lever type locksets.</p>		

<b>ADA Standard Reference:</b>	308.2, 603.3, 603.4, 604.6, 604.5.1, 604.5.2, 606.4, 606.5	
<b>Estimated Cost:</b>	\$831.84	
<b>Priority Level:</b>	Low	
<p><b>Barrier Description/Proposed Solution:</b>                  Several work items in the existing accessible restroom are required for compliance with the referenced sections. The existing mirror and towel dispenser require removal and replacement with a combined mirror and towel dispenser (603.3) The existing soap dispenser is mounted above the maximum height (308.2). The existing coat hook requires relocation to the required mounting height (603.4). The lavatories piping requires insulation to protect against contact (606.5). Both a 42" sidewall grab bar and a 36" rear wall grab bar require installation (604.5.1, 604.5.2). The existing faucet requires removal and replacement (606.4). The flush control on the water closet requires relocation to the open side of the unit (604.6). An estimate has been developed for the work items listed.</p>		

**Additional Access**

<b>ADA Standard Reference:</b>	404.2.4, 602.2	
<b>Estimated Cost:</b>	\$46.05	
<b>Priority Level:</b>	Medium	
<b>Barrier Description/Proposed Solution:</b> The existing drinking fountain blocks the maneuvering clearances from the door of the kitchen to the meeting rooms. This fountain is inoperable and not used. An estimate has been developed for the removal of the existing fountain.		

**State of New Mexico, Doña Ana County  
Asset/Location: Organ Fire Station, Organ, NM**

<b>Assessors</b> Michael Black		
<b>Inspection Date</b> November 2015		
<b>Department</b>	<b>Asset Type</b>	
Fire	Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	\$7,864.74	
<b>Priority 2:</b>	\$186.66	
<b>Priority 3:</b>	\$2,851.91	
<b>Priority 4:</b>	\$0.00	

**General Information**

The Organ Fire Station, located at 5816 3rd Street, Organ, NM, was built in 1992. It is a volunteer-type Fire Station that is locally operated, and provides service to DAC Fire District #5. This 3,200 SQFT, single-story building consists of a meeting room, office space, kitchen, lounge area, restrooms and an apparatus bay.

**Approach & Entrance**

<b>ADA Standard Reference:</b>	206.2.1, 208.2, 208.4, 502.6	
<b>Estimated Cost:</b>	\$7,756.39	
<b>Priority Level:</b>	High	
<b>Barrier Description/Proposed Solution:</b> The existing parking lot does not have identified spaces. It is estimated that 18 spaces are available; 1 which should be an accessible space. An estimate has been developed for the following items: installation of a new 13'x22' concrete pad with appropriate pavement markings, ADA signs, wheel stop, and new curb ramp. The new accessible parking and access aisle should be installed closest to the entrance. Access aisles should be painted with blue paint and include text that indicates "NO PARKING".		



<b>ADA Standard Reference:</b>	<b>404.2.8</b>	
<b>Estimated Cost:</b>	<b>\$108.35</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing entrance door takes less than 5 seconds to close. An estimate has been developed for the adjustment of the door closer.</p>		

**Access to Goods & Services**

<b>ADA Standard Reference:</b>	<b>404.2.7, 404.2.8</b>	
<b>Estimated Cost:</b>	<b>\$186.66</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing interior doors are equipped with knob type locksets and require replacement with lever type locksets. An estimate has been developed for the installation of lever type locksets.</p>		

**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>604.1, 604.8, 604.9, 606.2, 609.4</b>	
<b>Estimated Cost:</b>	<b>\$2,851.91</b>	
<b>Priority Level:</b>	<b>High</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>Neither of the 2 existing restrooms is large enough to be accessible, nor compliant with ADA Standards. An estimate has been developed for the reconfiguration of the restrooms to comply with ADA requirements. A complete demo of the existing restrooms is required in order combine them into 1, unisex accessible restroom. This estimate includes the following: removal of the partition wall, toilet accessories, ceramic tile, and 1 of the existing doors. The estimate also includes the installation of a new water closet, lavatory, grab bars, toilet room accessories, and the infill of 1 existing door opening.</p>		

**Additional Access**

Accessibility barriers were not identified for this category.


State of New Mexico, Doña Ana County  
 Asset/Location: Santa Teresa Fire Station 14, Santa Teresa, NM


<b>Assessors</b> Michael Black		
<b>Inspection Date</b> October 2015		
<b>Department</b> Fire	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$9,655.99</b>	
<b>Priority 2:</b>	<b>\$322.02</b>	
<b>Priority 3:</b>	<b>\$1,891.16</b>	
<b>Priority 4:</b>	<b>\$0.00</b>	

**General Information**

The Santa Teresa Fire Station 14, located at 101 Parkview, Santa Teresa, NM, was built in 1995. It is a volunteer-type Fire Station that is locally operated, and provides service to DAC Fire District #14. This 6,182 SQFT, single-story building consists of a meeting room, office area, kitchen, restrooms and an apparatus bay.


**Approach & Entrance**


<b>ADA Standard Reference:</b>	<b>208.2.4, 208.3.1, 502.6</b>	
<b>Estimated Cost:</b>	<b>\$4,713.58</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The existing accessible parking is not currently "van accessible", nor is it closest to the nearest accessible entrance. An estimate has been developed for the reconfiguration of the parking striping to align the accessible space and access aisle with the entrance. Access aisles should be painted with blue paint and include text that indicates "NO PARKING".		

<b>ADA Standard Reference:</b>	<b>302.2</b>	
<b>Estimated Cost:</b>	<b>\$4,942.41</b>	
<b>Priority Level:</b>	<b>High</b>	
<b>Barrier Description/Proposed Solution:</b> The existing entry door has a 5" step up from the outside. An estimate has been developed for the installation for a new ADA compliant ramp.		




**Access to Goods & Services**

<b>ADA Standard Reference:</b>	<b>404.2.4</b>	
<b>Estimated Cost:</b>	<b>\$230.72</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The door to the back office at the end of the hallway does not have the required minimum side maneuvering clearance. An estimate has been developed to reverse the swing of the door.</p>		

<b>ADA Standard Reference:</b>	<b>216.6</b>	
<b>Estimated Cost:</b>	<b>\$91.30</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing inaccessible entrance does not have a sign indicating the location of the nearest accessible exit. An estimated as been developed to install a directional sign.</p>		

**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>306.3.3, 308.2, 604.5.1, 604.5.2, 604.6, 606.5, 703.4.2</b>	
<b>Estimated Cost:</b>	<b>\$1,891.16</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>Several work items in the existing accessible restrooms are required for compliance with the referenced sections. The restroom signs require relocation to the appropriate mounting area (703.4.2). Both restrooms soap and towel dispensers should be adjusted to the appropriate mounting height (308.2). The lavatories require vertical adjustment (306.3.3). The existing piping under the lavatory requires insulation to protect against contact (606.5). The sidewall grab bars require replacement to the appropriate 42" bar height (604.5.1). The rear grab bar requires replacement to the appropriate 36" bar height (604.5.2). The flush control on the water closet requires relocation to the open side of the unit (604.6). An estimate has been developed for the work items listed.</p>		

**Additional Access**

Accessibility barriers were not identified for this category.


**State of New Mexico, Doña Ana County**  
**Asset/Location: Santa Teresa Hazmat, Santa Teresa, NM**

<b>Assessors</b> Michael Black		
<b>Inspection Date</b> October 2015		
<b>Department</b> Fire	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$1,901.63</b>	
<b>Priority 2:</b>	<b>\$216.70</b>	
<b>Priority 3:</b>	<b>\$720.06</b>	
<b>Priority 4:</b>	<b>\$0.00</b>	


**General Information**

The Santa Teresa Hazmat building, located at 8000 Airport Road, Santa Teresa, NM, was built in 2002. This 2,240 SQFT, single-story building consists of a meeting room, office space, kitchen, restrooms, and an apparatus bay.

**Approach & Entrance**


<b>ADA Standard Reference:</b>	<b>502</b>	
<b>Estimated Cost:</b>	<b>\$1,901.63</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> Space for accessible parking has been designed and provided; however, the surface of the parking area is a gravel/base course material that does not comply with the requirements of the referenced section. An estimate has been developed for the installation of a concrete pad and ADA specific pavement markings. New access aisles should be painted with blue paint and include text that indicates "NO PARKING".		


**Access to Goods & Services**


<b>ADA Standard Reference:</b>	<b>404.2.9, 404.2.8.1</b>	
<b>Estimated Cost:</b>	<b>\$216.70</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> Room 102 has double doors that require a considerable amount of effort to open (more than 5 lbs of force) and close in less than 5 seconds. An estimate has been developed for the adjustment of the door closers.		



**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>404.2.9, 404.2.8.1</b>	
<b>Estimated Cost:</b>	<b>\$216.70</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The doors to both the Women's and Men's restrooms require a considerable amount of effort to open (more than 5 pounds of force) and close in less than 5 seconds. An estimate has been developed for the adjustment of the door closers.</p>		
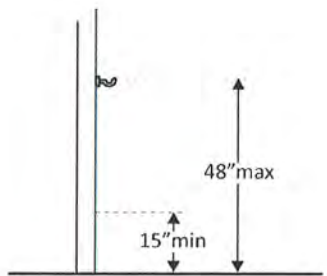
<b>ADA Standard Reference:</b>	<b>603.4</b>	
<b>Estimated Cost:</b>	<b>\$58.24</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The provided coat hooks are located inside the accessible stalls in each restroom. The hooks are mounted at a height greater than the 48" maximum. An estimate has been developed for the installation of a new coat hook installed at the appropriate height.</p>		


<b>ADA Standard Reference:</b>	<b>604.8.1.2</b>	
<b>Estimated Cost:</b>	<b>\$445.12</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing accessible restroom stalls have partition doors that are not self-closing. An estimate has been developed for the installation of a closer.</p>		

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**


**Asset/Location: South Valley Fire Station, Las Cruces, NM**

<b>Assessors</b>		
Michael Black		
<b>Inspection Date</b>		
October 2015		
<b>Department</b>	<b>Asset Type</b>	
Fire	Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$5,882.93</b>	
<b>Priority 2:</b>	<b>\$0.00</b>	
<b>Priority 3:</b>	<b>\$417.64</b>	
<b>Priority 4:</b>	<b>\$262.19</b>	

**General Information**

The South Valley Fire Station, located at 1801 Carver Road, Las Cruces, NM, was built in 1980. It is a volunteer-type Fire Station that is locally operated, and provides service to DAC Fire District #13. This 4,680 SQFT, single-story building consists of a meeting room, office space, kitchen, restrooms and an apparatus bay.


**Approach & Entrance**


<b>ADA Standard Reference:</b>	<b>502.2, 502.6</b>	
<b>Estimated Cost:</b>	<b>\$5,882.93</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The existing accessible parking requires reconfiguration to comply with the requirements of the referenced sections. Work items to include: removal and replacement of the existing heaving asphalt, restriping, and installation of a new ADA parking sign. Access aisles should be painted with blue paint and include text that indicates "NO PARKING".		

**Access to Goods & Services**

Accessibility barriers were not identified for this category.

**Toilet Rooms**


<b>ADA Standard Reference:</b>	<b>216.8, 703.4.2</b>	
<b>Estimated Cost:</b>	<b>\$194.22</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> This facility has 2 restrooms; 1 is accessible. A directional sign indicating the location of the accessible restroom should be installed at the inaccessible restroom. The sign installed at the accessible restroom requires horizontal relocation. An estimate has been developed for the work items listed.		

<b>ADA Standard Reference:</b>	<b>603.3, 604.5.1, 604.5.2</b>	
<b>Estimated Cost:</b>	<b>\$223.42</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> Several work items in the existing accessible restroom are required for compliance with the referenced sections. The existing sidewall grab bar requires horizontal adjustment (603.3). The existing soap dispenser requires vertical adjustment (604.5.1). An estimate has been developed for the work items listed.		



**Additional Access**

<b>ADA Standard Reference:</b>	<b>602.2</b>
<b>Estimated Cost:</b>	<b>\$262.19</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> The existing accessible restroom door opens into the clear space of the drinking fountain. The fountain is inoperable. An estimate has been developed for the fountains removal. A bottled water dispenser is provided as a replacement.	

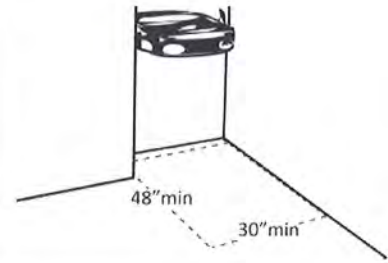

**State of New Mexico, Doña Ana County  
Asset/Location: Talavera Fire Station, Las Cruces, NM**

<b>Assessors</b> Antonio Florencio Ortega		
<b>Inspection Date</b> October 2015		
<b>Department</b> Fire	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$7,019.21</b>	
<b>Priority 2:</b>	<b>\$0.00</b>	
<b>Priority 3:</b>	<b>\$531.33</b>	
<b>Priority 4:</b>	<b>\$0.00</b>	

**General Information**

The Talavera Fire Station, located at 5000 Achenbach Canyon Road, Las Cruces, NM was built in 2000. The Talavera Fire Station is a sub-station of the Las Alturas Fire Station that provides services to DAC Fire District #15. This 1,981 SQFT, single-story building consists of office space, restrooms, and an apparatus bay.

**Approach & Entrance**


<b>ADA Standard Reference:</b>	<b>502.2, 502.6</b>
<b>Estimated Cost:</b>	<b>\$7,019.21</b>
<b>Priority Level:</b>	<b>Medium</b>
<b>Barrier Description/Proposed Solution:</b> This facility does not have any identified parking spaces provided, nor does it designate any accessible spaces. It is recommended that a new concrete pad be installed to provide for 1 new accessible parking space with an access aisle and new handicap parking sign. Access aisles should be painted with blue paint and include text that indicates "NO PARKING". An estimate has been developed for these work items listed.	





**Access to Goods & Services**

Accessibility barriers were not identified for this category.

**Toilet Rooms**

<b>ADA Standard Reference:</b>	703.2, 703.3, 703.4.2, 703.5,	
<b>Estimated Cost:</b>	\$76.32	
<b>Priority Level:</b>	Medium	
<b>Barrier Description/Proposed Solution:</b> The existing restroom requires the installation of a new sign. An estimate has been developed for the installation of a new tactile text with Braille sign.		
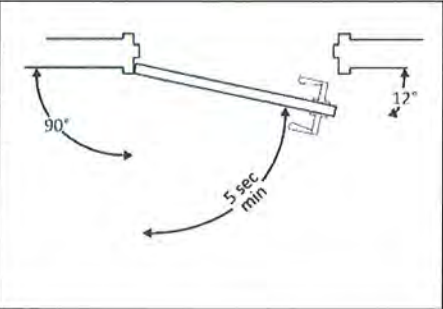
<b>ADA Standard Reference:</b>	404.2.8.1	
<b>Estimated Cost:</b>	\$108.35	
<b>Priority Level:</b>	Medium	
<b>Barrier Description/Proposed Solution:</b> The existing restroom door takes a considerable amount of effort to open (more than 5 lbs of force) and closes in less than five seconds. An estimate has been developed to adjust the door closer.		

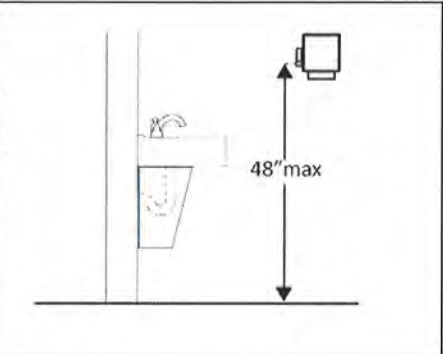
<b>ADA Standard Reference:</b>	308.2, 604.5	
<b>Estimated Cost:</b>	\$346.66	
<b>Priority Level:</b>	Medium	
<b>Barrier Description/Proposed Solution:</b> The existing restroom requires multiple work items to be in compliance with the referenced sections. The paper towel dispenser requires mounting height adjustment (308.2). The existing flush control on the water closet requires relocation to the open side of the unit (604.5). An estimate has been developed for the work items listed		

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**

**Asset/Location: Restroom, Berino Ball Park, Berino, NM**

<b>Assessors</b> Antonio Florencio Ortega		
<b>Inspection Date</b> October 2015		
<b>Department</b> Facilities	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	\$5,813.46	
<b>Priority 2:</b>	\$0.00	
<b>Priority 3:</b>	\$3,503.72	
<b>Priority 4:</b>	\$0.00	


**General Information**

The Restroom at the Berino Ball Park, located at 200 San Benito, Berino, NM, was built in 1995, and consists of 170 SQFT.



**Approach & Entrance**


<b>ADA Standard Reference:</b>	<b>208.2</b>	
<b>Estimated Cost:</b>	<b>\$5,650.04</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The ball park currently has 2 accessible parking spaces provided. The accessible spaces are located on the 3rd base side of the field, and consist of two 8' spaces with an 8' aisle on a concrete pad. The existing concrete markings are faded and an ADA sign needs to be installed. The ball field perimeter currently provides for an estimated 110 total parking spaces. ADA Standards require that at least 4 accessible spaces be provided. An estimate has been developed to restripe the existing accessible spaces, add a sign to the existing spaces, and add 2 new accessible spaces on the first base side of the field at the entry gate. Access aisles should be painted with blue paint and include text that indicates "NO PARKING".</p>		


<b>ADA Standard Reference:</b>	<b>403.5.3</b>	
<b>Estimated Cost:</b>	<b>\$163.42</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>There is a transition in the side walk near the restroom building that does not allow for passing space. This transition is also obstructed by sediments and overgrowth of the grass. An estimate has been developed for the installation of a new 60"x60" concrete pad to allow for passing at this transition.</p>		

**Access to Goods & Services**


Accessibility barriers were not identified for this category.

**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>206.2.4</b>	
<b>Estimated Cost:</b>	<b>\$326.28</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The restroom entrances have slopes that exceed 1:48. The concrete in these areas is also worn. An estimate has been developed for the removal of the existing concrete and the installation of a new walk that is no steeper than 1:48 between the side walk and the restroom entrances.</p>		
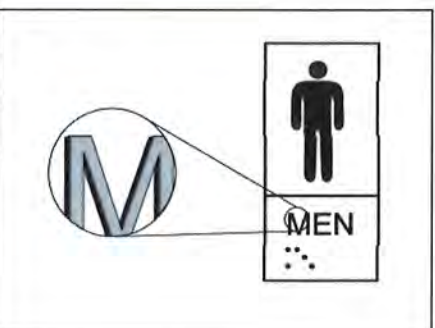
<b>ADA Standard Reference:</b>	<b>703.5</b>	
<b>Estimated Cost:</b>	<b>\$141.18</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing restrooms require new tactile text with Braille signs that indicate accessibility. An estimate has been developed for the installation of new ADA compliant signs.</p>		




<b>ADA Standard Reference:</b>	<b>604.4, 604.8.1.1, 604.8.1.2, 606.4, 606.5</b>	
<b>Estimated Cost:</b>	<b>\$3,036.26</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The 2 existing restrooms require several work items to comply with the referenced sections. The work required is as follows: The existing lavatories require pipe insulation to protect against contact (606.5). Faucets on the lavatories are knob type and require new lever type faucets (606.4). The existing water closets are operational, but dated and do not comply with the required seat height (604.4). The water closet compartment widths do not comply with the requirements of this section (604.8.1.1). The partition doors are not self-closing (604.8.1.2). An estimate has been developed to address the items required in each of the restrooms.		

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County, Facilities Department**


**Asset/Location: Adult Detention Center, Las Cruces, NM**


<b>Assessors</b> Michael Black		
<b>Inspection Date</b> October 2015		
<b>Department</b> Facilities	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$13,640.11</b>	
<b>Priority 2:</b>	<b>\$7,734.23</b>	
<b>Priority 3:</b>	<b>\$4,319.28</b>	
<b>Priority 4:</b>	<b>\$0.00</b>	


**General Information**

The Adult Detention Center, located at 1850 Copper Loop, Las Cruces, NM, was built in 1995 to accommodate 562 beds; however, in 2000, an additional housing unit was added and some renovation was done to increase the number of beds to 846. The Adult Detention Center is a single-story building consisting of 164,343 SQFT, with seven secure housing units. At this facility, there are no bars separating officers and inmates; they are separated by glass partitions.

**Approach & Entrance**

<b>ADA Standard Reference:</b>	<b>208.2</b>	
<b>Estimated Cost:</b>	<b>\$2,163.20</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The facility currently provides 6 standard accessible spaces. Along the circular drive at the building entrance, the curb is painted and additional spaces are marked as accessible. ADA Standards require that if parallel accessible spaces are provided, a 5'-0" minimum access aisle on the curb side adjacent to the accessible space shall be installed. The existing width of the drive will not allow for this and still provide for through traffic. According to the requirements of the referenced section, the 6 standard accessible spaces are adequate, and there is no need for the spaces provided at the circular drive. It is recommended that the markings indicating accessibility be removed, and the curb be identified as a pickup/drop off zone only. An estimate has been developed for the work items noted.		

<b>ADA Standard Reference:</b>	<b>502.2, 502.3, 502.6</b>	
<b>Estimated Cost:</b>	<b>\$9,924.61</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The existing accessible parking spaces provided do not comply with the minimum dimensional requirements of this section, nor is there a space designated as "van accessible". The locations of the East and West accessible spaces provide 19 total spaces, 7 of which are accessible. 1 of the provided accessible spaces on the West side is only 6'-8" wide, and 5 of the spaces are located farthest from the main public entrance. It is recommended that these areas of the parking be reconfigured to provide 4 accessible spaces with 2 access aisles closest to the main public entrance on the West side, and 2 accessible spaces with 1 access aisle on the East side. 10 standard inaccessible spaces will need to be re-striped. Access aisles should be painted with blue paint and include text that indicates "NO PARKING". 3 new curb ramps will need to be installed in the existing side walk at each access aisle and new handicap signs will need to be put up. An estimate has been developed for the work items described.		

<b>ADA Standard Reference:</b>	<b>302.1</b>	
<b>Estimated Cost:</b>	<b>\$280.00</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The concrete sidewalk at the accessible route has settled and heaved at joints creating tripping hazards up to 1"high. It is recommended that the raised edges of the concrete along the route be ground down and smoothed. An estimate has been provided for the work items listed.		



<b>ADA Standard Reference:</b>	<b>405.9.1, 405.9.2</b>
<b>Estimated Cost:</b>	<b>\$622.50</b>
<b>Priority Level:</b>	<b>Medium</b>
<b>Barrier Description/Proposed Solution:</b>	
The existing ramp between the Juvenile Booking Modular Building and the Juvenile Cell Block requires that edge protection be added to the bottom of the existing railing to prevent the passage of a 4" diameter sphere. An estimate has been developed for the listed work items.	



<b>ADA Standard Reference:</b>	<b>404.2.8</b>
<b>Estimated Cost:</b>	<b>\$649.80</b>
<b>Priority Level:</b>	<b>Medium</b>
<b>Barrier Description/Proposed Solution:</b>	
The 2 West entry doors have closers that are damaged and require significant amount of effort to open (more than 5 lbs of force) and also prevent the doors from fully closing. It is recommended that the closers be replaced. An estimate has been developed for the replacement of the existing door closers.	



**Access to Goods & Services**

<b>ADA Standard Reference:</b>	<b>206.4</b>
<b>Estimated Cost:</b>	<b>\$7,734.23</b>
<b>Priority Level:</b>	<b>High</b>
<b>Barrier Description/Proposed Solution:</b>	
The Juvenile Booking Modular is accessed by a gravel path to a set of wood steps making the space inaccessible. A new accessible ramp with rails and a sidewalk should be installed to provide access to the Juvenile Booking area. An estimate has been developed for the work items listed.	



**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>404.2.8.1, 404.2.9</b>
<b>Estimated Cost:</b>	<b>\$650.10</b>
<b>Priority Level:</b>	<b>Medium</b>
<b>Barrier Description/Proposed Solution:</b>	
The closers for the restroom doors in the Lobby, Employee, and Officer Break rooms require adjustment as they either take significant effort to open or shut too quickly. An estimate has been developed for the adjustment of 6 closers.	





<b>ADA Standard Reference:</b>	<b>603.4</b>
<b>Estimated Cost:</b>	<b>\$174.72</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> The Lobby, Employee, and Break room restrooms have coat hooks installed at noncompliant heights. An estimate has been developed for the installation of new hooks at the appropriate mounting heights.	



<b>ADA Standard Reference:</b>	<b>606.5</b>
<b>Estimated Cost:</b>	<b>\$368.60</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> The East and main Lobby, Employee, and Officer Break room restrooms require that pipe protection be installed below the lavatories to protect against contact. The insulation is installed on some of the pipes, some are missing and others are damaged or not attached properly. An estimate has been developed for the installation of pipe protection under 10 lavatories in the areas listed.	



<b>ADA Standard Reference:</b>	<b>308.2.2</b>
<b>Estimated Cost:</b>	<b>\$558.55</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> Soap dispensers at the main Lobby Men's restroom, Employee Men's and Women's restrooms, and the West Officer Break room restroom need to be relocated to 44" maximum AFF. An estimate has been developed for the relocation of the soap dispensers.	



<b>ADA Standard Reference:</b>	<b>308.2</b>
<b>Estimated Cost:</b>	<b>\$446.84</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> Towel dispensers at the East Men's and Women's restrooms and the main lobby Men's and Women's restrooms need to be relocated to 44" maximum AFF. An estimate has been developed for the relocation of the towel dispensers.	



<b>ADA Standard Reference:</b>	<b>604.4</b>
<b>Estimated Cost:</b>	<b>\$1,434.54</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> The wall mounted water closets at all accessible stalls in the East and main Lobby, as well as the employee, and West Officer Break room restrooms are mounted with the top of the seat above 19". The water closets require mounting adjustment to comply with the referenced section.	



<b>ADA Standard Reference:</b>	<b>604.5.1, 604.5.2</b>	
<b>Estimated Cost:</b>	<b>\$446.84</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The sidewall grab bars in the employee restrooms and the rear wall grab bars in the East Lobby Women's restroom require horizontal adjustment to comply with the mounting requirements of this section. An estimate has been developed for the adjustment of the grab bars.</p>		

<b>ADA Standard Reference:</b>	<b>604.6</b>	
<b>Estimated Cost:</b>	<b>\$239.09</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The flush control on the water closet in the Women's restroom at the West Officer's Break room is on the closed side of the unit. An estimate has been developed for the relocation of the flush control to the open side of the unit.</p>		

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**

**Asset/Location: Animal Control, Las Cruces, NM**

<b>Assessors</b>		
Antonio Florencio Ortega		
<b>Inspection Date</b>		
October 2015		
<b>Department</b>	<b>Asset Type</b>	
Facilities	Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$313.80</b>	
<b>Priority 2:</b>	<b>\$3,322.66</b>	
<b>Priority 3:</b>	<b>\$1,409.73</b>	
<b>Priority 4:</b>	<b>\$0.00</b>	

**General Information**

The Animal Control and Veterans Office building, located at 2024 E. Griggs, Las Cruces, NM, was built in 2001. It is a single-story building consisting of 4,513 SQFT. Animal Control is responsible for the well-being of both animals and residents of the community by providing animal control services. The New Mexico Department of Veterans' Services is a statewide community service organization dedicated to helping veterans and their families with receiving adequate services and benefits.



### Approach & Entrance

<b>ADA Standard Reference:</b>	<b>502.6</b>
<b>Estimated Cost:</b>	<b>\$313.80</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> 1 of 2 accessible parking signs requires height adjustment. An estimate has been developed for the installation of a new ADA sign.	



### Access to Goods & Services

<b>ADA Standard Reference:</b>	<b>904.4.1</b>
<b>Estimated Cost:</b>	<b>\$3,322.66</b>
<b>Priority Level:</b>	<b>Medium</b>
<b>Barrier Description/Proposed Solution:</b> The existing reception counter at the entrance is 50" AFF. A section of the counter, at least 36" long, should be provided no higher than 36" AFF. An estimate has been developed for the removal and installation of a new reception counter.	



### Toilet Rooms


<b>ADA Standard Reference:</b>	<b>703</b>
<b>Estimated Cost:</b>	<b>\$141.18</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> The existing room signs at the restrooms are mounted on the doors and are noncompliant. An estimate has been developed for the installation of new room signs with tactile text and Braille.	



<b>ADA Standard Reference:</b>	<b>404.2.7</b>
<b>Estimated Cost:</b>	<b>\$373.32</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> The existing locksets on both restroom doors have locks that require a pinching and twisting motion to operate. An estimate has been developed for the replacement of the locksets.	





<b>ADA Standard Reference:</b>	308.2, 604.5.1, 604.5.2, 604.6, 606.5	
<b>Estimated Cost:</b>	\$895.23	
<b>Priority Level:</b>	Medium	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing restrooms require minor work items to comply with the requirements of the referenced sections. Both restrooms require that pipe insulation be installed below the sinks to protect against contact (606.5). Both restrooms require that the paper towel dispensers be adjusted to the appropriate mounting height (308.2). The side wall grab bars in both restrooms require horizontal mounting adjustment (604.5.1). The rear wall grab bars in both restrooms require replacement with a 36" bar (604.5.2). The water closet in the Men's restroom requires the flush control be relocated to the open side of the unit (604.6). An estimate has been developed for the work items listed.</p>		

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**


**Asset/Location: Butterfield Community Center, East Mesa, NM**

<b>Assessors</b>		
Michael Black		
<b>Inspection Date</b>		
November 2015		
<b>Department</b>	<b>Asset Type</b>	
Facilities	Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	\$1,034.04	
<b>Priority 2:</b>	\$1,376.69	
<b>Priority 3:</b>	\$656.82	
<b>Priority 4:</b>	\$0.00	

**General Information**

The Butterfield Community Center, located at 9350 Berry Patch Avenue, East Mesa, NM was built in 2009. The Center provides programs that meet community needs, enhance the quality of life and promote community involvement. This single-story 3,015 SQFT building has a kitchen, bathrooms, meeting rooms, office space and multi-purpose rooms.


**Approach & Entrance**

<b>ADA Standard Reference:</b>	208.2.4, 502.6	
<b>Estimated Cost:</b>	\$627.60	
<b>Priority Level:</b>	Low	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing parking provides for 2 accessible parking spaces. While the existing spaces are large enough to be considered "van accessible", neither is identified as such. The signs that are provided are also mounted below the minimum required height. An estimate has been developed for the replacement of both signs to comply with the requirements of the referenced sections.</p>		

<b>ADA Standard Reference:</b>	<b>216.6</b>
<b>Estimated Cost:</b>	<b>\$189.74</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
There are 2 entrances to this facility; only 1 entry is accessible. Per ADA Standards, signs should be posted at inaccessible entrances indicating the direction of the nearest accessible entrance. There should also be a sign at the accessible entrance with the International Symbol of Accessibility. An estimate has been developed for the installation of 2 new directional signs.	



<b>ADA Standard Reference:</b>	<b>404.2.8</b>
<b>Estimated Cost:</b>	<b>\$216.70</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
The existing set of double doors at the entry close in less than 5 seconds. An estimate has been developed for the adjustment of the door closers.	

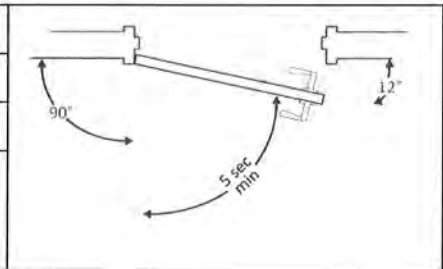


**Access to Goods & Services**

<b>ADA Standard Reference:</b>	<b>404.2.4</b>
<b>Estimated Cost:</b>	<b>\$1,190.03</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
The door from the kitchen into the corridor does not provide for at least 18" of maneuvering clearance beyond the latch side of the door. Possible solutions for removal of this barrier include: the reversal of the swing of the door given that this change would not violate any other building codes and standards or the reconfiguration of the wall to the kitchen pantry. For the purposes of this report, an estimate has been developed for the reversal of the door swing. Consultation with an Architect should be utilized to develop a feasible solution.	



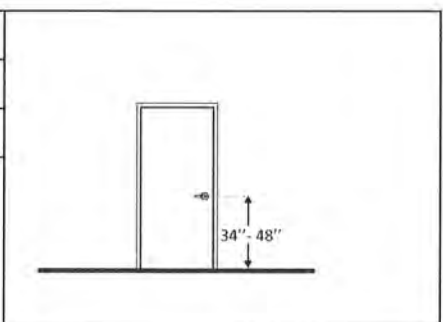

<b>ADA Standard Reference:</b>	<b>404.2.7</b>
<b>Estimated Cost:</b>	<b>\$186.66</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
The door to the library currently has a knob type lockset installed. An estimate has been developed for the replacement of the knob type lockset with a lever type lockset.	






**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>404.2.9</b>	
<b>Estimated Cost:</b>	<b>\$216.70</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The restroom doors take considerable amount of effort to open (more than 5 lbs of force). An estimate has been developed for the adjustment of the door closers.</p>		

<b>ADA Standard Reference:</b>	<b>308.2</b>	
<b>Estimated Cost:</b>	<b>\$223.42</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The paper towel dispensers in both restrooms require relocation to comply with the mounting requirements of the referenced section. An estimate has been developed for the relocation of the dispensers.</p>		


<b>ADA Standard Reference:</b>	<b>604.5.2</b>	
<b>Estimated Cost:</b>	<b>\$216.70</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The rear grab bars at the accessible stalls in both restrooms require adjustment to comply with the mounting requirements of the referenced section. An estimate has been developed for the horizontal adjustment of the grab bars.</p>		

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**

**Asset/Location: Chaparral Community Center, Chaparral, NM**


<b>Assessors</b>		
Michael Black		
<b>Inspection Date</b>		
October 2015		
<b>Department</b>	<b>Asset Type</b>	
Facilities	Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$1,376.02</b>	
<b>Priority 2:</b>	<b>\$503.99</b>	
<b>Priority 3:</b>	<b>\$870.11</b>	
<b>Priority 4:</b>	<b>\$0.00</b>	




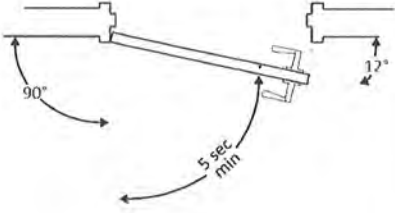
**General Information**

The Chaparral Community Center, 190 County Line Road, Chaparral, NM, was built in 2000. The Center provides programs that meet community needs, enhance the quality of life and promote community involvement. This single-story 4,851 SQFT building has a kitchen, bathrooms, meeting rooms, office space and multi-purpose rooms.

**Approach & Entrance**


<b>ADA Standard Reference:</b>	<b>208.2.4, 502.3.3, 502.6</b>	
<b>Estimated Cost:</b>	<b>\$752.88</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing accessible parking requires the following work items to be in compliance with the requirements of the referenced sections. The existing configuration of the parking spaces allows for “van accessibility”; however, there is not a sign provided indicating that the space is “van accessible” (208.2.4). The signs are mounted too low and are faded (502.6). The access aisle gore lines are incomplete (502.3.3). An estimate has been developed for the installation of new signs and the completion of the gore lines at the access aisle. Access aisles should be painted with blue paint and include text that indicates “NO PARKING”.</p>		

<b>ADA Standard Reference:</b>	<b>216.6</b>	
<b>Estimated Cost:</b>	<b>\$189.74</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>A sign at the south side entrance indicating the direction of the nearest accessible entrance, as well as a sign indicating that the main entrance is accessible require installation. An estimate has been developed for the installation of 2 new ADA compliant signs.</p>		


<b>ADA Standard Reference:</b>	<b>404.2.8</b>	
<b>Estimated Cost:</b>	<b>\$433.40</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing entry has 2 sets of double doors. All 4 doors close in less than 5 seconds. An estimate has been developed for the adjustment of all 4 door closers.</p>		

**Access to Goods & Services**


<b>ADA Standard Reference:</b>	<b>307.2</b>
<b>Estimated Cost:</b>	<b>\$0.00</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
<p>In the hallway that leads the restrooms, there is a fire extinguisher mounted to the wall that protrudes more than 4" into the walking path. The fire extinguisher should be relocated to a location that will not protrude more than 4" into the path. The new location of the fire extinguisher should be relocated in a place that still complies with other codes. This is a no cost item.</p>	

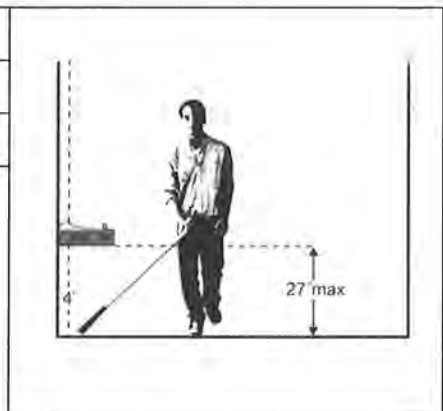

<b>ADA Standard Reference:</b>	<b>703.4.2</b>
<b>Estimated Cost:</b>	<b>\$70.59</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
<p>The existing room sign for the east multi-purpose room requires relocation to the latch side of the door. An estimate has been developed for the removal and relocation of the tactile text with Braille sign.</p>	

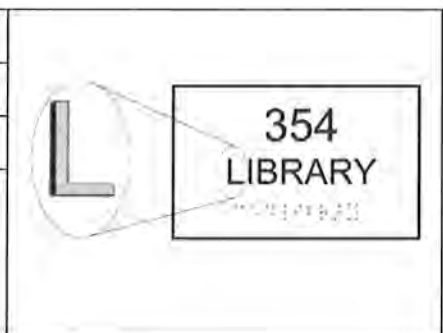


<b>ADA Standard Reference:</b>	<b>404.2.8.1</b>
<b>Estimated Cost:</b>	<b>\$433.40</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
<p>Several of the interior doors close in less than 5 seconds. An estimate has been developed to adjust the door closers.</p>	

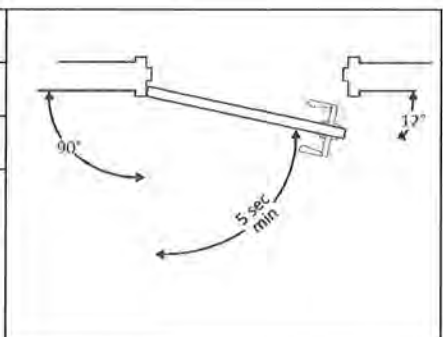

**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>703.4.2</b>
<b>Estimated Cost:</b>	<b>\$70.59</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
<p>The room sign at the Men's restroom requires relocation to the latch side of the door. An estimate has been developed for the removal and relocation of the tactile text with Braille sign.</p>	

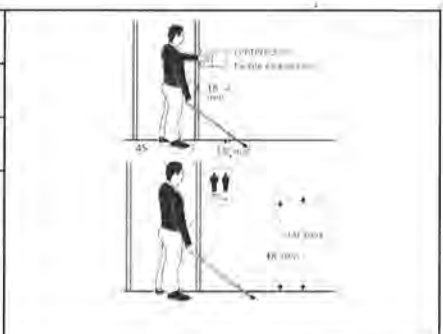

<b>ADA Standard Reference:</b>	<b>603.4</b>	
<b>Estimated Cost:</b>	<b>\$223.42</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing coat hooks in the restrooms are mounted above the maximum height as required by this section. An estimate has been developed for the adjustment of the hooks.</p>		

<b>ADA Standard Reference:</b>	<b>604.8.1.2</b>	
<b>Estimated Cost:</b>	<b>\$576.10</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing partition doors of the accessible stalls in the restrooms are not self-closing. An estimate has been developed for the replacement of the doors.</p>		

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**

**Asset/Location: Chaparral Community Health, Chaparral, NM**


<b>Assessors</b>		
Antonio Florencio Ortega		
<b>Inspection Date</b>		
October 2015		
<b>Department</b>	<b>Asset Type</b>	
Facilities	Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$3,632.56</b>	
<b>Priority 2:</b>	<b>\$0.00</b>	
<b>Priority 3:</b>	<b>\$2,366.13</b>	
<b>Priority 4:</b>	<b>\$0.00</b>	

**General Information**

The Chaparral Community Health Building, located at 317 McCombs, Chaparral, NM, was built in 1970. Chaparral Family Health Center provides comprehensive primary care services for children and adults of Chaparral, New Mexico. It is a single-story building consisting of 6,324 SQFT.




**Approach & Entrance**


<b>ADA Standard Reference:</b>	<b>502.2, 502.3, 502.6</b>	
<b>Estimated Cost:</b>	<b>\$3,632.56</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The accessible parking requires multiple work items to be in compliance with the referenced sections. The existing configuration of the accessible parking does not provide an access aisle (502.2, 502.3). The existing ADA signs do not designate "van accessibility" and are not mounted at the appropriate height (502.6). An estimate has been developed to reconfigure the parking to allow for two 8' accessible spaces with an 8' access aisle in the middle. Access aisles should be painted with blue paint and include text that indicates "NO PARKING". Wheel stops should be installed 5' from the existing curb to provide for an accessible route from the parking area to the main entrance.		


**Access to Goods & Services**


Accessibility barriers were not identified for this category.


**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>703.4.1</b>	
<b>Estimated Cost:</b>	<b>\$135.08</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The sign at the Lobby Restroom is noncompliant. The sign is mounted at the wrong height and requires relocation. An estimate has been developed for the relocation of the sign to the appropriate mounting height.		

<b>ADA Standard Reference:</b>	<b>404.2.7, 404.2.8.1</b>	
<b>Estimated Cost:</b>	<b>\$746.64</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The existing Lobby Restroom door has several issues that make it noncompliant. The knob type lockset is mounted too high and the door closes in less than 5 seconds. An estimate has been developed for the removal of the knob type lockset and push/plate, installation of lever type locksets, and adjustment of the door closer.		

<b>ADA Standard Reference:</b>	<b>309.4, 603.4, 604.8.1.1, 604.8.1.2, 606.5</b>	
<b>Estimated Cost:</b>	<b>\$495.64</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The Lobby Restroom requires multiple work items to be compliant. The lavatories require pipe insulation to protect against contact (606.5). The coat hooks in the accessible stalls require vertical adjustment (603.4). The doors to the accessible stall are not self-closing (604.8.1.2). The door to the accessible stall in the Women’s restroom is missing hardware (309.4). The existing accessible stalls are less than 60” wide (604.8.1.1) An estimate has been developed for the items listed.		

<b>ADA Standard Reference:</b>	<b>404.2.4, 604.5.1, 604.6, 606.5</b>	
<b>Estimated Cost:</b>	<b>\$608.73</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> Several work items in the existing Men’s Staff restroom are required for compliance with the referenced sections. The swing of the door needs to be flipped to provide adequate maneuvering clearance beyond the latch side of the door (404.2.4). The existing side wall grab bar requires horizontal adjustment (604.5.1). The flush control on the water closet requires relocation to the open side of the unit (604.6). The pipes under the lavatory need to be insulated to protect against contact (606.5). An estimate has been developed for the listed work items.		

<b>ADA Standard Reference:</b>	<b>604.5.1, 604.6, 606.5</b>	
<b>Estimated Cost:</b>	<b>\$380.04</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> Several work items in the existing Women’s Staff restroom are required for compliance with the referenced sections. The pipes under the lavatories need to be insulated to protect against contact (606.5). The flush control on the water closet requires relocation to the open side of the unit (604.6). The existing side wall grab bar requires horizontal adjustment (604.5.1). An estimate has been developed for the listed work items.		


**Additional Access**

Accessibility barriers were not identified for this category.



**State of New Mexico, Doña Ana County**


**Asset/Location: Restroom and Concession Stand, Chaparral, NM**


<b>Assessors</b> Javier Ortega		
<b>Inspection Date</b> October 2015		
<b>Department</b> Facilities	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$2,553.43</b>	
<b>Priority 2:</b>	<b>\$0.00</b>	
<b>Priority 3:</b>	<b>\$1,235.96</b>	
<b>Priority 4:</b>	<b>\$0.00</b>	

**General Information**

The Restroom and Concession Stand located at the Delores Wright Education Center, 400 E. Lisa Road, Chaparral, NM was built in 2010. It is a single-story building consisting of 1,224 SQFT.

**Approach & Entrance**

<b>ADA Standard Reference:</b>	<b>502.2, 502.6</b>	
<b>Estimated Cost:</b>	<b>653.86</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The existing accessible parking provided is missing 2 ADA signs. An estimate has been developed for 2 new signs; 1 of which should indicate "van accessibility".		

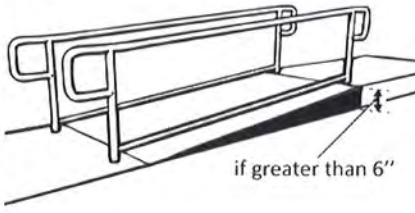
<b>ADA Standard Reference:</b>	<b>405.8</b>	
<b>Estimated Cost:</b>	<b>\$1,899.75</b>	
<b>Priority Level:</b>	<b>High</b>	
<b>Barrier Description/Proposed Solution:</b> The accessible route includes an 8' section with a slope of 1:12 near the concession restroom building. This section does not provide handrails. An estimate has been developed for the installation of 16 L.F. of handrails on each side of the ramp.		


**Access to Goods & Services**


Accessibility barriers were not identified for this category.



**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>703.5</b>	
<b>Estimated Cost:</b>	<b>\$141.18</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> Both the Men's and Women's restroom signs are faded and do not contrast with their background. An estimate has been developed for the removal and replacement of the existing signs with new tactile text and Braille signs.		


<b>ADA Standard Reference:</b>	<b>404.2.9</b>	
<b>Estimated Cost:</b>	<b>\$216.70</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The Men's and Women's restroom doors take a considerable amount of effort to open (more than 5lbs of force) and close in less than 5 seconds. An estimate has been developed for the adjustment of the door closers.		

<b>ADA Standard Reference:</b>	<b>604.5.1, 604.5.2, 604.8.1.2</b>	
<b>Estimated Cost:</b>	<b>\$878.08</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> Several work items in the existing Men's and Women's restroom are required for compliance with the referenced sections. The existing sidewall and rear wall grab bars require horizontal adjustment (604.5.1, 604.5.2). Restroom stall doors are not self-closing and require door adjustment or replacement (604.8.1.2). An estimate has been developed for the work items listed.		

**Additional Access**

Accessibility barriers were not identified for this category.


**State of New Mexico, Doña Ana County**  
**Asset/Location: Colquit Park Building, Chaparral, NM**


<b>Assessors</b> Michael Black		
<b>Inspection Date</b> October 2015		
<b>Department</b> Facilities	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	\$4,596.28	
<b>Priority 2:</b>	\$173.40	
<b>Priority 3:</b>	\$3,714.67	
<b>Priority 4:</b>	\$0.00	

**General Information**

The Colquit Park Building, located at 625 Paseo Real, Chaparral, NM, was built in 1980. It is a single-story building consisting of 1,664 SQFT.

**Approach & Entrance**

<b>ADA Standard Reference:</b>	<b>208.2</b>	
<b>Estimated Cost:</b>	<b>\$4,509.48</b>	
<b>Priority Level:</b>	<b>High</b>	
<b>Barrier Description/Proposed Solution:</b> The existing gravel parking lot currently has no provision for accessible parking associated with the Community Building. ADA standards require that at least 1 accessible parking space be made available. For the purposes of this estimate, it is suggested that a new concrete pad approximately 26'x22' to accommodate 2 new accessible parking spaces with an access aisle be installed. The estimate includes the installation of signs that include the International Symbol of Accessibility, parking bumpers, and appropriate pavement markings. New access aisles should be painted with blue paint and include text that indicates "NO PARKING".		

<b>ADA Standard Reference:</b>	<b>216.6</b>	
<b>Estimated Cost:</b>	<b>\$86.80</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> There are no existing entrance signs signifying an accessible entrance. ADA Standards require that all inaccessible entrances have signs indicating the location of the nearest accessible entrance. It is recommended that a sign be put up at the accessible entrance that includes the International Symbol of Accessibility on it. An estimate has been developed for the installation of the sign and the mounting.		

**Access to Goods & Services**

<b>ADA Standard Reference:</b>	<b>904.4.1</b>	
<b>Estimated Cost:</b>	<b>\$173.40</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing counter is currently measured at a height that is above ADA compliance. An estimate has been developed to lower the counter to the appropriate 36" AFF.</p>		

**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>404.2.4</b>	
<b>Estimated Cost:</b>	<b>\$230.72</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>There is a 9" maneuvering clearance beyond the latch side of the Men's restroom entrance door. An estimate has been developed to reverse the door to provide a front approach to the pull side of the door that has at least 18" of maneuvering clearance beyond the latch, with 60" of clear depth.</p>		

<b>ADA Standard Reference:</b>	<b>306.2, 603.3</b>	
<b>Estimated Cost:</b>	<b>\$2,290.51</b>	
<b>Priority Level:</b>	<b>High</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>Multiple work items in the existing restroom are required for compliance with the referenced sections. The existing lavatory is enclosed and does not have an accessible front approach for wheel chair access; it is recommended to remove and replace lavatory with an accessible lavatory (306.2). The existing mirror requires adjustment to the required mounting height (603.3). An estimate has been developed for the work items listed.</p>		

<b>ADA Standard Reference:</b>	<b>604.8.1.2, 604.8.1.1</b>	
<b>Estimated Cost:</b>	<b>\$1,193.44</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing accessible stall is noncompliant. Existing partitions and door require removal and replacement. Grab bars are currently not provided and require installation. An estimate has been developed for the work items listed. The estimate includes an Architectural Engineering fee for the reconfiguration of the existing space.</p>		

**Additional Access**

Accessibility barriers were not identified for this category.




**State of New Mexico, Doña Ana County**  
**Asset/Location: Colquit Park Restroom Building, Chaparral, NM**

<b>Assessors</b> Michael Black		
<b>Inspection Date</b> October 2015		
<b>Department</b> Facilities	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	\$2,920.77	
<b>Priority 2:</b>	\$0.00	
<b>Priority 3:</b>	\$2,219.27	
<b>Priority 4:</b>	\$0.00	

**General Information**

The Colquit Park Restroom Building, located at 625 Paseo Real, Chaparral, NM, was built in 2005, and consists of 417 SQFT.


**Approach & Entrance**

<b>ADA Standard Reference:</b>	208.2.4	
<b>Estimated Cost:</b>	\$2,920.77	
<b>Priority Level:</b>	High	
<b>Barrier Description/Proposed Solution:</b> The existing accessible parking provided is not properly striped and 1 of the ADA signs is missing and requires replacement. An estimate has been developed for the reconfiguration of the spaces and installation of a new sign. Access aisles should be painted with blue paint and include text that indicates "NO PARKING".		

**Access to Goods & Services**

Accessibility barriers were not identified for this category.

**Toilet Rooms**

<b>ADA Standard Reference:</b>	703.5	
<b>Estimated Cost:</b>	\$141.18	
<b>Priority Level:</b>	Medium	
<b>Barrier Description/Proposed Solution:</b> The existing accessible restrooms do not have tactile room signs with Braille. An estimate has been developed for the installation of new signs.		

<b>ADA Standard Reference:</b>	<b>404.2.8.1</b>	
<b>Estimated Cost:</b>	<b>\$108.35</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The door to the Women's restroom takes a considerable amount of effort to open (more than 5 lbs of force) and closes in less than 5 seconds. An estimate has been developed for the adjustment of the door closer.</p>		

<b>ADA Standard Reference:</b>	<b>308.2, 308.2.2, 603.4, 606.4</b>	
<b>Estimated Cost:</b>	<b>\$1,969.74</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>Several work items in the existing Men's and Women's restrooms are required for compliance with the referenced sections. The existing coat hooks require adjustment to the appropriate mounting height (603.4). The towel dispensers require adjustment to the appropriate mounting height (308.2). The existing sensor faucets should be replaced (606.4). New soap dispensers require installation (308.2.2). An estimate has been developed for the listed items.</p>		

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**

**Asset/Location: Crisis Triage Center, Las Cruces, NM**

<b>Assessors</b>		
Michael Black		
<b>Inspection Date</b>		
October 2015		
<b>Department</b>	<b>Asset Type</b>	
Facilities	Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$397.35</b>	
<b>Priority 2:</b>	<b>\$0.00</b>	
<b>Priority 3:</b>	<b>\$551.83</b>	
<b>Priority 4:</b>	<b>\$0.00</b>	

**General Information**

The Crisis Triage Center, located at 1850 Copper Loop, Las Cruces, NM, was built in 2013. The Center was built to provide a safe and secure environment for individuals with serious mental health issues until they are stabilized beyond the crisis moment; however, it has not yet been occupied. It is a single-story building consisting of 2,750 SQFT.




**Approach & Entrance**

<b>ADA Standard Reference:</b>	<b>502.4</b>
<b>Estimated Cost:</b>	<b>\$180.65</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> The newly installed asphalt has a low spot at the accessible parking access aisle. This is creating a slope greater than 1:48. It is recommended that the asphalt be saw-cut and reinstalled to create an even surface. An estimate has been developed for the items noted.	



<b>ADA Standard Reference:</b>	<b>404.2.8</b>
<b>Estimated Cost:</b>	<b>\$216.70</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> The existing public entry doors close in less than 5 seconds. An estimate has been developed for the adjustment of the door closers.	

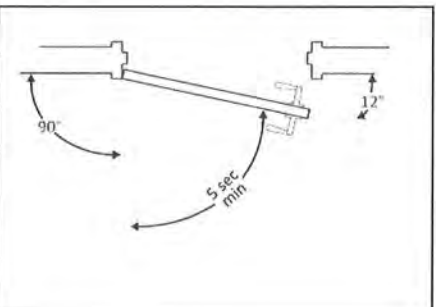


**Access to Goods & Services**

Accessibility barriers were not identified for this category.

**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>404.2.8.1</b>
<b>Estimated Cost:</b>	<b>\$216.70</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> The doors to restrooms 106 and 112 close in less than 5 seconds. An estimate has been developed to adjust the door closers.	

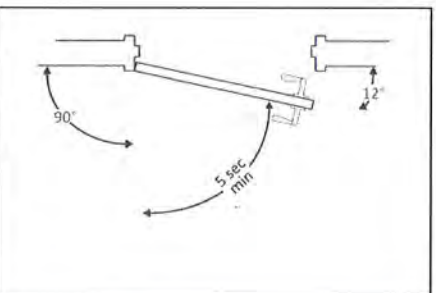

<b>ADA Standard Reference:</b>	<b>604.5.1, 604.5.2</b>
<b>Estimated Cost:</b>	<b>\$335.13</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> The side wall grab bar in restroom 106 requires horizontal adjustment and the rear wall grab bar in restrooms 106 and 112 require horizontal adjustment. An estimate has been developed for the work items listed.	




**Additional Access**

Accessibility barriers were not identified for this category.





**State of New Mexico, Doña Ana County**  
**Asset/Location: DASO Training Facilities, Las Cruces, NM**

<b>Assessors</b> Michael Black		
<b>Inspection Date</b> November 2015		
<b>Department</b> Facilities	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	\$4,284.54	
<b>Priority 2:</b>	\$0.00	
<b>Priority 3:</b>	\$1,001.68	
<b>Priority 4:</b>	\$0.00	

**General Information**

The DASO Training Facilities, located at 12060 Robert Larson Drive, Las Cruces, NM, was built in 1996. It is a single-story building consisting of 2,940 SQFT.


**Approach & Entrance**


<b>ADA Standard Reference:</b>	206.2.1, 208.2, 208.2.4, 502.2, 502.3, 502.6	
<b>Estimated Cost:</b>	\$4,104.75	
<b>Priority Level:</b>	High	
<b>Barrier Description/Proposed Solution:</b> The existing gravel parking lot does not provide accessible parking. An estimate has been developed to install a 26'x22' concrete pad to accommodate two 8' wide accessible spaces with an 8' access aisle. The estimate includes appropriate pavement markings, 2 ADA signs, and wheel stops. New access aisles should be painted with blue paint and include text that indicates "NO PARKING".		
<b>ADA Standard Reference:</b>	404.2.7	
<b>Estimated Cost:</b>	\$179.79	
<b>Priority Level:</b>	Low	
<b>Barrier Description/Proposed Solution:</b> The existing entrance door has a knob type lockset and requires removal and replacement with a lever type lockset. An estimate has been developed for the item noted.		


**Access to Goods & Services**

Accessibility barriers were not identified for this category.

**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>703.2, 703.3, 703.4.2, 703.4.1</b>	
<b>Estimated Cost:</b>	<b>\$135.84</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The existing room signs to the 2 restrooms are not ADA compliant. An estimate has been developed to install 2 new signs with tactile text and Braille.		

<b>ADA Standard Reference:</b>	<b>308.2, 308.2.2, 603.3, 604.5.1</b>	
<b>Estimated Cost:</b>	<b>\$432.92</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> Several work items in the South restroom are required for compliance with the referenced sections. The existing mirror requires relocation to the required mounting height (603.3). The soap and towel dispensers require adjustment to the appropriate mounting height (308.2, 308.2.2). The existing sidewall grab bar requires horizontal adjustment (604.5.1). An estimate has been developed for the work items listed.		

<b>ADA Standard Reference:</b>	<b>308.2, 308.2.2, 603.3, 604.5.1</b>	
<b>Estimated Cost:</b>	<b>\$432.92</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> Several work items in the North restroom are required for compliance with the referenced sections. The existing mirror requires relocation to the required mounting height (603.3). The soap and towel dispensers require adjustment to the appropriate mounting height (308.2, 308.2.2). The existing sidewall grab bar requires horizontal adjustment (604.5.1). An estimate has been developed for the work items listed.		

**Additional Access**

Accessibility barriers were not identified for this category.



**State of New Mexico, Doña Ana County**


**Asset/Location: Doña Ana DASO (Public Health), Doña Ana, NM**


<b>Assessors</b> Michael Black		
<b>Inspection Date</b> November 2015		
<b>Department</b> Facilities	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	\$3,594.50	
<b>Priority 2:</b>	\$0.00	
<b>Priority 3:</b>	\$900.83	
<b>Priority 4:</b>	\$0.00	

**General Information**

The Doña Ana Public Health Building, located at 5595 Elks Road, Doña Ana, NM, was built in 1998. The building consists of 3,024 SQFT, and has a number of private offices and lab areas.

**Approach & Entrance**

<b>ADA Standard Reference:</b>	208.2.4, 502.2, 502.6	
<b>Estimated Cost:</b>	\$3,334.17	
<b>Priority Level:</b>	Low	
<b>Barrier Description/Proposed Solution:</b> The existing parking lot provides 2 accessible spaces with 2 access aisles. The access aisles do not align with the ramps. An estimate has been developed for the reconfiguration of the accessible parking to have two 8'-0" wide spaces, with an 8'-0" wide access aisle aligned with the ramp entrance. Access aisles should be painted with blue paint and include text that indicates "NO PARKING". New accessible parking signs should also be installed.		

<b>ADA Standard Reference:</b>	505.10.1	
<b>Estimated Cost:</b>	\$151.98	
<b>Priority Level:</b>	Low	
<b>Barrier Description/Proposed Solution:</b> The handrails at the entry ramps do not extend at least 12" horizontally beyond the bottom of the ramp. An estimate has been developed for the installation of an extension to the rail to comply with the requirements of this section. Installation of the handrail extension may create a clearance issue at the accessible route. It is recommended that if such an issue arises, the bar extension be turned at a 90 degree angle toward the parking area.		



<b>ADA Standard Reference:</b>	<b>404.2.8</b>	
<b>Estimated Cost:</b>	<b>\$108.35</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The entry door takes a considerable amount of effort to open (more than 5 lbs of force) and closes in less than 5 seconds. An estimate has been developed for the adjustment of the door closer.</p>		

**Access to Goods & Services**

Accessibility barriers were not identified for this category.

**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>703</b>	
<b>Estimated Cost:</b>	<b>\$141.18</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The restrooms currently have room signs that do not comply with the requirements of this section. An estimate has been developed for the installation of new tactile text with Braille signs at each of the restrooms.</p>		


<b>ADA Standard Reference:</b>	<b>308.2, 604.5.2., 604.6, 606.5</b>	
<b>Estimated Cost:</b>	<b>\$759.65</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing restrooms require several work items to comply with the referenced sections. Both restroom lavatories require the installation of pipe insulation to protect against contact (606.5). The paper towel dispensers are mounted above the maximum allowable height and should be relocated (308.2). The rear grab bars in both restrooms require horizontal adjustment (604.5.2). In the Women's restroom the flush control on the water closet requires relocation to the open side of the unit (604.6). An estimate has been developed for the work items listed.</p>		

**Additional Access**

Accessibility barriers were not identified in this category.

**State of New Mexico, Doña Ana County**

**Asset/Location: Restroom, (De La O Saloon-Future Visitor Center), Doña Ana, NM**

<b>Assessors</b> Michael Black		
<b>Inspection Date</b> November 2015		
<b>Department</b> Facilities	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$0.00</b>	
<b>Priority 2:</b>	<b>\$0.00</b>	
<b>Priority 3:</b>	<b>\$853.44</b>	
<b>Priority 4:</b>	<b>\$0.00</b>	

**General Information**

The Restroom at the De La O Saloon/Visitor Center, located at 105 Joe Gutierrez Street, Doña Ana, NM, was built in 1975, and consists of 352 SQFT.


**Approach & Entrance**


Accessibility barriers were not identified for this category.


**Access to Goods & Services**

Accessibility barriers were not identified for this category.

**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>703.4.2</b>	
<b>Estimated Cost:</b>	<b>\$141.18</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The provided room signs are mounted on the doors, but should be mounted on the wall nearest to the latch side of the door. An estimate has been provided for the installation of 2 new tactile text with Braille room signs.		

<b>ADA Standard Reference:</b>	<b>404.2.9</b>	
<b>Estimated Cost:</b>	<b>\$433.40</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The existing Men's and Women's restroom take considerable amount of effort to open (more than 5 lbs of force). The doors stick at the threshold and close in less than 5 seconds. An estimate has been developed for the adjustment of the thresholds and the door closers.		

<b>ADA Standard Reference:</b>	<b>604.8.1.2</b>	
<b>Estimated Cost:</b>	<b>\$278.86</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing toilet compartment doors to the accessible stalls are not self-closing. The partition doors should be adjusted to be self-closing. An estimate has been developed for the adjustments of the doors.</p>		

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**


**Asset/Location: De La O Saloon/Visitor Center, Doña Ana, NM**

<b>Assessors</b> Michael Black		
<b>Inspection Date</b> November 2015		
<b>Department</b> Facilities	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	\$719.25	
<b>Priority 2:</b>	\$126.36	
<b>Priority 3:</b>	\$0.00	
<b>Priority 4:</b>	\$0.00	

**General Information**

The De La O Saloon/Visitor Center, located at 105 Joe Gutierrez Street, Doña Ana, NM, was built in 1900. It is a single-story building consisting of 3,130 SQFT.

**Approach & Entrance**
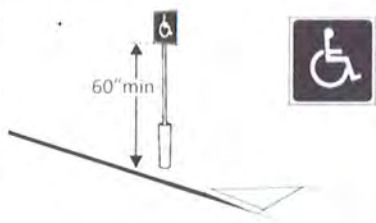
<b>ADA Standard Reference:</b>	<b>502.6</b>	
<b>Estimated Cost:</b>	<b>\$270.16</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The signs at both accessible parking spaces are mounted below the minimum required height. An estimate has been developed to adjust the signs to 60" AFF.</p>		



<b>ADA Standard Reference:</b>	<b>406.4</b>
<b>Estimated Cost:</b>	<b>\$330.53</b>
<b>Priority Level:</b>	<b>Medium</b>
<b>Barrier Description/Proposed Solution:</b> The landing at the top of the curb ramp exceeds the maximum allowable slope. An estimated has been developed to demolish the 4'x4' existing landing and install a level landing.	




<b>ADA Standard Reference:</b>	<b>216.6</b>
<b>Estimated Cost:</b>	<b>\$118.56</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> Signs indicating the nearest accessible entrance require installation. This building is on the historic register which may provide an exception to this standard. An estimate has been developed for the installation of 2 new directional signs.	



**Access to Goods & Services**

<b>ADA Standard Reference:</b>	<b>206.2.4</b>
<b>Estimated Cost:</b>	<b>\$126.36</b>
<b>Priority Level:</b>	<b>High</b>
<b>Barrier Description/Proposed Solution:</b> The Saloon room is accessed by a 9" step down. This building is on the historic register which may provide an exception to this standard. An estimate has been developed for the installation of a new wood ramp.	

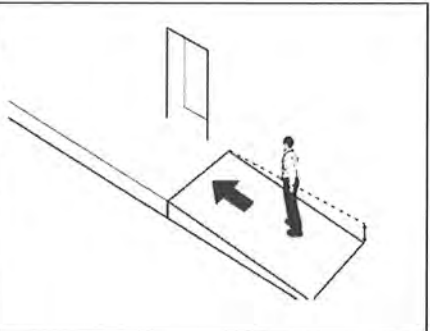

**Toilet Rooms**

Accessibility barriers were not identified for this category.

**Additional Access**

Accessibility barriers were not identified for this category.


**State of New Mexico, Doña Ana County**  
**Asset/Location: Del Cerro Community Center, Del Cerro, NM**


<b>Assessors</b> Michael Black		
<b>Inspection Date</b> October 2015		
<b>Department</b> Facilities	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	\$238.70	
<b>Priority 2:</b>	\$0.00	
<b>Priority 3:</b>	\$5,534.69	
<b>Priority 4:</b>	\$0.00	

**General Information**

The Del Cerro Community Center located at 180 La Fe Avenue, Del Cerro, NM, was built in 1994. The Center provides programs that meet community needs, enhance the quality of life and promote community involvement. This single-story building consisting of 4,194 SQFT has a kitchen, bathrooms, meeting rooms, office space and multi-purpose rooms.

**Approach & Entrance**
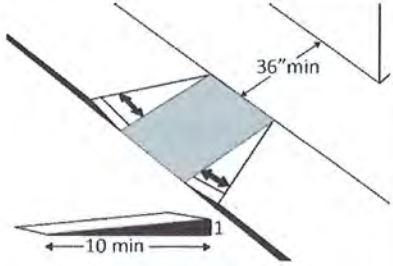
<b>ADA Standard Reference:</b>	<b>406.3</b>	
<b>Estimated Cost:</b>	<b>\$151.51</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The existing curb ramp includes flares with a slope that is greater than 1:10. An estimate has been developed to remove and replace the curb ramp to comply with the requirements of the referenced section.		


<b>ADA Standard Reference:</b>	<b>216.6</b>	
<b>Estimated Cost:</b>	<b>87.19</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> This facility has 2 entrances. A directional sign needs to be installed indicating the direction of the main accessible entrance and a sign needs to be installed at the accessible entrance indicating ADA accessibility. An estimate has been developed for the installation of the signs.		


**Access to Goods & Services**


Accessibility barriers were not identified for this category.




**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>308.2, 604.5.1, 604.5.2, 604.8.1.1, 604.8.1.2, 606.4, 606.5, 703.5</b>	
<b>Estimated Cost:</b>	<b>\$2,296.15</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> Several work items in the existing Men's restroom are required for compliance with the referenced sections. The existing door to the Men's restroom requires that a tactile text with Braille sign be installed (703.5). Pipe insulation under one of the lavatories is missing and requires installation (606.5). 2 existing faucets require the installation of lever type hardware (606.4). The existing soap dispenser requires mounting adjustment (308.2). The side and rear wall grab bars require horizontal adjustment (604.5.1, 604.5.2) The accessible stall partition door requires adjustment or replacement to achieve self-closing (604.8.1.2). The accessible stall is less than the minimum required width and requires reconfiguration (604.8.1.1). An estimate has been developed for the work items listed.		

<b>ADA Standard Reference:</b>	<b>308.2, 603.4, 604.5.1, 604.6, 604.8.1.1, 604.8.1.2, 606.4, 703.5,</b>	
<b>Estimated Cost:</b>	<b>\$2,524.94</b>	
<b>Priority Level:</b>	<b>High</b>	
<b>Barrier Description/Proposed Solution:</b> Several work items in the existing Women's restroom are required for compliance with the referenced sections. The existing door to the Women's restroom requires that a tactile text with Braille sign be installed (703.5). The existing accessible stall has a coat hook that is above the maximum mounting height and requires the installation of a new hook (603.4). 2 existing faucets require the installation of lever type hardware (606.4). The existing soap dispenser requires mounting adjustment (308.2). The side wall grab bar requires horizontal adjustment (604.5.1). The flush control on the water closet in the accessible stall requires relocation to the open side of the unit (604.6). The accessible stall partition door requires adjustment or replacement to achieve self-closing (604.8.1.2). The accessible stall is less than the minimum required width and requires reconfiguration (604.8.1.1). An estimate has been developed for the work items listed.		

<b>ADA Standard Reference:</b>	<b>308.2, 308.2.2, 604.6</b>	
<b>Estimated Cost:</b>	<b>\$451.41</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> Several work items in the existing Staff restroom are required for compliance with the referenced sections. The soap and paper towel dispensers require mounting adjustment (308.2, 308.2.2). The flush control on the water closet requires relocation to the open side of the unit (604.6). An estimate has been developed for the work items listed.		




<b>ADA Standard Reference:</b>	<b>404.2.4</b>	
<b>Estimated Cost:</b>	<b>\$262.19</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> A drinking fountain is installed at the latch side of the door to the Staff unisex restroom. The fountain prohibits required maneuvering clearances. An additional drinking fountain is available in the building; therefore, this unit should be removed. An estimate has been developed for the removal of the existing drinking fountain.		

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**


**Asset/Location: Delores Wright Education Center, Chaparral, NM**

<b>Assessors</b> Antonio Florencio Ortega		
<b>Inspection Date</b> October 2015		
<b>Department</b> Facilities	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$2,322.62</b>	
<b>Priority 2:</b>	<b>\$0.00</b>	
<b>Priority 3:</b>	<b>\$690.40</b>	
<b>Priority 4:</b>	<b>\$0.00</b>	

**General Information**

The Delores Wright Education Center, located at 400 E. Lisa Road, Chaparral, NM, was built in 2001. It is a single-story building consisting of 3,389 SQFT.


**Approach & Entrance**

<b>ADA Standard Reference:</b>	<b>206.2.1, 502.3</b>	
<b>Estimated Cost:</b>	<b>\$2,000.30</b>	
<b>Priority Level:</b>	<b>High</b>	
<b>Barrier Description/Proposed Solution:</b> The existing access aisle and accessible route requires that persons with disabilities walk behind vehicles to access the remote ramp. An estimate has been developed for the installation of a new curb ramp aligned with the existing access aisle.		

<b>ADA Standard Reference:</b>	<b>208.2.4</b>
<b>Estimated Cost:</b>	<b>\$213.97</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> The existing parking lot provides 2 accessible parking spaces; neither is designated as "van accessible". An estimate has been developed for the installation of a "van accessible" sign for identification purposes.	



<b>ADA Standard Reference:</b>	<b>404.2.8</b>
<b>Estimated Cost:</b>	<b>\$108.35</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> The existing entry door closes in less than 5 seconds. An estimate has been developed for the adjustment of the door closer.	

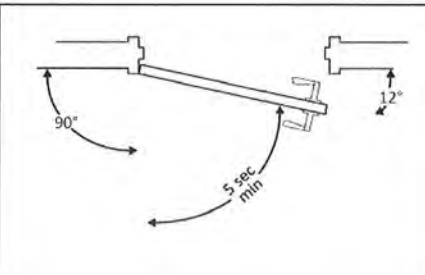

**Access to Goods & Services**


Accessibility barriers were not identified for this category.

**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>404.2.9, 604.8.1.2</b>
<b>Estimated Cost:</b>	<b>\$216.70</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> The existing doors to the Men's and Women's restroom take a considerable amount of effort to open (more than 5 lbs of force). An estimate has been developed for the adjustment of the door closers.	



<b>ADA Standard Reference:</b>	<b>306.3.3, 308.2, 604.8.1.2</b>
<b>Estimated Cost:</b>	<b>\$473.70</b>
<b>Priority Level:</b>	<b>Medium</b>
<b>Barrier Description/Proposed Solution:</b> The existing Men's and Women's restroom require several work items to be in compliance with the referenced sections. Each restroom has a sink that is too low and requires vertical mounting adjustment (306.3.3). The existing paper towel dispensers in each restroom require relocation (308.2). The partition doors at the accessible stall in each restroom require replacement to achieve self-closing (604.8.1.2). An estimate has been developed for the items listed.	

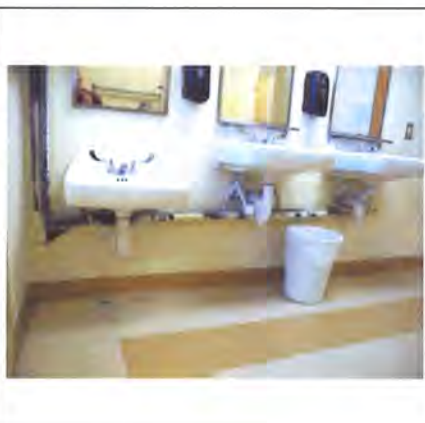


**Additional Access**

Accessibility barriers were not identified for this category.



**State of New Mexico, Doña Ana County**


**Asset/Location: Ball Field Concession/Restrooms, Doña Ana Ball Field, Doña Ana, NM**


<b>Assessors</b> Javier Ortega, Charles Sheville, Antonio Florencio Ortega, Michael Black		
<b>Inspection Date</b> November 2015		
<b>Department</b> Facilities	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$2,282.99</b>	
<b>Priority 2:</b>	<b>\$0.00</b>	
<b>Priority 3:</b>	<b>\$6,167.98</b>	
<b>Priority 4:</b>	<b>\$3,999.96</b>	

**General Information**

The Ball Field Concession/Restrooms at the Doña Ana Ball Field, 615 Doña Ana School Road, Doña Ana, NM was built in 1995, and consists of 414 SQFT.

**Approach & Entrance**

<b>ADA Standard Reference:</b>	<b>502.2, 502.3</b>	
<b>Estimated Cost:</b>	<b>\$1,746.45</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The concrete pad is large enough to accommodate the appropriate ADA parking requirements; however, it is striped incorrectly. An estimate has been developed for the removal of the existing stripes and the repainting of new appropriate pavement markings. New access aisles should be painted with blue paint and include text that indicates "NO PARKING".		


<b>ADA Standard Reference:</b>	<b>403.3</b>	
<b>Estimated Cost:</b>	<b>\$536.54</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The walkway between the stands and concession building is too steep (1:19). An estimate has been developed to remove the existing sidewalk and replace it with 75 S.F. of new sidewalk that has a slope of 1:20.		

**Access to Goods & Services**


Accessibility barriers were not identified for this category.



**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>216, 404, 604, 606, 703</b>	
<b>Estimated Cost:</b>	<b>\$6,167.98</b>	
<b>Priority Level:</b>	<b>High</b>	
<b>Barrier Description/Proposed Solution:</b> The existing restroom building currently does not provide for ADA accessibility. An estimate has been developed for the complete gut and redesign of 2 compliant restrooms.		

**Additional Access**

<b>ADA Standard Reference:</b>	<b>602.5</b>	
<b>Estimated Cost:</b>	<b>\$3,999.96</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The 2 existing water fountains are not ADA compliant. An estimate has been developed for the removal and replacement of the drinking fountains.		

**State of New Mexico, Doña Ana County**


**Asset/Location: Doña Ana Boxing Facility, Doña Ana, NM**

<b>Assessors</b> Michael Black		
<b>Inspection Date</b> November 2015		
<b>Department</b> Facilities	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$157.78</b>	
<b>Priority 2:</b>	<b>0.00</b>	
<b>Priority 3:</b>	<b>\$352.97</b>	
<b>Priority 4:</b>	<b>\$0.00</b>	

**General Information**

The Doña Ana Boxing Facility, located at 75597 Elks Drive, Doña Ana, NM, was built in 2008. It is a single-story building consisting of 5,625 SQFT.


**Approach & Entrance**

<b>ADA Standard Reference:</b>	<b>208.2.4, 502.6</b>	
<b>Estimated Cost:</b>	<b>\$157.78</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The accessible parking provided does not have ADA signs. An estimate has been developed for the installation of 2 new signs on the existing posts; 1 which should indicate the space as "van accessible".		

**Access to Goods & Services**

Accessibility barriers were not identified for this category.

**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>308.2.2, 603.4, 604.8.1.2</b>	
<b>Estimated Cost:</b>	<b>\$352.97</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The existing restroom requires several work items to be in compliance with the referenced sections. The existing coat hook is installed above the maximum allowable height and requires adjustment to the appropriate mounting height (603.4). The existing towel dispenser requires relocation (308.2). The accessible stall partition door requires adjustment or replacement to be self-closing (604.8.1.2). An estimate has been developed for the items listed.		

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**

**Asset/Location: Doña Ana Community Center, Doña Ana, NM**


<b>Assessors</b> Michael Black		
<b>Inspection Date</b> November 2015		
<b>Department</b> Facilities	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$2,871.88</b>	
<b>Priority 2:</b>	<b>\$2,650.49</b>	
<b>Priority 3:</b>	<b>\$1,062.90</b>	
<b>Priority 4:</b>	<b>\$0.00</b>	


**General Information**

The Doña Ana Community Center, located at 5475 Ledesma Drive, Doña Ana, NM, was built in 1971. The Center provides programs that meet community needs, enhance the quality of life and promote community involvement. This single-story 3,994 SQFT building has a kitchen, bathrooms, meeting rooms, office space and multi-purpose rooms.




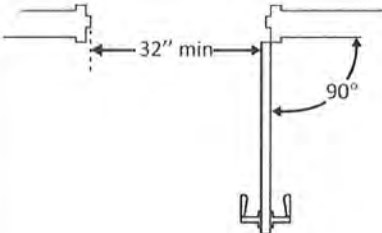
**Approach & Entrance**

<b>ADA Standard Reference:</b>	<b>208.2.4, 502.2</b>	
<b>Estimated Cost:</b>	<b>\$2,777.01</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The existing accessible parking provided requires that the markings be reconfigured to provide for a "van accessible" space. An estimate has been developed for the reconfiguration of the markings to provide for two 8'-0" spaces and an 8'-0" access aisle. Access aisles should be painted with blue paint and include text that indicates "NO PARKING". A new "van accessible" sign should be installed.		

<b>ADA Standard Reference:</b>	<b>216.6</b>	
<b>Estimated Cost:</b>	<b>\$94.87</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> A sign indicating that the West side entrance is accessible is required to be installed. An estimate has been developed for the installation of a new tactile text with Braille sign.		

**Access to Goods & Services**

<b>ADA Standard Reference:</b>	<b>216.2</b>	
<b>Estimated Cost:</b>	<b>\$211.77</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> 3 permanent rooms that are unlikely to change currently have no compliant room signs. An estimate has been developed for the installation of 3 new tactile text with Braille room signs.		

<b>ADA Standard Reference:</b>	<b>404.2.3</b>	
<b>Estimated Cost:</b>	<b>\$332.31</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The door into the classroom is too narrow providing only 29" of clearance. This section requires that there be at least 32" of clearance at the door when opened to 90 degrees. An estimate has been developed to alter the opening to provide a door that is compliant with the requirements of this section.		



<b>ADA Standard Reference:</b>	<b>904.4.1</b>	
<b>Estimated Cost:</b>	<b>\$2,106.41</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing serving counter is currently at 44" AFF. This section requires that the counter be no higher than 36" AFF. An estimate has been developed to lower this section of the counter.</p>		

### Toilet Rooms


<b>ADA Standard Reference:</b>	<b>404.2.9, 604.2, 604.5.1, 604.5.2, 606.5., 703.4.2</b>	
<b>Estimated Cost:</b>	<b>\$584.45</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The Women's restroom is marked as accessible; however, several work items will need to be completed to bring the restroom into full compliance. The tactile sign requires relocation (703.4.2). The restroom door requires maintenance, so that it can be opened easily (404.2.9). The lavatory pipes require insulation to protect against contact (606.5). The side wall of the water closet needs to be furred out to provide for the installation of a continuous grab bar (604.5.1). This will require that the water closet be relocated to maintain the required distance from the side wall to the centerline (604.2). A new grab bar on the rear wall needs to be installed (604.5.2). An estimate has been developed for the work items listed.</p>		

<b>ADA Standard Reference:</b>	<b>404.2.9, 604.5.1, 604.5.2, 604.6, 606.5., 703.4.2</b>	
<b>Estimated Cost:</b>	<b>\$478.45</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The Men's restroom is marked as accessible; however, several work items will need to be completed to bring the restroom into full compliance. The tactile sign requires relocation (703.4.2). The restroom door requires maintenance, so that it can be opened easily (404.2.9). The lavatory pipes require insulation to protect against contact (606.5). A new 42" side wall and 36" rear wall grab bar require installation (604.5.1, 604.5.2). The flush control on the water closet requires relocation to the open side of the unit. (604.6) An estimate has been developed for the work items listed.</p>		

### Additional Access

Accessibility barriers were not identified for this category.


**State of New Mexico, Doña Ana County**  
**Asset/Location: East Mesa Public Health, East Mesa, NM**


<b>Assessors</b> Michael Black		
<b>Inspection Date</b> November 2015		
<b>Department</b> Facilities	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	\$3,110.01	
<b>Priority 2:</b>	\$476.52	
<b>Priority 3:</b>	\$1,526.45	
<b>Priority 4:</b>	\$0.00	

**General Information**


East Mesa Public Health, located at 5220 Holman Road, East Mesa, NM, was built in 2001. The building consists of 2,829 SQFT, and provides primary care services for children and adults.

**Approach & Entrance**

<b>ADA Standard Reference:</b>	502.3.3, 502.6	
<b>Estimated Cost:</b>	\$2,348.46	
<b>Priority Level:</b>	Low	
<b>Barrier Description/Proposed Solution:</b> The existing parking striping is faded and hard to see. There are no signs signifying that the stalls are accessible. An estimate has been developed to remove the existing paint, re-paint the stalls, including the accessible aisle, and put up 2 ADA signs; 1 being a "van accessible" sign. Access aisles should be painted with blue paint and include text that indicates "NO PARKING".		

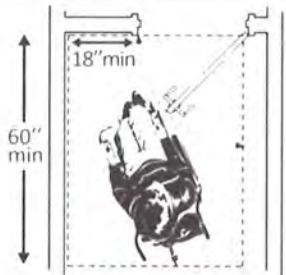
<b>ADA Standard Reference:</b>	404.2.4	
<b>Estimated Cost:</b>	\$761.55	
<b>Priority Level:</b>	Medium	
<b>Barrier Description/Proposed Solution:</b> The front approach to the pull side of the door is 12" to the edge of the ramp which does not allow for the required maneuvering space. An estimate has been developed to install an automatic door opener.		


**Access to Goods & Services**

<b>ADA Standard Reference:</b>	703	
<b>Estimated Cost:</b>	\$476.52	
<b>Priority Level:</b>	Low	
<b>Barrier Description/Proposed Solution:</b> The existing rooms do not have compliant signs. An estimate has been developed for the installation of 6 new tactile text with Braille signs.		



**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>703.2, 703.3, 703.4.2</b>	
<b>Estimated Cost:</b>	<b>\$152.64</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> This facility has 3 restrooms with room signs mounted to the doors that do not include Braille. An estimate has been developed to install 2 new tactile text with Braille signs.		


<b>ADA Standard Reference:</b>	<b>308.2, 603.4, 604.2, 604.5.2, 604.8.1.2, 609.4</b>	
<b>Estimated Cost:</b>	<b>\$1,155.73</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> Several work items in the existing Men's and Women's restroom are required for compliance with the referenced sections. The coat hooks are mounted above the maximum allowable height and an additional hook should be installed (603.4). The paper towel dispensers require mounting adjustment (308.2). The sidewall grab bars require vertical adjustment (609.4). The rear wall grab bars require horizontal and vertical adjustment (604.5.2, 609.4). The accessible stall partition doors require adjustment to achieve self-closing (604.8.1.2). In the Women's restroom the accessible stalls water closet requires adjustment to achieve the required distance from the sidewall (604.2). An estimate has been developed for the work items listed.		

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**

**Asset/Location: Administration Office, Las Cruces, NM**


<b>Assessors</b> Javier Ortega, Charles Sheville, Terry Maloney; Michael Black		
<b>Inspection Date</b> November 2015		
<b>Department</b> Facilities	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$13,698.07</b>	
<b>Priority 2:</b>	<b>\$1,099.59</b>	
<b>Priority 3:</b>	<b>\$2,797.34</b>	
<b>Priority 4:</b>	<b>\$0.00</b>	





**General Information**


The Administration Office is located at the Las Cruces Fairgrounds, 12020 Robert Larson Drive, Las Cruces, NM, and was built in 1965. It is a single-story building consisting of 4,819 SQFT.

**Approach & Entrance**

<b>ADA Standard Reference:</b>	<b>208.2</b>	
<b>Estimated Cost:</b>	<b>\$2,951.55</b>	
<b>Priority Level:</b>	<b>High</b>	
<b>Barrier Description/Proposed Solution:</b> The existing parking lot does not designate an accessible parking space. An estimate has been developed to demolish 320 S.F. of asphalt and to construct a new concrete pad for a "van accessible" parking space, with an access aisle that aligns with the main entry. Access aisles should be painted with blue paint and include text that indicates "NO PARKING". This estimate includes a "van accessible" sign and post.		

<b>ADA Standard Reference:</b>	<b>402.2, 403.3, 502.3</b>	
<b>Estimated Cost:</b>	<b>\$3,431.86</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The concrete sidewalk is disintegrating and does not have an ADA curb ramp. An estimate has been developed to demolish 450 S.F. of concrete sidewalk and replace with a new sidewalk and curb ramp that is aligned with the ADA parking access aisle and main entrance. This includes the walk way to the entrance door.		

<b>ADA Standard Reference:</b>	<b>405.5</b>	
<b>Estimated Cost:</b>	<b>\$5,771.72</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> Wood ramps have been installed at 2 entrances of the building; the ramps do not comply with the referenced sections. The ramps should be removed and replaced with new ADA compliant concrete ramps with rails.		

<b>ADA Standard Reference:</b>	<b>206.2.1</b>	
<b>Estimated Cost:</b>	<b>\$1,441.38</b>	
<b>Priority Level:</b>	<b>High</b>	
<b>Barrier Description/Proposed Solution:</b> The main entrance to the Fair Office currently has a 3" step up at the door. A new concrete landing and ramp with railing should be installed to provide access. An estimate has been developed for the work item noted.		

<b>ADA Standard Reference:</b>	<b>216.6</b>
<b>Estimated Cost:</b>	<b>\$101.56</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
At the East side of the building there are 2 entrances; the entrance to the Fair Office and the entrance at the North set of double doors. It is recommended that the set of double doors be the main accessible entrance to the facility. An estimate has been developed for the installation of 2 signs. At the Fair Office entrance a directional sign should be installed indicating the location of the nearest accessible entrance and at the set of double doors a sign indicating accessibility. An estimate has been developed for the item noted.	



**Access to Goods & Services**

<b>ADA Standard Reference:</b>	<b>206.2.4</b>
<b>Estimated Cost:</b>	<b>\$20.85</b>
<b>Priority Level:</b>	<b>Medium</b>
<b>Barrier Description/Proposed Solution:</b>	
The conference room is only accessible through the swinging gate which is too narrow for a wheelchair. An estimate has been developed to remove the swinging gate.	



<b>ADA Standard Reference:</b>	<b>404.2.7</b>
<b>Estimated Cost:</b>	<b>\$1,078.74</b>
<b>Priority Level:</b>	<b>Medium</b>
<b>Barrier Description/Proposed Solution:</b>	
All existing interior doors (6 doors) have knob type locksets. An estimate has been developed to remove the existing knob type locksets and replace with lever type locksets.	



**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>404.2.3</b>
<b>Estimated Cost:</b>	<b>\$1,434.99</b>
<b>Priority Level:</b>	<b>High</b>
<b>Barrier Description/Proposed Solution:</b>	
The door to the accessible restroom has a clearance of 24.5" between the face of the door and the stop. An estimate has been developed to widen the opening and replace the door. The existing wall is CMU and may require structural engineering for alteration.	





<b>ADA Standard Reference:</b>	603.3, 604.2, 604.4, 604.5.1, 604.5.2, 606.4, 606.5
<b>Estimated Cost:</b>	\$658.94
<b>Priority Level:</b>	Medium
<b>Barrier Description/Proposed Solution:</b> Several work items in the existing unisex restroom are required for compliance with the referenced sections. A room sign with tactile text and Braille requires installation (703.5).The existing mirror requires relocation to the required mounting height (603.3). The existing lavatory requires the installation of pipe insulation to protect against contact and a new ADA compliant faucet (606.5, 606.4). The water closet mounting location requires adjustment and the water closet requires replacement (604.2, 604.4). New rear and sidewall grab bars need to be installed. (604.5.1, 604.5.2). An estimate has been developed for the work items listed.	



**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**

**Asset/Location: Restroom Building- West, Las Cruces, NM**

<b>Assessors</b> Michael Black	
<b>Inspection Date</b> November 2015	
<b>Department</b> Facilities	<b>Asset Type</b> Building
<b>ADA Checklist Summary Of Costs:</b>	
<b>Priority 1:</b>	\$0.00
<b>Priority 2:</b>	\$0.00
<b>Priority 3:</b>	\$1,463.71
<b>Priority 4:</b>	\$0.00



**General Information**

The Restroom located at the West side of the Fairgrounds, 12021 Robert Larson Drive, Las Cruces, NM was built in 1996. It is a single-story building consisting of 1,322 SQFT.

**Approach & Entrance**


Accessibility barriers were not identified for this category.


**Access to Goods & Services**

Accessibility barriers were not identified for this category.



**Toilet Rooms**

<b>ADA Standard Reference:</b>	404.2.8.1, 404.2.9	
<b>Estimated Cost:</b>	\$433.40	
<b>Priority Level:</b>	Low	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing entry and exit doors to both the Men's and Women's restrooms require a considerable amount of effort to open (more than 5 lbs of force) and close in less than 5 seconds. An estimate has been developed for the adjustment of the door closers.</p>		


<b>ADA Standard Reference:</b>	308.2, 603.4, 604.2, 604.5.1, 606.5	
<b>Estimated Cost:</b>	\$1,030.31	
<b>Priority Level:</b>	Low	
<b>Barrier Description/Proposed Solution:</b>		
<p>Several work items at the West Restroom building are required for compliance with the referenced sections. New coat hooks need to be installed at the required mounting height (603.4). The lavatories in the Women's restroom require pipe insulation below the sink to protect against contact (606.5). The paper towel dispensers in both the Men's and the Women's restrooms require vertical mounting adjustment (308.2). The water closet in the Men's accessible stall requires adjustment from the side wall to the center line (604.2). The side wall grab bars in both the Men's and Women's restrooms require replacement with the appropriate 42" bar (604.5.1). An estimate has been developed for the work items listed.</p>		

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**

**Asset/Location: Restroom (New), Las Cruces, NM**

<b>Assessors</b> Michael Black		
<b>Inspection Date</b> November 2015		
<b>Department</b> Facilities	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	\$0.00	
<b>Priority 2:</b>	\$0.00	
<b>Priority 3:</b>	\$1,144.09	
<b>Priority 4:</b>	\$0.00	

**General Information**

The Restroom building at the Fairgrounds, located at 12038 Robert Larson Drive, Las Cruces, NM, was built in 2006. It is a single-story building consisting of 720 SQFT.


**Approach & Entrance**

Accessibility barriers were not identified for this category.

**Access to Goods & Services**

Accessibility barriers were not identified for this category.

**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>603.3, 604.5.1, 609.4</b>	
<b>Estimated Cost:</b>	<b>\$1,144.09</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The new restroom on the far East side of the property is relatively new construction with minor noncompliance issues that will need to be addressed to achieve full compliance with ADA Standards. 4 mirrors in both the Men's and Women's restrooms are mounted above the maximum mounting height (603.3). The sidewalls grab bars in both the Men's and the Women's accessible stalls are the wrong size and will need to be replaced (604.5.1). The rear wall grab bar in the Men's restroom accessible stall requires vertical mounting adjustment (609.4). An estimate has been developed for the work items listed.		

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**

**Asset/Location: Fleet Building, Las Cruces, NM**

<b>Assessors</b> Michael Black		
<b>Inspection Date</b> October 2015		
<b>Department</b> Facilities	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$213.16</b>	
<b>Priority 2:</b>	<b>\$0.00</b>	
<b>Priority 3:</b>	<b>\$216.46</b>	
<b>Priority 4:</b>	<b>\$0.00</b>	


**General Information**

The Fleet Building, located at 2033 E. Griggs, Las Cruces, NM, was built in 2012. It is a single-story building consisting of 18,000 SQFT.



**Approach & Entrance**

<b>ADA Standard Reference:</b>	<b>404.2.8</b>
<b>Estimated Cost:</b>	<b>\$213.16</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> The entry doors close in less than 5 seconds. An estimate has been developed to adjust the door closers.	

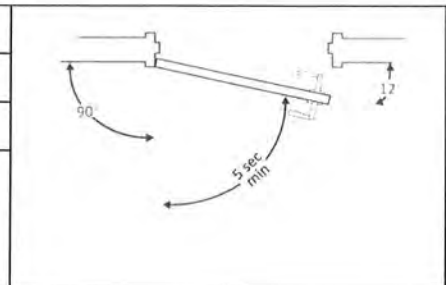

**Access to Goods & Services**

Accessibility requirements were not identified for this category.

**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>604.7</b>
<b>Estimated Cost:</b>	<b>\$216.46</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> The existing Men's and Women's restroom toilet paper dispensers require horizontal mounting adjustment. An estimate has been developed for the item noted.	



**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**

**Asset/Location: Gazebo, Dusty Lane and Cristo Rey, Doña Ana**

<b>Assessors</b> Michael Black	
<b>Inspection Date</b> November 2015	
<b>Department</b> Facilities	<b>Asset Type</b> Building
<b>ADA Checklist Summary Of Costs:</b>	
<b>Priority 1:</b>	<b>\$5,267.01</b>
<b>Priority 2:</b>	<b>\$0.00</b>
<b>Priority 3:</b>	<b>\$0.00</b>
<b>Priority 4:</b>	<b>\$0.00</b>





**General Information**

The Gazebo, located at Dusty Lane and Cristo Rey, Doña Ana, NM, was built in 2005, and consists of 164 SQFT.



**Approach & Entrance**

<b>ADA Standard Reference:</b>	<b>208.2.4, 502.2, 502.3, 502.4, 502.6</b>	
<b>Estimated Cost:</b>	<b>\$2,227.41</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The existing parking requires several work items to be in compliance with the referenced sections. The existing asphalt surface is degraded and markings are faded (502.2, 502.3.3). An ADA sign is not provided (502.6). The slope of the provided parking exceeds 1:48 and is unstable (502.4). An estimate has been developed to remove and replace the degraded asphalt surface, provide the required pavement markings for the accessible space and access aisle, and to provide a new sign and post. New access aisles should be painted with blue paint and include text that indicates "NO PARKING".		

<b>ADA Standard Reference:</b>	<b>405.8</b>	
<b>Estimated Cost:</b>	<b>\$3,039.60</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The accessible route has a sloped side walk or ramp that has a rise greater than 6" and requires that handrails be installed on both sides of the ramp. An estimate has been developed for the installation of the handrails.		

**Access to Goods & Services**

Accessibility barriers were not identified for this category.

**Toilet Rooms**


Accessibility barriers were not identified for this category.

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**


**Asset/Location: Government Center/Radio and Fleet Shop, Las Cruces, NM**


<b>Assessors</b> Michael Black		
<b>Inspection Date</b> November 2015		
<b>Department</b> Facilities	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$2,351.24</b>	
<b>Priority 2:</b>	<b>\$4,941.56</b>	
<b>Priority 3:</b>	<b>\$9,239.57</b>	
<b>Priority 4:</b>	<b>\$0.00</b>	


**General Information**

The Government Center, located at 845 N. Motel Boulevard, Las Cruces, NM, was built in 2006. It is a two-story building consisting of 152,680 SQFT.


**Approach & Entrance**

<b>ADA Standard Reference:</b>	<b>208.2, 208.2.4, 502.6</b>	
<b>Estimated Cost:</b>	<b>\$1,069.85</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The main East parking lot has 20 accessible parking; 1 which is "van accessible". An estimate has been developed to install 4 "van accessible" signs at 4 of the accessible spaces to create a total of 5 "van accessible" spaces.		

<b>ADA Standard Reference:</b>	<b>208.2, 208.2.4, 502.6</b>	
<b>Estimated Cost:</b>	<b>\$855.88</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The West employee parking lot has 8 accessible parking spaces. There are also 4 accessible parking spaces inside the fenced County Vehicle parking lot on the West side of the building that are not accessible to the public. There are no "van accessible" spaces identified in the West parking lot. The existing striping has 4 spaces that could be "van accessible" parking. An estimate has been developed for the installation of new signs on 4 of the accessible spaces to designate "van accessibility".		

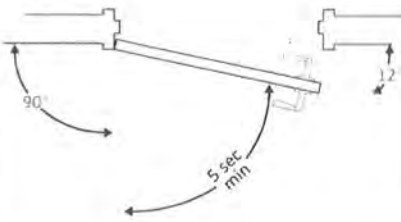
<b>ADA Standard Reference:</b>	<b>404.2.8</b>	
<b>Estimated Cost:</b>	<b>\$639.48</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> Most of the entry doors close in less than 5 seconds; 2 of the entry doors have auto openers. An estimate has been developed to adjust 6 door closers.		


**Access to Goods & Services**


<b>ADA Standard Reference:</b>	<b>405.8, 505.4, 505.10.1</b>	
<b>Estimated Cost:</b>	<b>\$4,941.56</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The ramp to the Commissioners raised platform has a single handrail that is 42" AFF and the ramp to the Commissioners break room and restrooms do not have rails. An estimate has been developed to install 68 L.F. of compliant rails to both sides of both ramps.		




## Toilet Rooms

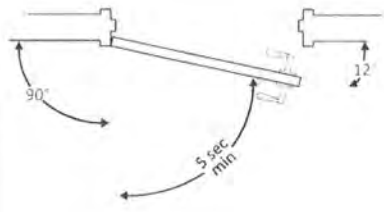
<b>ADA Standard Reference:</b>	<b>404.2.8.1, 404.2.9</b>	
<b>Estimated Cost:</b>	<b>\$3,623.72</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>All of the restroom doors close in less than 5 seconds. An estimate has been developed to adjust 34 door closers.</p>		

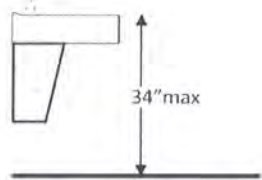
<b>ADA Standard Reference:</b>	<b>606.3</b>	
<b>Estimated Cost:</b>	<b>\$525.06</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>Both of the South restrooms on the second floor and the Finance Office Women's restroom lavatories measure above the maximum mounting height. An estimate has been developed to adjust the lavatories.</p>		


<b>ADA Standard Reference:</b>	<b>606.5</b>	
<b>Estimated Cost:</b>	<b>\$35.28</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The drain is covered, but the pipes are exposed in the DA's West Men's restroom. An estimate has been developed to install ADA type insulation to the exposed pipes to protect against contact.</p>		

<b>ADA Standard Reference:</b>	<b>308.2.2</b>	
<b>Estimated Cost:</b>	<b>\$865.84</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The first and second floor restrooms soap dispensers are mounted above the maximum allowable height required by this section. An estimate has been developed to adjust the dispensers mounting height.</p>		



<b>ADA Standard Reference:</b>	<b>604.2</b>	
<b>Estimated Cost:</b>	<b>\$2,114.55</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> Most of the toilets are located 1/2" to 1" too far from the side wall or partition. An estimate has been developed to adjust 9 water closets that are no less than 16" and no greater than 18" from the side wall or partition.		

<b>ADA Standard Reference:</b>	<b>604.5.1, 604.5.2</b>	
<b>Estimated Cost:</b>	<b>\$350.16</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The grab bars at the East DA's Men's and Women's restroom require replacement and adjustment as follows: The rear wall grab bar in the Men's and Women's restroom requires horizontal adjustment. The side wall grab bar in the Women's restroom requires replacement with an appropriate 42" bar. An estimate has been developed for the listed items.		


<b>ADA Standard Reference:</b>	<b>604.8.1.2</b>	
<b>Estimated Cost:</b>	<b>\$1,724.96</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The following restrooms require that the accessible toilet partition doors be adjusted to achieve self-closing (restrooms 1-138, 1-139, 1-108, 1-109, 2-116, 2-117, 2-331, and 2-329). An estimate had been developed to adjust the partition doors.		

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**


**Asset/Location: Judicial Complex, Las Cruces, NM**


<b>Assessors</b> Michael Black		
<b>Inspection Date</b> October 2015		
<b>Department</b> Facilities	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$5,219.99</b>	
<b>Priority 2:</b>	<b>\$9,406.65</b>	
<b>Priority 3:</b>	<b>\$2,962.50</b>	
<b>Priority 4:</b>	<b>\$0.00</b>	


**General Information**

The Judicial Complex, located at 808 N. Alameda Boulevard, Las Cruces, NM, was built in 1927. The Court has jurisdiction over criminal cases, domestic relations, probate cases, children's court and all general civil cases. There are eight District Court Judges, one Child Support Hearing Officer and one part-time Domestic Violence Special Commissioner, who hear cases at this facility.


**Approach & Entrance**

<b>ADA Standard Reference:</b>	<b>208.2.4</b>	
<b>Estimated Cost:</b>	<b>\$137.34</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The existing parking lot has 2 "van accessible" spaces, but they are not identified. An estimate has been developed for the installation of 2 "van accessible" signs for identification purposes.		


<b>ADA Standard Reference:</b>	<b>502.2, 502.3</b>	
<b>Estimated Cost:</b>	<b>\$452.16</b>	
<b>Priority Level:</b>	<b>High</b>	
<b>Barrier Description/Proposed Solution:</b> On the north side of the lot there are 3 handicap spaces that do not have access aisles. For this estimate, it is suggested that 2 access aisles measuring 144 S.F. each (288 S.F. Total) be painted. However, reconfiguration of the existing accessible spaces to add an access aisle would decrease the total number of spaces provided. Access aisles should be painted with blue paint and include text that indicates "NO PARKING". Architectural design will be required.		


<b>ADA Standard Reference:</b>	<b>302.1</b>	
<b>Estimated Cost:</b>	<b>\$1,667.20</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The existing concrete is spalling and the surface is covered with loose material. ADA Standards require that the route be stable, firm and slip-resistant. An estimate has been developed to resurface 160 S.F. of concrete. This estimate includes the concrete scarifying and the concrete topping.		




<b>ADA Standard Reference:</b>	<b>502.3</b>	
<b>Estimated Cost:</b>	<b>\$2,963.29</b>	
<b>Priority Level:</b>	<b>High</b>	
<b>Barrier Description/Proposed Solution:</b> All of the existing access aisles end in 6" curb. Curb ramps are only accessible by traveling across vehicular traffic. ADA Standards require that access aisles adjoin with an accessible route. An estimate has been developed for the construction of 2 curb ramps at the existing access aisles. The estimate includes demolition where the curb and access aisle meet and the construction of a new curb ramp with tactile warning tiles.		

**Access to Goods & Services**

<b>ADA Standard Reference:</b>	<b>405.8</b>	
<b>Estimated Cost:</b>	<b>\$281.80</b>	
<b>Priority Level:</b>	<b>High</b>	
<b>Barrier Description/Proposed Solution:</b> The existing ramp to the Clerk's Office measures more than 6" and does not have handrails. ADA Standards require that if a ramp has a rise higher than 6", there must be handrails on both sides. For this estimate, it is suggested that 2 handrails be placed on each side of the ramp for an estimated 20 L.F.		

<b>ADA Standard Reference:</b>	<b>407.4.7.1, 703.2</b>	
<b>Estimated Cost:</b>	<b>\$ 116.08</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The existing LULA elevator has control buttons without Braille. ADA Standards require that car control buttons be designed with Braille. An estimate has been developed for the installation of control buttons with Braille.		

<b>ADA Standard Reference:</b>	<b>407.2.3, 408.2.3</b>	
<b>Estimated Cost:</b>	<b>\$94.64</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The existing LULA elevator does not have a star on the first-floor sign. ADA Standards require that there is a sign on both door jambs on every floor identifying the floor. An estimate has been developed for the installation of 2 new tactile text with Braille signs that include stars.		



<b>ADA Standard Reference:</b>	702.3, 703.2
<b>Estimated Cost:</b>	\$187.28
<b>Priority Level:</b>	Medium
<b>Barrier Description/Proposed Solution:</b> New room signs are required to comply with the referenced sections. ADA Standards require that text characters contrast with the background and that there is Braille. An estimate has been developed to remove and replace existing room signs with new tactile text and Braille signs that are mounted at the appropriate mounting location.	



<b>ADA Standard Reference:</b>	404.2.9
<b>Estimated Cost:</b>	\$657.65
<b>Priority Level:</b>	High
<b>Barrier Description/Proposed Solution:</b> Several of the existing doors take a considerable amount of effort to open (more than 5 lbs of force). An estimate has been developed to adjust 35 door closers.	





<b>ADA Standard Reference:</b>	221.2.1
<b>Estimated Cost:</b>	\$1,435.20
<b>Priority Level:</b>	Low
<b>Barrier Description/Proposed Solution:</b> The Judicial Complex has 8 courtrooms and 2 hearing rooms that have a seating capacity of approximately 46-150 spectators. All of the rooms have wooden benches for seating and all have open spaces to accommodate for wheelchairs. However, none of the spaces are identified as accessible seating. ADA Standards require that there are an adequate number of wheelchair spaces provided. An estimate has been developed to install signs where the accessible seating is located. This estimate includes the installation of 3 ADA signs in each of the 8 courtrooms and 2 hearing rooms, totaling to 30 new signs.	





**Toilet Rooms**

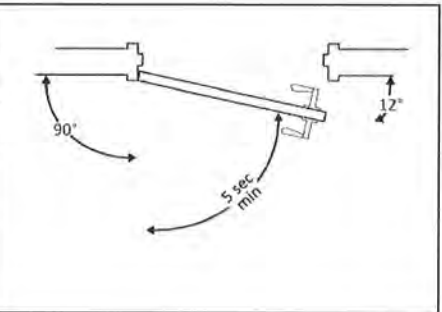
<b>ADA Standard Reference:</b>	404.2.6, 404.2.9
<b>Estimated Cost:</b>	\$1,083.50
<b>Priority Level:</b>	Medium
<b>Barrier Description/Proposed Solution:</b> 10 of the buildings existing doors take a considerable amount of effort to open (more than 5 lbs of force) and close in less than 5 seconds. An estimate has been developed to adjust the door closers of 10 doors.	

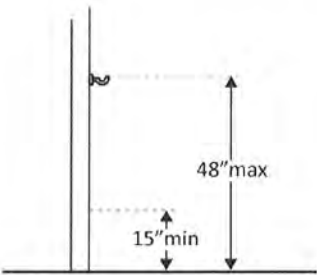

<b>ADA Standard Reference:</b>	<b>603.4</b>	
<b>Estimated Cost:</b>	<b>\$336.96</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing coat hooks in the accessible stalls measure between 55"-56". ADA Standards require that if there is a coat hook, it is no less than 15" and no greater than 48" AFF. An estimate has been developed to install additional coat hooks in the accessible stalls at the appropriate mounting height.</p>		

<b>ADA Standard Reference:</b>	<b>604.4</b>	
<b>Estimated Cost:</b>	<b>\$714.23</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>Several of the existing toilets have raised seats that are above the maximum allowable height. ADA Standards require that the height of the water closet be no less than 17" and no greater than 19" AFF. An estimate has been developed to remove and replace the existing seats with standard seats.</p>		

<b>ADA Standard Reference:</b>	<b>604.5.2, 609.3</b>	
<b>Estimated Cost:</b>	<b>\$111.71</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The mounting heights of the grab bars, both side and rear, in Rooms 105, 253 and 257 do not comply with the requirements of this section. An estimate has been developed for the adjustment and addition of grab bars as needed.</p>		


<b>ADA Standard Reference:</b>	<b>604.8.1.2</b>	
<b>Estimated Cost:</b>	<b>\$716.10</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing restrooms are not self-closing. An estimate has been developed to adjust the doors to achieve self-closing.</p>		

**Additional Access**

Accessibility barriers were not identified for this category.




State of New Mexico, Doña Ana County  
 Asset/Location: Juvenile Detention Center, Las Cruces, NM


<b>Assessors</b> Michael Black		
<b>Inspection Date</b> October 2015		
<b>Department</b> Facilities	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	\$5,111.38	
<b>Priority 2:</b>	\$836.29	
<b>Priority 3:</b>	\$1,268.76	
<b>Priority 4:</b>	\$0.00	

**General Information**

The Juvenile Detention Center, located at 1850 Cooper Loop, Las Cruces, NM, was built in 2001, with a new roof installed in 2011. This 23,525 SQFT building does not currently house inmates, but does house a small administrative staff, and serves as a training facility for new cadets.


**Approach & Entrance**


<b>ADA Standard Reference:</b>	302.1, 502.3, 502.6,	
<b>Estimated Cost:</b>	\$4,971.38	
<b>Priority Level:</b>	Medium	
<b>Barrier Description/Proposed Solution:</b>  The existing location of the accessible parking is compliant and at the closest location to the building entrance. However, the accessible aisle does not adjoin an accessible route to the curb ramp provided. Individuals would have to travel behind vehicles and through traffic to get to the curb ramp. It is recommended that the 2 accessible spaces and the access aisle be relocated to the parking area just North of the roundabout drop off area and a new curb ramp installed. The access aisle should be painted with blue paint and include text that indicates "NO PARKING". The existing accessible parking would then be converted to standard spaces. An estimate has been developed for the following work items.		


<b>ADA Standard Reference:</b>	302.1	
<b>Estimated Cost:</b>	\$140.00	
<b>Priority Level:</b>	Low	
<b>Barrier Description/Proposed Solution:</b>  The concrete sidewalk at the accessible route has settled and heaved at joints creating up to 1" tripping hazards. It is recommended that the raised edges of the concrete along the route be ground down and smoothed. An estimate has been provided for the work items listed.		




**Access to Goods & Services**


<b>ADA Standard Reference:</b>	<b>307.2</b>	
<b>Estimated Cost:</b>	<b>\$299.47</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The fire extinguisher adjacent to the restrooms protrudes 8" into the circulation path. An estimate has been developed for the installation of a new fire extinguisher cabinet.</p>		


<b>ADA Standard Reference:</b>	<b>703.3</b>	
<b>Estimated Cost:</b>	<b>\$211.77</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>3 room signs are mounted above the doors and do not include Braille. An estimate has been developed for the installation of 3 new room tactile text with Braille signs.</p>		


<b>ADA Standard Reference:</b>	<b>404.2.9</b>	
<b>Estimated Cost:</b>	<b>\$325.05</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>Interior doors at the Classroom, Medical and Multipurpose rooms take considerable amount of effort to open (more than 5 pounds of force) An estimate has been developed for the adjustment of the door closers.</p>		

**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>404.2.9</b>	
<b>Estimated Cost:</b>	<b>\$216.70</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The doors to the Public restrooms take a considerable amount of effort to open (more than 5 pounds of force). An estimate has been developed for the adjustment of the door closers.</p>		

<b>ADA Standard Reference:</b>	<b>604.8.1.2</b>	
<b>Estimated Cost:</b>	<b>\$576.10</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing accessible stalls in the public restrooms do not have self-closing doors or internal door pulls. An estimate has been developed for the adjustment of the partition doors.</p>		

<b>ADA Standard Reference:</b>	<b>308.2, 603.4</b>	
<b>Estimated Cost:</b>	<b>\$140.83</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The Men's restroom requires minor work items to be in compliance with ADA Standards. The existing coat hook has been torn off and requires replacement. The existing paper towel dispenser requires vertical adjustment. An estimate has been developed for the work items listed.</p>		


<b>ADA Standard Reference:</b>	<b>308.2.2, 308.2, 604.7</b>	
<b>Estimated Cost:</b>	<b>\$335.13</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The Women's restroom requires minor work items to be in compliance with ADA Standards. The soap dispenser, paper towel dispenser and toilet paper dispenser require mounting adjustment. (308.2.2, 308.2, 604.7). An estimate has been developed for the work items listed.</p>		

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**


**Asset/Location: La Mesa Community Center, Las Cruces, NM**

<b>Assessors</b>		
Antonio Florencio Ortega		
<b>Inspection Date</b>		
October 2015		
<b>Department</b>	<b>Asset Type</b>	
Facilities	Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	\$213.97	
<b>Priority 2:</b>	\$213.16	
<b>Priority 3:</b>	\$701.40	
<b>Priority 4:</b>	\$0.00	


### General Information

The La Mesa Community Center, located at 744 San Jose, Las Cruces, NM, was built in 2008. The Center provides programs that meet community needs, enhance the quality of life and promote community involvement. This single-story building consists of 1,600 SQFT and has a kitchen, bathrooms, meeting rooms, office space and multi-purpose rooms.


### Approach & Entrance

<b>ADA Standard Reference:</b>	<b>208.2.4, 502.6</b>	
<b>Estimated Cost:</b>	<b>\$213.97</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The existing parking lot provides for 2 accessible parking spaces. The spaces are large enough to be "van accessible"; however, existing signs do not designate as such. An estimate had been developed to remove 1 of the accessible parking signs and install a "van accessible" sign.		

### Access to Goods & Services

<b>ADA Standard Reference:</b>	<b>404.2.9</b>	
<b>Estimated Cost:</b>	<b>\$213.16</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The 2 doors to the classroom take a considerable amount of effort to open (more than 5 lbs of force). An estimate has been developed to adjust the door closers.		

### Toilet Rooms

<b>ADA Standard Reference:</b>	<b>703.4.2, 306.3.3, 604.8.1.2</b>	
<b>Estimated Cost:</b>	<b>\$701.40</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> Multiple work items in the existing Men's and Women's restroom are required for compliance with the referenced sections. The existing room signs require relocation to the latch side of the door (703.4.2). The accessible stall partition doors require adjustment to achieve self-closing (604.8.1.2). An estimate has been developed for the work items listed.		

### Additional Access

Accessibility barriers were not identified for this category.




**State of New Mexico, Doña Ana County**  
**Asset/Location: Concession Stand and Restroom, La Mesa, NM**

<b>Assessors</b> Javier Ortega		
<b>Inspection Date</b> October 2015		
<b>Department</b> Facilities	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	\$4,092.87	
<b>Priority 2:</b>	\$0.00	
<b>Priority 3:</b>	\$5,556.92	
<b>Priority 4:</b>	\$0.00	

**General Information**

The Concession Stand and Restroom at the La Mesa Ballpark, located at 300 Principal Street, La Mesa, NM, was built in 1975 and consists of 2,250 SQFT.


**Approach & Entrance**


<b>ADA Standard Reference:</b>	206.2.1	
<b>Estimated Cost:</b>	\$4,092.87	
<b>Priority Level:</b>	High	
<b>Barrier Description/Proposed Solution:</b> The existing ball park does not currently provide dedicated parking or handicap accessible spaces. An estimate has been developed for the installation of a new 24'x22' concrete pad with appropriate pavement markings, including handicap signs and wheel stops. New access aisles should be painted with blue paint and include text that indicates "NO PARKING". The estimate includes an Architectural and Engineering fee.		


**Access to Goods & Services**


Accessibility barriers were not identified for this category.


**Toilet Rooms**

<b>ADA Standard Reference:</b>	703	
<b>Estimated Cost:</b>	\$135.84	
<b>Priority Level:</b>	Low	
<b>Barrier Description/Proposed Solution:</b> The existing restrooms do not have compliant signs. An estimate has been developed to install 2 new tactile text with Braille signs.		


<b>ADA Standard Reference:</b>	<b>404.2.4</b>	
<b>Estimated Cost:</b>	<b>\$334.31</b>	
<b>Priority Level:</b>	<b>High</b>	
<b>Barrier Description/Proposed Solution:</b> The existing restrooms have a 2" step up at the entry doors. An estimate has been developed to remove the existing slab and replace it with a 5'-0" x 5'-0" new slab that is flush with the restroom floor elevation.		

<b>ADA Standard Reference:</b>	<b>404.2.4,404.2.7</b>	
<b>Estimated Cost:</b>	<b>\$1,160.90</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The door swings to both restrooms do not provide adequate maneuvering clearance beyond the latch side of the door on the inside. The doors should be removed and replaced with the door swings reversed. The new doors should be installed with ADA compliant locksets. An estimate has been developed for the items listed.		

<b>ADA Standard Reference:</b>	<b>606.4</b>	
<b>Estimated Cost:</b>	<b>\$1,100.52</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The existing restroom lavatories require the faucets be replaced with ADA compliant fixtures and the pipes be insulated to protect against contact. An estimate has been developed for the items listed.		

<b>ADA Standard Reference:</b>	<b>308.2</b>	
<b>Estimated Cost:</b>	<b>\$216.46</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The paper towel dispensers in the existing restrooms require relocation to the appropriate mounting height. An estimate has been developed for the item noted.		



<b>ADA Standard Reference:</b>	<b>308.2, 604.2, 604.5.1, 604.5.2, 609.4</b>	
<b>Estimated Cost:</b>	<b>\$2,608.89</b>	
<b>Priority Level:</b>	<b>High</b>	
<b>Barrier Description/Proposed Solution:</b> The existing restrooms require several work items to be in compliance with the referenced sections. The existing toilet paper dispensers require adjustment to the required mounting height-(604.7). Sidewall and rear wall grabs bars require installation in both restrooms (604.5.1, 604.5.2). In the Women's restroom the water closet mounting location requires adjustment to the appropriate distance from the side wall (604.2). In the Men's restroom the existing urinal needs to be removed and the water closet relocated to side wall (609.4). An estimate has been developed for the work items listed.		

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**


**Asset/Location: La Pinon Office, Las Cruces, NM**

<b>Assessors</b> Michael Black		
<b>Inspection Date</b> November 2015		
<b>Department</b> Facilities	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$5,217.05</b>	
<b>Priority 2:</b>	<b>\$1,796.97</b>	
<b>Priority 3:</b>	<b>\$808.51</b>	
<b>Priority 4:</b>	<b>\$0.00</b>	


**General Information**


The La Pinon Office, located at 525 Melendres, Las Cruces, NM, was built in 1980. It is a single-story building consisting of 2,400 SQFT. This office provides comprehensive sexual assault recovery services for sexual abuse victims and their families.

**Approach & Entrance**


<b>ADA Standard Reference:</b>	<b>208.2.4, 302.1, 502.3</b>	
<b>Estimated Cost:</b>	<b>\$2,981.57</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The existing parking lot provides an accessible parking space and access aisle. However, the location of the parking is not at the nearest location to the entry and the access aisle does not adjoin to the accessible route. The accessible route is 1"-2" higher than the asphalt paving. It is recommended that the accessible spaces be relocated, so that the access aisle aligns with the entry and that a new concrete pad be installed so the parking is flush with the existing sidewalk. The access aisles should be painted with blue paint and include text that indicates "NO PARKING". An estimate has been developed for the work items listed.		




<b>ADA Standard Reference:</b>	<b>405.8, 405.9.1, 505.3, 505.10.1</b>	
<b>Estimated Cost:</b>	<b>\$1,950.87</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing handrail does not comply with the requirements of the referenced sections. There is only railing on 1 side of the ramp and requires railing on both sides (405.8). The railing does not provide an unobstructed gripping surface (505.3). The rail does not extend at least 12" beyond the bottom of the ramp (505.10.1). Edge protection is not provided (405.9.1). An estimate has been developed for the removal and replacement of the railing.</p>		

<b>ADA Standard Reference:</b>	<b>216.6</b>	
<b>Estimated Cost:</b>	<b>\$284.61</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>This facility has 3 entry doors; 1 of which is the Public accessible entry. Directional signs require installation at the inaccessible entries indicating the direction of the accessible entry. The sign at the accessible entry should have the International Symbol of Accessibility. An estimate has been developed for the installation of 3 new tactile text with Braille signs.</p>		

**Access to Goods & Services**

<b>ADA Standard Reference:</b>	<b>404.2.4</b>	
<b>Estimated Cost:</b>	<b>\$738.16</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The front approach to the entry door does not allow at least 24" on the latch side of the door to the start of the ramp. In lieu of reconfiguring the ramp, an automatic door opener should be installed. An estimate has been developed for the installation of a new door opener.</p>		

<b>ADA Standard Reference:</b>	<b>404.2.4</b>	
<b>Estimated Cost:</b>	<b>\$125.51</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The hallway has a security door that only provides 5" of maneuvering clearance on the latch side of the door. During business hours the door is held open. The nature of the building's use may require that the door remain, but that a sign be posted that it remain open during business hours. The permanent solution to this obstruction is to remove the door completely. An estimate has been developed for the removal of the door.</p>		

<b>ADA Standard Reference:</b>	<b>404.2.7</b>	
<b>Estimated Cost:</b>	<b>\$933.30</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>All existing interior doors have knob type lock sets installed. An estimate has been developed for the removal and replacement of the knob type locksets to lever type locksets.</p>		

**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>216.8</b>	
<b>Estimated Cost:</b>	<b>\$211.77</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>This facility has 1 unisex accessible restroom and 1 unisex inaccessible restroom. Currently signs are not installed indicating accessible versus inaccessible. An estimate has been developed for the installation of 3 new tactile text with Braille signs; 2 at each restrooms and 1 that indicates the direction of the accessible restroom.</p>		

<b>ADA Standard Reference:</b>	<b>404.2.7</b>	
<b>Estimated Cost:</b>	<b>\$373.32</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing restroom doors have knob type locksets installed. An estimate has been developed for the removal and replacement of the knob type locksets with lever type locksets.</p>		

<b>ADA Standard Reference:</b>	<b>308.2, 604.5.1</b>	
<b>Estimated Cost:</b>	<b>\$223.42</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The unisex accessible restroom requires minor work items to be in compliance with the referenced sections. The paper towel dispenser requires vertical adjustment and the side wall grab bar requires horizontal adjustment. An estimate has been developed for the work items listed.</p>		

**Additional Access**

Accessibility barrier were not identified for this category.




**State of New Mexico, Doña Ana County**  
**Asset/Location: Maintenance Shop, Las Cruces, NM**


<b>Assessors</b> Javier Ortega		
<b>Inspection Date</b> October 2015		
<b>Department</b> Facilities	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	\$3,446.56	
<b>Priority 2:</b>	\$0.00	
<b>Priority 3:</b>	\$3,263.95	
<b>Priority 4:</b>	\$3,284.71	

**General Information**

The Maintenance Shop, located at 2025 E. Griggs, Las Cruces, NM, was built in 1976. It is a single-story building consisting of 9,212 SQFT.

**Approach & Entrance**

<b>ADA Standard Reference:</b>	208.2.4, 302.1, 406.1, 502.2, 502.6,	
<b>Estimated Cost:</b>	\$3,053.60	
<b>Priority Level:</b>	Medium	
<b>Barrier Description/Proposed Solution:</b> The existing parking lot currently provides 16 total standard spaces with 1 accessible space. The existing pavement markings are faded and do not clearly indicate the spaces and access aisle. The ADA sign is not mounted at the appropriate height nor does it indicate the space as "van accessible" (502.2, 502.6). The slope and transition of the asphalt to the concrete curb ramp is uneven (302.1). The existing curb ramp exceeds the maximum slope (406.1). An estimate has been developed to remove and replace the existing asphalt with a new concrete pad. New pavement markings should account for an 8' space and 5' access aisle that with blue paint indicates "NO PARKING". New ADA signs should be put up and a new curb ramp installed.		

<b>ADA Standard Reference:</b>	216.6	
<b>Estimated Cost:</b>	\$284.61	
<b>Priority Level:</b>	Low	
<b>Barrier Description/Proposed Solution:</b> Signs indicating the direction of the nearest ADA accessible entrance need to be installed on the Southwest corner of the building. A sign also needs to be installed at the South side accessible entrance with the International Symbol of Accessibility. An estimate has been developed for the installation of 3 new tactile text with Braille signs.		



<b>ADA Standard Reference:</b>	<b>404.2.8</b>	
<b>Estimated Cost:</b>	<b>\$108.35</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing entry door closes in less than 5 seconds. An estimate has been developed for the adjustment of the door closer.</p>		


**Access to Goods & Services**

Accessibility barriers were not identified for this category.


**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>308.2, 404.2.7, 404.2.8.1, 404.2.9, 604.5.1, 604.5.2, 604.6, 606.4, 606.5, 703.5</b>	
<b>Estimated Cost:</b>	<b>\$1,662.05</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The West Women's restroom requires several work items to be in compliance with ADA Standards. A tactile room sign with Braille needs to be installed (703.5). The door requires maintenance, a new lever type lock set, and the closer requires adjustment (404.2.7, 404.2.8.1, 404.2.9). The lavatory requires that the faucet be replaced and that pipe insulation be installed (606.4, 606.5). The paper towel dispenser requires vertical adjustment (308.2). The side wall grab bar requires horizontal adjustment (604.5.1). The rear grab bar requires replacement with the appropriate 36" bar (604.5.2). The water closet flush controls require relocation to the open side of the unit (604.6). An estimate has been developed for the items listed.</p>		


<b>ADA Standard Reference:</b>	<b>308.2, 404.2.7, 404.2.8.1, 404.2.9, 604.5.1, 604.5.2, 606.4, 606.5, 703.5</b>	
<b>Estimated Cost:</b>	<b>\$1,422.96</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The West Men's restroom requires several work items to be in compliance with ADA Standards. A tactile room sign with Braille needs to be installed (703.5). The door requires maintenance, a new lever type lock set, and the closer requires adjustment (404.2.7, 404.2.8.1, 404.2.9). The lavatory requires that the faucet be replaced and that pipe insulation be installed (606.4, 606.5). The paper towel dispenser requires vertical adjustment (308.2). The side wall grab bar requires horizontal adjustment (604.5.1). The rear grab bar requires replacement with the appropriate 36" bar (604.5.2). An estimate has been developed for the items listed.</p>		

<b>ADA Standard Reference:</b>	404.2.8.1, 703.4.1	
<b>Estimated Cost:</b>	\$178.94	
<b>Priority Level:</b>	Low	
<b>Barrier Description/Proposed Solution:</b>		
<p>The East unisex restroom requires minor work items for compliance with the referenced sections. The existing tactile room sign requires relocation. The door closes in less than 5 seconds and requires closer adjustment. An estimate has been developed for the items listed.</p>		

**Additional Access**

<b>ADA Standard Reference:</b>	602.2	
<b>Estimated Cost:</b>	\$3,284.71	
<b>Priority Level:</b>	Medium	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing drinking fountain provided does not comply with the requirements of the referenced section. An estimate has been developed for the installation of a new compliant drinking fountain.</p>		

**State of New Mexico, Doña Ana County  
Asset/Location: Mesquite Community Center, Mesquite, NM**

<b>Assessors</b> Antonio Florencio Ortega		
<b>Inspection Date</b> October 2015		
<b>Department</b> Facilities	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	\$983.12	
<b>Priority 2:</b>	\$0.00	
<b>Priority 3:</b>	\$734.30	
<b>Priority 4:</b>	\$0.00	

**General Information**

The Mesquite Community Center, located at 12720 Highway 478, Mesquite, NM, was built in 1970. It is a single-story building consisting of 3,303 SQFT. The Center provides programs that meet community needs, enhance the quality of life and promote community involvement.



**Approach & Entrance**

<b>ADA Standard Reference:</b>	<b>502.6</b>
<b>Estimated Cost:</b>	<b>\$923.84</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
<p>The existing accessible parking requires reconfiguration to comply with the requirements of the referenced sections. Work items to include: removal of 2 existing noncompliant signs and replacement with new ADA parking signs with post.</p>	



<b>ADA Standard Reference:</b>	<b>216.6</b>
<b>Estimated Cost:</b>	<b>\$59.28</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
<p>The existing inaccessible entrance does not have a sign indicating the location of the nearest accessible entrance. An estimate had been developed to install a directional sign at the inaccessible entrance.</p>	



**Access to Goods & Services**


Accessibility barriers were not identified for this category.

**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>216.8, 703</b>
<b>Estimated Cost:</b>	<b>\$251.84</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
<p>This facility has 2 restrooms; 1 is accessible. A directional sign indicating the location of the accessible restroom should be installed at the inaccessible restroom. 2 room signs with tactile text and Braille require installation. An estimate has been developed for the work items listed.</p>	



<b>ADA Standard Reference:</b>	<b>404.2.4</b>
<b>Estimated Cost:</b>	<b>\$230.72</b>
<b>Priority Level:</b>	<b>Medium</b>
<b>Barrier Description/Proposed Solution:</b>	
<p>1 of the restrooms has a front approach to the pull side of the door that is 7.5". An estimate has been developed to reverse the door swing to get proper maneuvering clearance.</p>	

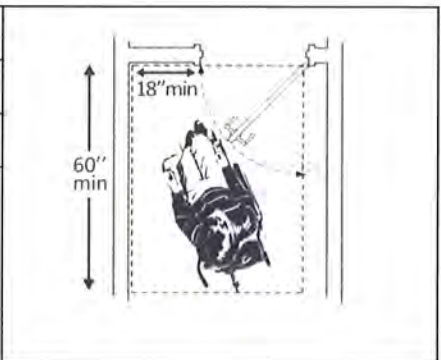



<b>ADA Standard Reference:</b>	<b>308.2, 604.5.1, 606.5</b>	
<b>Estimated Cost:</b>	<b>251.74</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>Several work items in the existing accessible restroom are required for compliance with the referenced sections. The existing lavatory requires that pipe insulation be installed to protect against contact (606.5). The existing soap dispenser requires vertical adjustment (308.2.2). The existing sidewall grab bar requires a horizontal adjustment (604.5.1). An estimate has been developed for the work items listed.</p>		

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County  
Asset/Location: Concession and Restroom, Mesquite, NM**


<b>Assessors</b> Antonio Florencio Ortega		
<b>Inspection Date</b> October 2015		
<b>Department</b> Facilities	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$4,933.47</b>	
<b>Priority 2:</b>	<b>\$0.00</b>	
<b>Priority 3:</b>	<b>\$13,374.89</b>	
<b>Priority 4:</b>	<b>\$3,562.16</b>	

**General Information**

The Concession and Restrooms building at the Mesquite Ball Park, located at 215 Highway 228, Mesquite, NM, was built in 1980 and consists of 256 SQFT.

**Approach & Entrance**


<b>ADA Standard Reference:</b>	<b>206.2.1</b>	
<b>Estimated Cost:</b>	<b>\$4,781.49</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing accessible parking at the Northeast corner of the park requires reconfiguration to comply with the requirements of the referenced sections. Work items to include: removal and replacement of the existing concrete pad, re-striping, and installation of 2 new ADA parking signs. The access aisle should be painted with blue paint and include text that indicates "NO PARKING".</p>		


<b>ADA Standard Reference:</b>	<b>302.1</b>	
<b>Estimated Cost:</b>	<b>\$151.98</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing utility box cover outside the door of the restroom is not flush with the concrete. An estimate has been developed to remove and replace the utility box.</p>		


**Access to Goods & Services**

Accessibility barriers were not identified for this category.

**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>404.2.4</b>	
<b>Estimated Cost:</b>	<b>\$1,174.48</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing doors require removal and replacement with a new door assembly, including all required hardware. The door swings should be reversed to provide maneuvering clearances. An estimate has been developed for the items listed.</p>		

<b>ADA Standard Reference:</b>	<b>703</b>	
<b>Estimated Cost:</b>	<b>\$227.14</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>2 room signs are required at the existing restrooms. An estimate has been developed for the installation of 2 new tactile text with Braille signs.</p>		

<b>ADA Standard Reference:</b>	<b>606.5, 606.4, 308.2.2, 308.2, 604.5.1, 604.5.2</b>	
<b>Estimated Cost:</b>	<b>\$5,691.85</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The 2 restrooms do not provide accessibility. An estimate had been developed for a complete reconfiguration of the restrooms. Work items to include an entire removal of all restroom fixtures and accessories. The installation of all new ADA compliant plumbing, fixtures, and accessories. An estimate has been developed for the work items listed.</p>		



**Additional Access**

<b>ADA Standard Reference:</b>	<b>602.2, 602.5</b>
<b>Estimated Cost:</b>	<b>\$3,562.16</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
The existing drinking fountain does not meet ADA compliance. An estimate has been developed to remove and replace the drinking fountain.	



**State of New Mexico, Doña Ana County  
Asset/Location: Community Center, Organ, NM**

<b>Assessors</b> Michael Black	
<b>Inspection Date</b> November 2015	
<b>Department</b> Facilities	<b>Asset Type</b> Trailer
<b>ADA Checklist Summary Of Costs:</b>	
<b>Priority 1:</b>	<b>\$4,304.32</b>
<b>Priority 2:</b>	<b>\$0.00</b>
<b>Priority 3:</b>	<b>\$1,224.31</b>
<b>Priority 4:</b>	<b>\$0.00</b>



**General Information**

The Community Center, located at 5880 2<sup>nd</sup> Street, Organ, NM, was built in 2004. It is a single-story building consisting of 2,940 SQFT. The Center provides programs that meet community needs, enhance the quality of life and promote community involvement.

**Approach & Entrance**

<b>ADA Standard Reference:</b>	<b>208.3.1</b>
<b>Estimated Cost:</b>	<b>\$3,107.69</b>
<b>Priority Level:</b>	<b>Medium</b>
<b>Barrier Description/Proposed Solution:</b>	
The existing accessible parking requires reconfiguration to comply with the requirements of the referenced sections. At the existing ADA parking space both pavement markings and sign require removal. There is also gravel parking at the base of the access ramp where a new (18' x 22') concrete pad should be placed with appropriate pavement markings and ADA sign. The access aisle should be painted with blue paint and include text that indicates "NO PARKING". An estimate has been developed for the items listed.	






<b>ADA Standard Reference:</b>	<b>403.3</b>
<b>Estimated Cost:</b>	<b>\$1,090.05</b>
<b>Priority Level:</b>	<b>Medium</b>
<b>Barrier Description/Proposed Solution:</b>	
<p>The sidewalk to the access ramp is steep enough that it is classified as a ramp and needs to have handrails on both sides of the walk path. An estimate has been developed to install a handrail on the side of the ramp that does not have rails.</p>	



<b>ADA Standard Reference:</b>	<b>404.2.8</b>
<b>Estimated Cost:</b>	<b>\$106.58</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
<p>The existing entrance door closes in less than five seconds. An estimate has been developed to adjust the door closer.</p>	

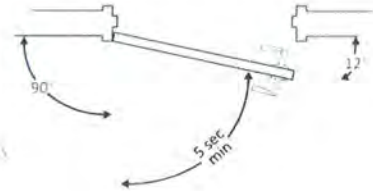

**Access to Goods & Services**

Accessibility barriers were not identified for this category.

**Toilet Rooms**


<b>ADA Standard Reference:</b>	<b>703</b>
<b>Estimated Cost:</b>	<b>\$135.84</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
<p>The existing restrooms require the installation of 2 new tactile text with Braille signs. An estimate has been developed for the item noted.</p>	



<b>ADA Standard Reference:</b>	<b>606.5, 606.4</b>
<b>Estimated Cost:</b>	<b>\$420.60</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
<p>The lavatories in both restrooms require that pipe insulation be installed to protect against contact. The faucets on both lavatories require hardware adjustment. An estimate has been developed for the work items listed.</p>	



<b>ADA Standard Reference:</b>	<b>604.5.1, 604.5.2, 604.6</b>
<b>Estimated Cost:</b>	<b>\$667.87</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
<p>Several work items in the existing accessible restrooms are required for compliance with the referenced sections. Both existing sidewall grab and rear wall grab bars require horizontal adjustment (604.5.1, 605.5.2). The flush control on the Men's water closet needs to be relocated to the open side of the unit (604.6). An estimate has been developed for the work items listed.</p>	

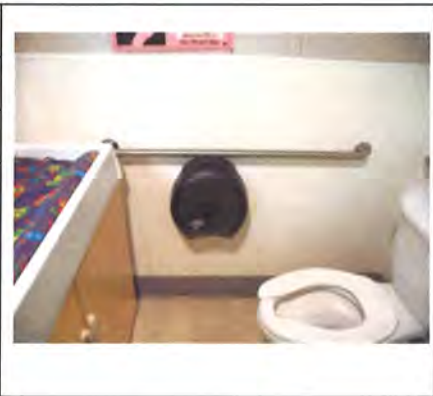

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County  
Asset/Location: Community Center, Placitas, NM**

<b>Assessors</b>	
Michael Black	
<b>Inspection Date</b>	
November 2015	
<b>Department</b>	<b>Asset Type</b>
Facilities	Building
<b>ADA Checklist Summary Of Costs:</b>	
<b>Priority 1:</b>	<b>\$404.34</b>
<b>Priority 2:</b>	<b>\$82.16</b>
<b>Priority 3:</b>	<b>\$2,077.41</b>
<b>Priority 4:</b>	<b>\$0.00</b>



**General Information**

The Community Center, located at 241 Monticello, Placitas, NM, was built in 1965. It is a single-story building consisting of 2,622 SQFT. The Center provides programs that meet community needs, enhance the quality of life and promote community involvement.

**Approach & Entrance**

<b>ADA Standard Reference:</b>	<b>502.6</b>
<b>Estimated Cost:</b>	<b>\$224.55</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
<p>The existing ADA sign is noncompliant. The sign is mounted below the required mounting height and does not indicate the space as "van accessible". An estimate has been developed for removal and replacement of the existing accessible sign.</p>	





<b>ADA Standard Reference:</b>	<b>404.2.7</b>
<b>Estimated Cost:</b>	<b>\$179.79</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
The existing entry door lock requires a pinch and twist action. An estimate has been developed to remove and replace the existing lockset with a new lockset	



**Access to Goods & Services**

<b>ADA Standard Reference:</b>	<b>404.2.4</b>
<b>Estimated Cost:</b>	<b>\$82.16</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
The door to the kitchen is set flush with the kitchen wall limiting latch side clearances to the activity room. An estimate has been developed to move the door out of the alcove to be flush with the activity room wall.	



**Toilet Rooms**


<b>ADA Standard Reference:</b>	<b>703.2</b>
<b>Estimated Cost:</b>	<b>\$135.84</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
The 2 existing restrooms require room signs with tactile text and Braille. An estimate has been developed for the item noted.	




<b>ADA Standard Reference:</b>	<b>404.2.3, 404.2.4</b>
<b>Estimated Cost:</b>	<b>\$986.68</b>
<b>Priority Level:</b>	<b>High</b>
<b>Barrier Description/Proposed Solution:</b>	
The 2 existing restroom doors are too narrow for wheelchair access. An estimate has been developed to remove the existing doors and prepare the openings for the installation of a new 32" wide minimum opening. The new doors should be installed with the swings reversed to provide adequate pull-side clearances and should be installed with the appropriate ADA hardware. An estimate has been developed for the work items noted. The estimate also includes an Architectural/Engineering fee for the alteration of the openings.	





<b>ADA Standard Reference:</b>	<b>308.2, 308.2.2, 606.5</b>	
<b>Estimated Cost:</b>	<b>\$287.02</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>Several work items in the existing accessible restrooms are required for compliance with the referenced sections. The lavatories require that pipe insulation be installed to protect against contact (606.5). The soap dispenser in the Women's restroom requires mounting adjustment (308.2.2). The towel dispenser in the Men's restroom requires mounting adjustment (308.2). An estimate has been developed for the items listed.</p>		


<b>ADA Standard Reference:</b>	<b>604.5.1, 604.5.2, 604.6</b>	
<b>Estimated Cost:</b>	<b>\$667.87</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>Several work items in the existing accessible restrooms are required for compliance with the referenced sections. The existing side wall and rear wall grab bars require horizontal adjustment (604.5.1, 604.5.2). The flush control on the Men's water closet requires relocation to the open side of the unit (604.6). An estimate has been developed for the work items listed.</p>		

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**


**Asset/Location: Public Health Building A West, Las Cruces, NM**


<b>Assessors</b>		
Michael Black		
<b>Inspection Date</b>		
October 2015		
<b>Department</b>	<b>Asset Type</b>	
Facilities	Trailer	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$4,130.79</b>	
<b>Priority 2:</b>	<b>\$0.00</b>	
<b>Priority 3:</b>	<b>\$908.75</b>	
<b>Priority 4:</b>	<b>\$0.00</b>	


**General Information**

The Public Health Building A West, located at 1850 A Copper Loop, Las Cruces, NM, was built in 1998. It is a single-story building consisting of 3,024 SQFT.

**Approach & Entrance**

<b>ADA Standard Reference:</b>	<b>502.2.2, 502.3</b>	
<b>Estimated Cost:</b>	<b>\$3,615.94</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The existing accessible parking requires reconfiguration to comply with the requirements of the referenced sections. Work items to include: construction of a new sidewalk with curb ramp, appropriate pavement markings, and new signs. The access aisle should be painted with blue paint and include text that indicates "NO PARKING".		


<b>ADA Standard Reference:</b>	<b>505.10.1</b>	
<b>Estimated Cost:</b>	<b>\$280.34</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The existing railing at the accessible walking ramp requires retrofit to the base of the rail that provides a barrier that prevents the passage of a 4" diameter sphere. An estimate has been developed for the item noted.		

<b>ADA Standard Reference:</b>	<b>404.2.5, 303.2</b>	
<b>Estimated Cost:</b>	<b>\$234.51</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The existing ramp at the entry is higher than the metal threshold at the entrance door. An estimate has been developed to install a threshold ramp.		


**Access to Goods & Services**


Accessibility barriers were not categorized for this category.

**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>216.8, 703.5, 703.2, 703.3, 703.4.2, 703.4.1</b>	
<b>Estimated Cost:</b>	<b>\$171.22</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> This facility has 3 restrooms; 2 which are accessible. A directional sign indicating the location of the accessible restrooms should be installed at the Employee restroom. 2 tactile signs need to be installed at the accessible restrooms indicating the Sign of International Accessibility. An estimate has been developed for installation of 3 new tactile text with Braille signs.		



<b>ADA Standard Reference:</b>	<b>308.2, 604.5.2, 606.5</b>	
<b>Estimated Cost:</b>	<b>\$251.29</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>Several work items in the existing Men's accessible restroom are required for compliance with the referenced sections. Pipe insulation requires installation to protect against contact (606.5). The paper towel dispenser requires vertical adjustment (308.2). The rear grab bar requires horizontal adjustment (604.5.2). An estimate has been developed for the work items listed.</p>		


<b>ADA Standard Reference:</b>	<b>308.2, 604.5.2, 604.6, 606.5</b>	
<b>Estimated Cost:</b>	<b>\$486.24</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>Several work items in the existing Women's accessible restroom are required for compliance with the referenced sections. Pipe insulation requires installation to protect against contact (606.5). The paper towel dispenser requires vertical adjustment (308.2). The rear grab bar requires horizontal adjustment (604.5.2). The flush control on the water closet requires relocation to the open side of the unit (604.6). An estimate has been developed for the work items listed.</p>		

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**

**Asset/Location: Public Health Building, Las Cruces, NM**


<b>Assessors</b>		
Michael Black		
<b>Inspection Date</b>		
November 2015		
<b>Department</b>	<b>Asset Type</b>	
Facilities	Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$10,624.81</b>	
<b>Priority 2:</b>	<b>\$50.42</b>	
<b>Priority 3:</b>	<b>\$8,642.99</b>	
<b>Priority 4:</b>	<b>\$0.00</b>	

**General Information**


The Public Health Building, located at 1170 N. Solano, Las Cruces, NM, was built in 1982. The building consists of 64,936 SQFT, and provides comprehensive primary care services for children and adults.




**Approach & Entrance**


<b>ADA Standard Reference:</b>	302.1, 502.2, 503.3	
<b>Estimated Cost:</b>	\$10,624.81	
<b>Priority Level:</b>	Low	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing accessible parking requires reconfiguration to comply with the requirements of the referenced sections. Work items to include: removal and replacement of the existing heaving asphalt and re-stripping pavement markings. The access aisles should be painted with blue paint and include text that indicates "NO PARKING".</p>		

**Access to Goods & Services**

<b>ADA Standard Reference:</b>	407.2.3, 408.2.3	
<b>Estimated Cost:</b>	\$50.42	
<b>Priority Level:</b>	Low	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing elevator does not have a tactile star on the first-floor sign. An estimate has been developed to install a new tactile text with Braille sign.</p>		

**Toilet Rooms**

<b>ADA Standard Reference:</b>	703.4.1, 703.4.2	
<b>Estimated Cost:</b>	\$1,756.04	
<b>Priority Level:</b>	Low	
<b>Barrier Description/Proposed Solution:</b>		
<p>The tactile signs to the 13 restrooms are mounted on the doors. An estimate has been developed to relocate the signs to the latch side of the doors.</p>		

<b>ADA Standard Reference:</b>	404.2.9, 404.2.8.1	
<b>Estimated Cost:</b>	\$1,385.54	
<b>Priority Level:</b>	Low	
<b>Barrier Description/Proposed Solution:</b>		
<p>The 13 existing restroom doors take a considerable amount of effort to open (more than 5 pounds of force) and close in less than 5 seconds. An estimate has been developed to adjust the door closers.</p>		


<b>ADA Standard Reference:</b>	<b>308.2, 603.4, 604.2, 604.5.1, 604.5.2, 604.7, 606.5</b>
<b>Estimated Cost:</b>	<b>\$731.82</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
Several work items in the Men's South Lobby restroom are required for compliance with the referenced sections. The existing coat hook is broken or at the wrong height and a new hook should be installed (603.4).The lavatories require pipe insulation to protect against contact (606.5). The water closet, paper towel dispenser, rear and side grab bars, and toilet paper dispenser require mounting adjustment (604.2, 308.2, 604.5.1, 604.5.2, 604.7).	




<b>ADA Standard Reference:</b>	<b>308.2, 308.2.2, 603.4, 604.2, 604.5.1, 604.5.2, 604.7, 606.5</b>
<b>Estimated Cost:</b>	<b>\$756.96</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
Several work items in the Women's South Lobby restroom are required for compliance with the referenced sections. The existing coat hook is broken or at the wrong height and a new hook should be installed (603.4).The lavatories require pipe insulation to protect against contact (606.5). The water closet, paper towel dispenser, rear and side grab bars, toilet paper dispenser, and soap dispenser require mounting adjustment (604.2, 308.2, 604.5.1, 604.5.2, 604.7, 308.2.2).	




<b>ADA Standard Reference:</b>	<b>603.4, 604.2, 604.7, 606.5</b>
<b>Estimated Cost:</b>	<b>\$623.59</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
Several work items in the Men's North Lobby restroom are required for compliance with the referenced sections. The existing coat hook is broken or at the wrong height and a new hook should be installed (603.4).The lavatories require pipe insulation to protect against contact (606.5). The water closet and toilet paper dispenser require mounting adjustment (604.2, 604.7).	

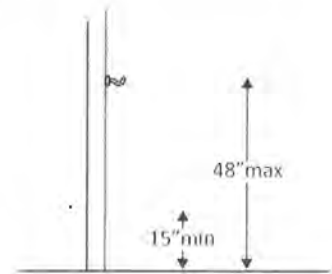


<b>ADA Standard Reference:</b>	<b>308.2, 603.4, 604.2, 604.5.1, 604.5.2, 604.7, 606.5</b>
<b>Estimated Cost:</b>	<b>\$731.82</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
Several work items in the Women's North Lobby restroom are required for compliance with the referenced sections. The existing coat hook is broken or at the wrong height and a new hook should be installed (603.4).The lavatories require pipe insulation to protect against contact (606.5). The water closet, paper towel dispenser, rear and side grab bars, and toilet paper dispenser require mounting adjustment (604.2, 308.2, 604.5.1, 604.5.2, 604.7).	

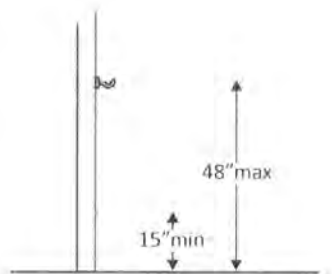


<b>ADA Standard Reference:</b>	<b>308.2.2, 603.4, 604.7, 606.5</b>
<b>Estimated Cost:</b>	<b>\$280.41</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
Several work items in the Men's Staff restroom are required for compliance with the referenced sections. The existing coat hook is broken or at the wrong height and a new hook should be installed (603.4). The lavatories require pipe insulation to protect against contact (606.5). The soap dispenser and toilet paper dispenser require mounting adjustment (308.2.2, 604.7).	

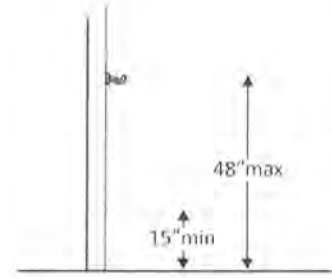


<b>ADA Standard Reference:</b>	<b>308.2.2, 603.4, 604.5.1, 604.5.2, 604.7</b>
<b>Estimated Cost:</b>	<b>\$462.04</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
Several work items in the Women's Staff restroom are required for compliance with the referenced sections. The existing coat hook is broken or at the wrong height and a new hook should be installed (603.4). The soap dispenser, toilet paper dispenser, and side and rear grab bars require mounting adjustment (308.2.2, 604.7, 604.5.1, 604.5.2).	

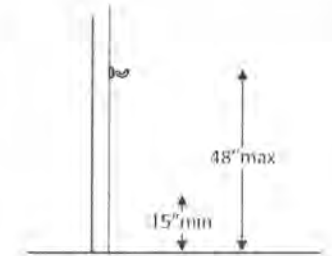

<b>ADA Standard Reference:</b>	<b>603.4, 604.5.1, 604.5.2</b>
<b>Estimated Cost:</b>	<b>\$245.58</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
Several work items in the Medical unisex restroom are required for compliance with the referenced sections. The existing coat hook is broken or at the wrong height and a new hook should be installed (603.4). The side and rear grab bars require mounting adjustment (604.5.1, 604.5.2).	

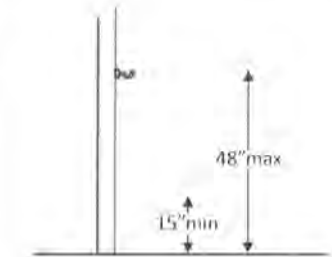


<b>ADA Standard Reference:</b>	<b>308.2.2, 603.4</b>
<b>Estimated Cost:</b>	<b>\$137.35</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
Several work items in the North Men's second-floor restroom are required for compliance with the referenced sections. The existing coat hook is broken or at the wrong height and a new hook should be installed (603.4). The soap dispenser requires mounting adjustment (308.2.2).	

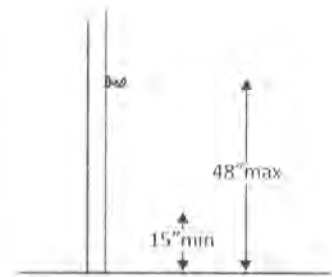





<b>ADA Standard Reference:</b>	<b>308.2.2, 603.4, 606.5</b>
<b>Estimated Cost:</b>	<b>\$172.18</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
Several work items in the North Women's second-floor restroom are required for compliance with the referenced sections. The existing coat hook is broken or at the wrong height and a new hook should be installed (603.4). The lavatories require pipe insulation to protect against contact (606.5). The soap dispenser requires mounting adjustment (308.2.2).	

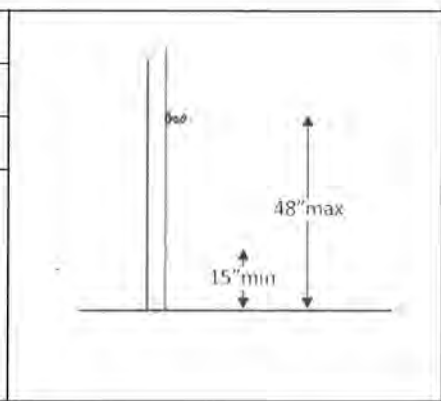


<b>ADA Standard Reference:</b>	<b>308.2, 604.4, 604.7</b>
<b>Estimated Cost:</b>	<b>\$298.23</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
Several work items in the South Men's second-floor restroom are required for compliance with the referenced sections. The existing coat hook is broken or at the wrong height and a new hook should be installed (603.4). The toilet paper dispenser requires mounting adjustment and the toilet seat requires replacement (604.7, 604.4).	

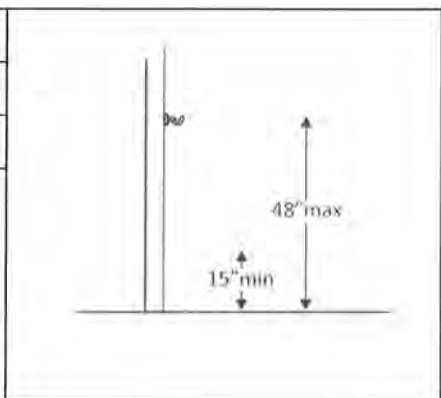

<b>ADA Standard Reference:</b>	<b>308.2.2, 603.4, 604.5.1, 604.5.2, 604.7</b>
<b>Estimated Cost:</b>	<b>\$462.04</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
Several work items in the South Women's second-floor restroom are required for compliance with the referenced sections. The existing coat hook is broken or at the wrong height and a new hook should be installed (603.4). The soap dispenser, toilet paper dispenser, and side and rear grab bars require mounting adjustment (308.2.2, 604.7, 604.5.1, 604.5.2).	

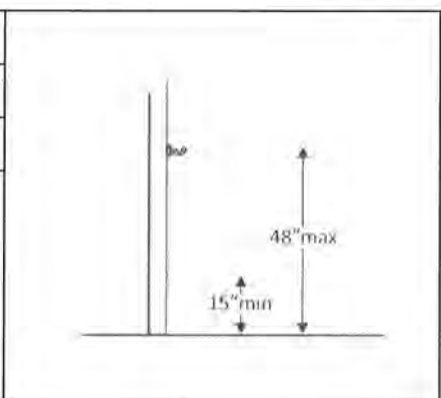

<b>ADA Standard Reference:</b>	<b>308.2, 603.4, 604.5.1</b>
<b>Estimated Cost:</b>	<b>\$353.81</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
Several work items in the Men's Emergency Management restroom are required for compliance with the referenced sections. The existing coat hook is broken or at the wrong height and a new hook should be installed (603.4). The soap dispenser, paper towel dispenser, and side grab bar require mounting adjustment (308.2.2, 308.2, 604.5.1).	

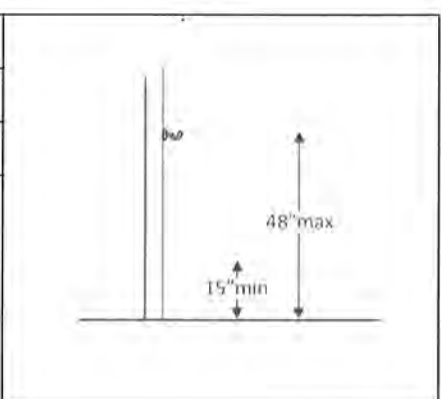

<b>ADA Standard Reference:</b>	<b>603.4, ,604.5.1, 604.6</b>	
<b>Estimated Cost:</b>	<b>\$245.58</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>Several work items in the Women’s Emergency Management restroom are required for compliance with the referenced sections. The existing coat hook is broken or at the wrong height and a new hook should be installed (603.4). The sidewall grab bar requires mounting adjustment (604.5.1). The flush controls on the water closet require relocation to the open side of the unit (604.6).</p>		

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**

**Asset/Location: Community Center, Radium Springs, NM**


<b>Assessors</b> Michael Black		
<b>Inspection Date</b> November 2015		
<b>Department</b> Facilities	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$1,546.96</b>	
<b>Priority 2:</b>	<b>\$0.00</b>	
<b>Priority 3:</b>	<b>\$1,102.44</b>	
<b>Priority 4:</b>	<b>\$262.19</b>	

**General Information**

The Community Center, located at 12060 Lindbeck Road, Radium Springs, NM, was built in 2000. It is a two-story building consisting of 6,182 SQFT. The Center provides programs that meet community needs, enhance the quality of life and promote community involvement.

**Approach & Entrance**


<b>ADA Standard Reference:</b>	<b>502.6</b>	
<b>Estimated Cost:</b>	<b>\$1,487.68</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing ADA parking signs are noncompliant and require replacement. An estimate has been developed for the installation of 4 new signs; 2 which should be “van accessible”.</p>		


<b>ADA Standard Reference:</b>	<b>216.6</b>	
<b>Estimated Cost:</b>	<b>\$59.28</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing inaccessible entrance does not have a sign that indicates the location of the nearest accessible entrance. An estimate has been developed to install a directional sign.</p>		


**Access to Goods & Services**

Accessibility barriers were not identified for this category.

**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>703</b>	
<b>Estimated Cost:</b>	<b>\$135.84</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The 2 multi-stall public restrooms require that new room signs with tactile text and Braille be installed. An estimate has been developed for the item noted.</p>		

<b>ADA Standard Reference:</b>	<b>404.2.9</b>	
<b>Estimated Cost:</b>	<b>\$319.74</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The 3 existing restroom doors take a considerable amount of effort to open (more than 5 lbs of force) and close in less than 5 seconds. An estimate has been developed to adjust the door closers.</p>		

<b>ADA Standard Reference:</b>	<b>604.8.1.2</b>	
<b>Estimated Cost:</b>	<b>\$646.86</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing accessible stall doors in both restrooms are not self-closing. An estimate has been developed to adjust the doors to achieve self-closing.</p>		



**Additional Access**

<b>ADA Standard Reference:</b>	<b>602.7</b>
<b>Estimated Cost:</b>	<b>\$262.19</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
1 of the existing drinking fountains is below the minimum mounting height required. An estimate has been developed to adjust the mounting of the drinking fountain to meet ADA compliance.	



**State of New Mexico, Doña Ana County  
Asset/Location: Rincon Community Center, Rincon, NM**

<b>Assessors</b> Michael Black	
<b>Inspection Date</b> November 2015	
<b>Department</b> Facilities	<b>Asset Type</b> Building
<b>ADA Checklist Summary Of Costs:</b>	
<b>Priority 1:</b>	<b>\$270.16</b>
<b>Priority 2:</b>	<b>\$0.00</b>
<b>Priority 3:</b>	<b>\$318.27</b>
<b>Priority 4:</b>	<b>\$1,465.99</b>



**General Information**

The Rincon Community Center, located at 220 Baker Street, Rincon, NM, was built in 1986. It is a single-story building consisting of 2,940 SQFT. The Center provides programs that meet community needs, enhance the quality of life and promote community involvement.

**Approach & Entrance**

<b>ADA Standard Reference:</b>	<b>502.6</b>
<b>Estimated Cost:</b>	<b>\$270.16</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
The existing ADA parking signs are too low. An estimate has been developed to raise 2 signs to 60" AFF minimum.	



**Access to Goods & Services**

<b>ADA Standard Reference:</b>	<b>307.2</b>
<b>Estimated Cost:</b>	<b>\$318.27</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
The fire extinguisher protrudes 6" into the walking path and 48" AFF. An estimate has been developed for the installation of a fire extinguisher cabinet.	




**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>216.8, 703</b>
<b>Estimated Cost:</b>	<b>\$171.22</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
This facility has 2 restrooms; 1 is accessible. A directional sign indicating the location of the nearest accessible restroom should be installed at the inaccessible restroom. 2 new room signs with tactile text and Braille should be installed. An estimate has been developed for the work item noted.	




<b>ADA Standard Reference:</b>	<b>404.2.8.1</b>
<b>Estimated Cost:</b>	<b>\$213.16</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
The existing restroom doors close in less than five seconds. An estimate has been developed to adjust the door closers.	

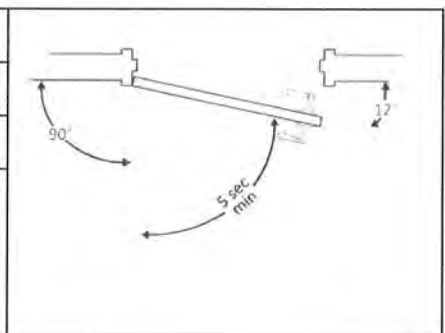

<b>ADA Standard Reference:</b>	<b>603.3, 604.5.1, 604.5.2, 604.6, 606.5</b>
<b>Estimated Cost:</b>	<b>\$594.92</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b>	
Several work items in the existing Men's restroom are required for compliance with the referenced sections. The existing mirror requires adjustment to the appropriate mounting height (603.3). The lavatory requires the installation of pipe insulation to protect against contact (606.5). The existing side wall and rear wall grab bars require horizontal adjustment (604.5.1, 604.5.2). The flush control on the water closet requires relocation to the open side of the unit (604.6). An estimate has been developed for the work items listed.	





<b>ADA Standard Reference:</b>	<b>604.5.1, 604.5.2, 604.6, 606.5</b>	
<b>Estimated Cost:</b>	<b>\$486.69</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>Several work items in the existing Women's restroom are required for compliance with the referenced sections. The lavatory requires the installation of pipe insulation to protect against contact (606.5). The existing side wall and rear wall grab bars require horizontal adjustment (604.5.1, 604.5.2). The flush control on the water closet requires relocation to the open side of the unit (604.6). An estimate has been developed for the work items listed.</p>		

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**


**Asset/Location: Sheriff's Substation, Chaparral, NM**

<b>Assessors</b> Michael Black		
<b>Inspection Date</b> October 2015		
<b>Department</b> Facilities	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$5,215.17</b>	
<b>Priority 2:</b>	<b>\$0.00</b>	
<b>Priority 3:</b>	<b>\$1,814.68</b>	
<b>Priority 4:</b>	<b>\$0.00</b>	


**General Information**


The Sheriff's Substation, located at 121 W. Lisa Road, Chaparral, NM, was built in 1996. The Sheriff's Office responds to all public assistance calls, to include, but not limited to crimes, traffic control, domestic disputes and missing children. It is a single-story building consisting of 3,720 SQFT.


**Approach & Entrance**

<b>ADA Standard Reference:</b>	<b>208.2, 405.7.3, 502.6</b>	
<b>Estimated Cost:</b>	<b>\$2,642.71</b>	
<b>Priority Level:</b>	<b>High</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing gravel parking lot does not provide an accessible space and access aisle that complies with the requirements of the referenced sections. An estimate has been developed for the installation of a new 18'x20' concrete pad with the appropriate pavement markings, wheel stop, and new ADA sign. The access aisle should be aligned with the accessible route. Access aisles should be painted with blue paint and include text that indicates "NO PARKING". The existing ramp has a 48" extension of concrete that should be removed for the installation of the new concrete pad.</p>		



<b>ADA Standard Reference:</b>	<b>405.8</b>	
<b>Estimated Cost:</b>	<b>\$1,512.00</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The existing ramp includes a handrail that is noncompliant. It is recommended that the existing handrail be removed and a new handrail be installed on each side of the ramp. An estimate has been developed for the installation of 70 L.F. of railing.		


<b>ADA Standard Reference:</b>	<b>216.6</b>	
<b>Estimated Cost:</b>	<b>\$86.80</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> This facility has 2 entrances. A directional sign needs to be installed indicating the direction of the main accessible entrance and a sign needs to be installed at the accessible entrance indicating ADA accessibility. An estimate has been developed for the installation of the signs.		

<b>ADA Standard Reference:</b>	<b>404.2.4, 404.2.7</b>	
<b>Estimated Cost:</b>	<b>\$973.66</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The existing entry door does not have adequate maneuvering clearance beyond the latch side of the door. The existing lockset on the door requires a grasping, pinching, and twisting motion to lock and should be replaced with push/pull plate hardware and deadbolt.		

**Access to Goods & Services**

Accessibility barriers were not identified for this category.

**Toilet Rooms**
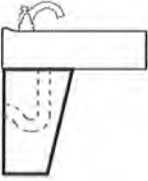
<b>ADA Standard Reference:</b>	<b>308.2, 308.2.2, 404.2.4, 603.3, 604.2, 604.5.1, 604.5.2, 604.6, 606.4, 606.5, 703.4.2,</b>	
<b>Estimated Cost:</b>	<b>\$1,814.68</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<p><b>Barrier Description/Proposed Solution:</b>                  Several work items in the existing Lobby restroom are required for compliance with the referenced sections. The existing room sign is noncompliant and requires removal and replacement with a new tactile text with Braille sign (703.4.2). The existing door does not allow for the required 18" of maneuvering clearance beyond the latch side of the door and requires that the door swing be reversed (404.2.4). The existing mirror requires relocation to the required mounting height (603.3). The lavatory pipes require insulation (606.5). The existing faucet requires replacement with a compliant unit (606.4). The soap and towel dispensers require mounting adjustment (308.2, 308.2.2). The distance from the centerline of the water closet to the side wall requires adjustment (604.2). A new 42" sidewall grab bar and a new 36" rear wall grab bar require installation (604.5.1, 604.5.2). The flush control on the water closet requires relocation to the open side of the unit (604.6). An estimate has been developed for the work items listed.</p>		

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**

**Asset/Location: Speedway Restroom, Las Cruces, NM**


<b>Assessors</b> Javier Ortega		
<b>Inspection Date</b> December 2015		
<b>Department</b> Facilities	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$5,956.49</b>	
<b>Priority 2:</b>	<b>\$875.88</b>	
<b>Priority 3:</b>	<b>\$6,626.30</b>	
<b>Priority 4:</b>	<b>\$0.00</b>	


**General Information**


The East Speedway Restroom located at Robert Larson Boulevard, Las Cruces, NM, was built in 1980, and consists of 598 SQFT.




**Approach & Entrance**

<b>ADA Standard Reference:</b>	<b>208.2.4,502.2,502.3, 502.3.3, 502.6</b>	
<b>Estimated Cost:</b>	<b>\$3,796.06</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The existing parking lot does not have any designated pavement markings. An estimate has been developed to paint 4 accessible parking spaces with 2 access aisles. Access aisles should be painted with blue paint and include text that indicates "NO PARKING". The estimate also includes the installation of 4 new signs; 1 of which should be designated as "van accessible".		

<b>ADA Standard Reference:</b>	<b>403.3</b>	
<b>Estimated Cost:</b>	<b>\$1,456.56</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> There are 3 sloped sidewalk areas at the speedway entry that exceed the maximum slope of 1:20. An estimate has been developed to remove and replace 200 S.F. of sidewalk to meet ADA compliance.		


<b>ADA Standard Reference:</b>	<b>216.6</b>	
<b>Estimated Cost:</b>	<b>\$703.87</b>	
<b>Priority Level:</b>	<b>High</b>	
<b>Barrier Description/Proposed Solution:</b> The main entrance to the speedway is not accessible. An estimate has been developed to remove a portion of the existing chain link fence and add a gate for a dedicated accessible entrance. Signs should be installed directing to and identifying the accessible entrance.		


**Access to Goods & Services**


<b>ADA Standard Reference:</b>	<b>221.2.1</b>	
<b>Estimated Cost:</b>	<b>\$875.88</b>	
<b>Priority Level:</b>	<b>High</b>	
<b>Barrier Description/Proposed Solution:</b> The existing Grandstands at the Speedway provide an estimated 4,451 standard seats and 2 wheelchair spaces. In Section 221.2.1 of the 2010 ADA Standards for Accessible Design requires that for every 500 standard seats provided, 6 wheelchair spaces are required. The code also requires that standard spaces between 501-5,000 require 1 wheelchair space for every 150 spaces. 30 wheelchair spaces are required; it is recommended that for each section of Grandstand the spaces are provided evenly. An estimate has been developed for the removal of 36 standard fixed seats to provide space for the required wheelchair spaces.		





**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>216.8</b>	
<b>Estimated Cost:</b>	<b>\$135.84</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The East Men's and Women's restroom require the installation of tactile text with Braille signs. An estimate has been developed for the item noted.		

<b>ADA Standard Reference:</b>	<b>206.2.4</b>	
<b>Estimated Cost:</b>	<b>\$3,074.00</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The West Men's and Women's restrooms have an uneven transition from the asphalt to concrete surface. An estimate has been developed to demolish 225 S.F. of the existing asphalt in front of each of the restrooms and replace with a concrete pad that allows for an accessible route.		

<b>ADA Standard Reference:</b>	<b>308.2, 603.3</b>	
<b>Estimated Cost:</b>	<b>\$324.69</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The existing mirror in the Women's restroom requires mounting adjustment The towel dispensers in the Men's and Women's restroom require mounting adjustment. An estimate has been developed for items listed.		

<b>ADA Standard Reference:</b>	<b>606.5, 606.4</b>	
<b>Estimated Cost:</b>	<b>1,652.13</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The Men's and Women's lavatories require that pipe insulation and ADA faucets be installed. An estimate has been developed for the work items listed.		

<b>ADA Standard Reference:</b>	<b>604.2, 604.5.1, 604.5.2, 609.3, 609.4</b>	
<b>Estimated Cost:</b>	<b>\$791.94</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> Several work items in the Men's and Women's accessible stalls are required for compliance with the referenced sections. The existing water closet requires mounting location adjustment and replacement (604.2, 604.4). The existing sidewall grab bars require mounting adjustment (604.5.1). A 36" bar requires installation at the rear wall (604.5.2). The existing accessible stall toilet partition doors require complete removal and replacement to the required 32" door (604.8.1.2). An estimate has been developed for the work items listed.		

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**

**Asset/Location: South Valley Complex- Community Health Center, Anthony, NM**


<b>Assessors</b> Michael Black		
<b>Inspection Date</b> October 2015		
<b>Department</b> Facilities		
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>		<b>\$408.67</b>
<b>Priority 2:</b>		<b>\$590.02</b>
<b>Priority 3:</b>		<b>\$178.04</b>
<b>Priority 4:</b>	<b>\$0.00</b>	

**General Information**

The South Valley Complex, located at 875/876 N. Main Street, Anthony, NM, was built in 1990. It is a single-story building consisting of 11,082 SQFT shared by the following organizations:

- The Community Health Center – responsible for providing comprehensive primary care services for children and adults.

**Approach & Entrance**

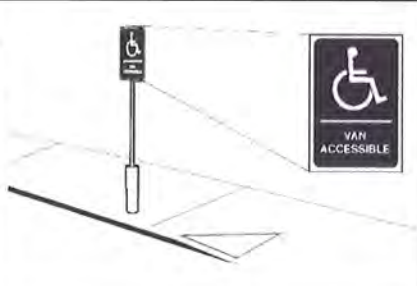
<b>ADA Standard Reference:</b>	<b>502.6</b>	
<b>Estimated Cost:</b>	<b>\$313.80</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> A sign identifying the accessible parking space with the International Symbol of Accessibility is not provided. An estimate has been developed for the installation of an ADA compliant sign.		

<b>ADA Standard Reference:</b>	<b>216.6</b>
<b>Estimated Cost:</b>	<b>\$94.87</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> The existing inaccessible entrance does not have a sign indicating the direction and location of the nearest accessible entrance. An estimate has been developed to install a new sign.	




**Access to Goods & Services**

<b>ADA Standard Reference:</b>	<b>404.2.7, 404.2.8.1, 404.2.9</b>
<b>Estimated Cost:</b>	<b>\$590.02</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> The existing door to the lunch room requires that the lockset be replaced as the locking mechanism requires a pinch/push action to operate (404.2.7). The door takes a considerable amount of effort to open (more than 5 pounds of force) and closes in less than 5 seconds (404.2.9, 404.2.8.1). An estimate has been developed to replace the lockset and adjust the door closer.	

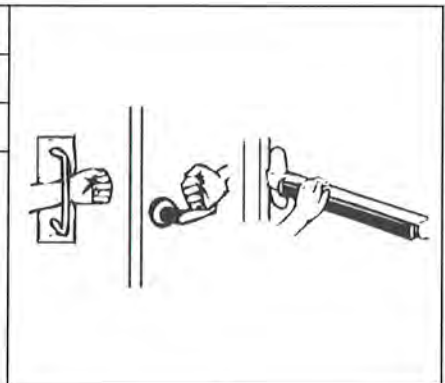


**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>703.4.2</b>
<b>Estimated Cost:</b>	<b>\$141.18</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> The existing room sign at the accessible restroom is noncompliant. An estimate has been developed to install a new tactile text with Braille sign that complies with the mounting requirements of this section.	

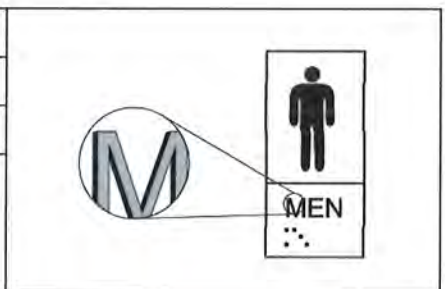

<b>ADA Standard Reference:</b>	<b>606.5</b>
<b>Estimated Cost:</b>	<b>\$36.86</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> The pipes below the lavatory in the Women's restroom are not insulated. An estimate has been developed to insulate the pipes to protect against contact.	

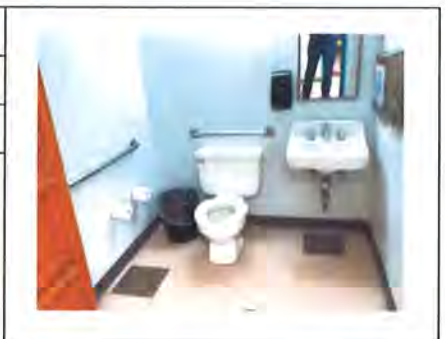

**Additional Access**

Accessibility barriers were not identified for this category.



**State of New Mexico, Doña Ana County**

**Asset/Location: South Valley Complex- Senior Center, Anthony, NM**


<b>Assessors</b> Michael Black		
<b>Inspection Date</b> October 2015		
<b>Department</b> Facilities		
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	\$3,213.68	
<b>Priority 2:</b>	\$378.34	
<b>Priority 3:</b>	\$1,803.63	
<b>Priority 4:</b>	\$0.00	


**General Information**


The South Valley Complex, located at 875/876 N. Main Street, Anthony, NM, was built in 1990. It is a single-story building consisting of 11,082 SQFT shared by the following organizations:

- The Senior Center - responsible for providing activities and opportunities to promote active and healthy aging.


**Approach & Entrance**


<b>ADA Standard Reference:</b>	<b>502.2, 502.3, 502.6</b>	
<b>Estimated Cost:</b>	<b>\$2,634.06</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The existing configuration of the accessible parking does not comply with the requirements of this section. The existing lines are faded and do not clearly designate parking and access aisles (502.2, 502.3). The existing ADA signs are faded and hard to read (502.6). An estimate has been developed for the reconfiguration of the parking to provide two 8' accessible spaces and an 8' access aisle in the middle. Access aisles should be painted with blue paint and include text that indicates "NO PARKING". New signs also require installation.		

<b>ADA Standard Reference:</b>	<b>216.6</b>	
<b>Estimated Cost:</b>	<b>\$284.61</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> Directional signs are not provided at inaccessible entries indicating the location of the nearest accessible entry. An estimate has been developed for the installation of 3 ADA compliant directional signs.		


<b>ADA Standard Reference:</b>	<b>404.2.7, 404.2.8</b>	
<b>Estimated Cost:</b>	<b>\$295.01</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The existing entry door has multiple issues that make it noncompliant. The lockset has a thumb trigger and the door closes in less than 5 seconds. An estimate has been developed to replace the lockset with a lever type system and adjust the door closer.		

**Access to Goods & Services**


<b>ADA Standard Reference:</b>	<b>404.2.4</b>	
<b>Estimated Cost:</b>	<b>\$83.33</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> There is a 1" transition between the Cafeteria and the Game room. This transition is minimal; however, it must be no greater than 1:48. An estimate has been developed for the beveling of the concrete to achieve the maximum slope allowed by this section.		


<b>ADA Standard Reference:</b>	<b>404.2.7, 404.2.8.1, 404.2.9</b>	
<b>Estimated Cost:</b>	<b>\$295.01</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The existing door to the lunch room requires that the lockset be replaced as the locking mechanism requires a pinch/push action to operate. The door takes a considerable amount of effort to open (than 5lbs of force) and closes in less than 5seconds. An estimate has been developed to replace the lockset and adjust the door closer.		

**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>703.3, 703.4.2</b>	
<b>Estimated Cost:</b>	<b>\$141.18</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The existing signs to the restrooms are noncompliant. An estimate has been developed for the installation of new compliant tactile text with Braille signs.		



<b>ADA Standard Reference:</b>	<b>404.2.9</b>	
<b>Estimated Cost:</b>	<b>\$108.35</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The door to the restroom takes a considerable amount of effort to open (more than 5lbs of force). An estimate has been developed to adjust the door closer.</p>		
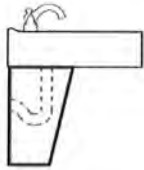
<b>ADA Standard Reference:</b>	<b>604.5.1, 604.6, 604.8, 606.5</b>	
<b>Estimated Cost:</b>	<b>\$1,554.10</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>Several work items in the existing Men's restroom are required for compliance with the referenced sections. The piping below the lavatory is exposed and requires insulation to protect against contact (606.5). The sidewall grab bar requires horizontal adjustment to comply with the mounting requirements (604.5.1). The flush control on the water closet requires relocation to the open side of the unit (604.6). The existing accessible compartment needs to be widened and the door needs to be replaced. An estimate has been developed for the work items listed.</p>		

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**

**Asset/Location: South Valley Complex- Sheriff's Substation**

<b>Assessors</b>		
Michael Black		
<b>Inspection Date</b>		
October 2015		
<b>Department</b>		
Facilities		
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$3,602.31</b>	
<b>Priority 2:</b>	<b>\$0.00</b>	
<b>Priority 3:</b>	<b>\$603.69</b>	
<b>Priority 4:</b>	<b>\$0.00</b>	


**General Information**

The South Valley Complex, located at 875/876 N. Main Street, Anthony, NM, was built in 1990. It is a single-story building consisting of 11,082 SQFT shared by the following organizations:

- The Sheriff's Substation - responsible for responding to all public assistance calls, including, but not limited to, crimes, traffic control, domestic disputes and missing children.




**Approach & Entrance**


<b>ADA Standard Reference:</b>	<b>208.2.4, 502.2, 502.3, 502.3.3, 502.6</b>	
<b>Estimated Cost:</b>	<b>\$3,602.31</b>	
<b>Priority Level:</b>	<b>Medium</b>	
<b>Barrier Description/Proposed Solution:</b> The existing accessible parking requires reconfiguration to comply with the requirements of the referenced sections. The accessible parking does not provide an access aisle (502.2, 502.3). The existing ADA signs do not designate "van accessibility" and are not mounted at the appropriate height (502.6). An estimate has been developed for the reconfiguration of the parking lot to allow for two 8' accessible spaces with an 8' access aisle in the middle. Wheel stops should be installed 5' from the existing curb to provide for an accessible route from the parking area to the main entrance. Access aisles should be painted with blue paint and include text that indicates "NO PARKING".		


**Access to Goods & Services**

Accessibility barriers were not identified for this category.

**Toilet Rooms**
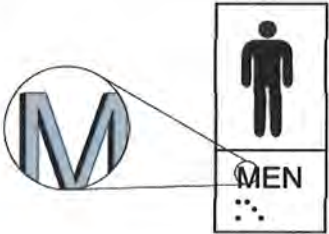
<b>ADA Standard Reference:</b>	<b>703.4.2</b>	
<b>Estimated Cost:</b>	<b>\$141.18</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> Existing room signs for the restrooms are mounted on the door and do not comply with the requirements of this section. An estimate has been developed for the installation of new tactile text with Braille room signs.		
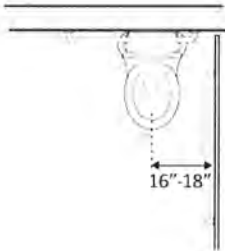
<b>ADA Standard Reference:</b>	<b>604.2</b>	
<b>Estimated Cost:</b>	<b>\$239.09</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The existing water closet exceeds the maximum distance of 18" from the centerline to the side wall. An estimate has been developed for the adjustment of the water closet to meet the requirements of this section.		
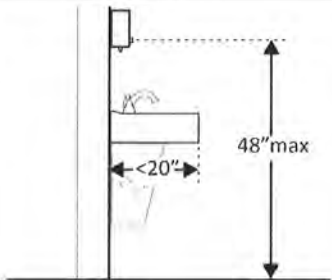
<b>ADA Standard Reference:</b>	<b>308.2</b>	
<b>Estimated Cost:</b>	<b>\$223.42</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The existing soap dispenser and paper towel dispenser are mounted above the maximum height as required by this section. An estimate has been developed for the adjustment of both accessories.		

**Additional Access**

Accessibility barriers were not identified for this category.

State of New Mexico, Doña Ana County


Asset/Location: Vector Control, Las Cruces, NM

<b>Assessors</b> Michael Black		
<b>Inspection Date</b> October 2015		
<b>Department</b> Facilities	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	\$2,677.84	
<b>Priority 2:</b>	\$106.58	
<b>Priority 3:</b>	\$1,513.07	
<b>Priority 4:</b>	\$1,926.91	


**General Information**

Vector Control, located at 2025 E. Griggs, Las Cruces, NM, was built in 1980. It is a single-story building consisting of 3,060 SQFT.

**Approach & Entrance**


<b>ADA Standard Reference:</b>	502.2, 502.3	
<b>Estimated Cost:</b>	\$2,677.84	
<b>Priority Level:</b>	Low	
<b>Barrier Description/Proposed Solution:</b> <p>The existing accessible parking requires reconfiguration to comply with the requirements of the referenced sections. Work items to include: construction of a new concrete pad (16' x 22'), striping, and the removal and replacement of the existing ADA sign with a new ADA 'Van Accessible' sign. The access aisle should be painted with blue paint and include text that indicates "NO PARKING".</p>		


**Access to Goods & Services**

<b>ADA Standard Reference:</b>	404.2.6	
<b>Estimated Cost:</b>	\$106.58	
<b>Priority Level:</b>	Low	
<b>Barrier Description/Proposed Solution:</b> <p>The interior door right of the entry door swings into the clear space of the entry door. An estimate has been developed to remove the interior door as it is propped open and no longer serves a purpose.</p>		




**Toilet Rooms**
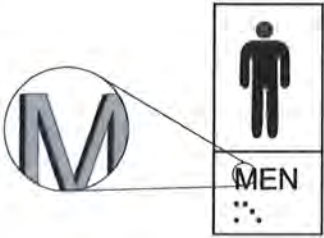
<b>ADA Standard Reference:</b>	<b>404.2.4, 404.2.7, 703.5</b>	
<b>Estimated Cost:</b>	<b>\$478.43</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing unisex restroom requires several work items to be in compliance with the referenced section. A new tactile text with Braille sign requires installation (703.5). The door does not have adequate maneuvering clearance beyond the latch side and requires that the door swing be reversed (404.2.4). The existing knob type lockset requires replacement with a lever type lockset (404.2.7). An estimate has been developed for the items listed.</p>		

<b>ADA Standard Reference:</b>	<b>308.2, 604.5.1 604.5.2, 604.6, 606.4, 606.5,</b>	
<b>Estimated Cost:</b>	<b>\$1,034.64</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>Several work items in the unisex restroom are required for compliance with the referenced sections. Pipe insulation is required for protection against contact (606.5). The existing faucet hardware requires replacement with lever type hardware (606.4). The towel dispenser requires vertical adjustment (308.2). A sidewall and rear wall grab bar requires installation (604.5.1, 604.5.2).The flush controls on the water closet require relocation to the open side of the unit (604.6). An estimate has been developed for the items listed.</p>		

**Additional Access**

<b>ADA Standard Reference:</b>	<b>602.2</b>	
<b>Estimated Cost:</b>	<b>\$1,926.91</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b>		
<p>The existing drinking fountain located in the hall is noncompliant. An estimated has been developed to remove and replace the drinking fountain.</p>		



**State of New Mexico, Doña Ana County**  
**Asset/Location: Veterans Administration, Las Cruces, NM**

<b>Assessors</b> Antonio Florencio Ortega		
<b>Inspection Date</b> October 2015		
<b>Department</b> Facilities	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$0.00</b>	
<b>Priority 2:</b>	<b>\$0.00</b>	
<b>Priority 3:</b>	<b>\$1,327.81</b>	
<b>Priority 4:</b>	<b>\$0.00</b>	

**General Information**

The Animal Control and Veterans Office building, located at 2024 E. Griggs, Las Cruces, NM, was built in 2001. It is a single-story building consisting of 4,513 SQFT. Animal Control is responsible for the well-being of both animals and residents of the community by providing animal control services. The New Mexico Department of Veterans' Services is a statewide community service organization dedicated to helping veterans and their families with receiving adequate services and benefits.


**Approach & Entrance**


Accessibility barriers were not identified for this category.


**Access to Goods & Services**

Accessibility barriers were not identified for this category.

**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>703</b>	
<b>Estimated Cost:</b>	<b>\$141.18</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The existing room signs at the restrooms are noncompliant. Only 1 restroom is large enough to be fully compliant. It is recommended that the larger restroom be designated as a unisex restroom and a new sign that indicates handicap accessibility be installed. An estimate has been developed for the installation of 2 new signs with tactile text and Braille.		

<b>ADA Standard Reference:</b>	<b>404.2.7</b>	
<b>Estimated Cost:</b>	<b>\$373.32</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The existing locksets on both restroom doors have a lock that requires a pinching and twisting motion to operate. An estimate has been developed for the replacement of the locksets.		

<b>ADA Standard Reference:</b>	<b>308.2, 604.2, 604.5.1, 604.6, 604.7</b>	
<b>Estimated Cost:</b>	<b>\$813.31</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The existing East restroom requires minor work items to be in compliance with the requirements of the referenced sections. The paper towel dispenser requires mounting height adjustment (308.2). The water closet requires mounting adjustment to provide the required distance from the side wall (604.2). The flush control requires relocation to the open side of the unit (604.6). The side wall grab bar requires horizontal mounting adjustment (604.5.1). The toilet paper dispenser requires mounting height adjustment (604.7). An estimate has been developed for the work items listed.		

**Additional Access**

Accessibility barriers were not identified for this category.

**State of New Mexico, Doña Ana County**

**Asset/Location: West Speedway Restroom, Las Cruces, NM**

<b>Assessors</b> Javier Ortega		
<b>Inspection Date</b>		
<b>Department</b> Facilities	<b>Asset Type</b> Building	
<b>ADA Checklist Summary Of Costs:</b>		
<b>Priority 1:</b>	<b>\$0.00</b>	
<b>Priority 2:</b>	<b>\$0.00</b>	
<b>Priority 3:</b>	<b>\$4,190.78</b>	
<b>Priority 4:</b>	<b>\$0.00</b>	

**General Information**

The West Speedway Restroom located at Robert Larson Boulevard, Las Cruces, NM, was built in 1980, and consists of 598 SQFT.


**Approach & Entrance**

Accessibility barriers were not identified for this category.

**Access to Goods & Services**


Accessibility barriers were not identified for this category.

**Toilet Rooms**

<b>ADA Standard Reference:</b>	<b>703.2, 703.3, 703.4.2, 216.8</b>	
<b>Estimated Cost:</b>	<b>\$271.68</b>	
<b>Priority Level:</b>	<b>Low</b>	
<b>Barrier Description/Proposed Solution:</b> The Men's and Women's restrooms require the installation of new tactile text with Braille signs. An estimate has been developed to install 4 new signs.		



<b>ADA Standard Reference:</b>	<b>404..2.8.1</b>
<b>Estimated Cost:</b>	<b>\$213.16</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> The entrance doors to the Men's and Women's restrooms close in less than 5 seconds. An estimate has been developed to adjust the door closers.	

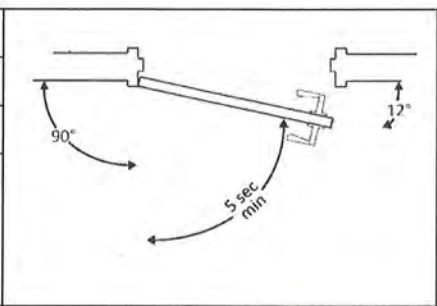

<b>ADA Standard Reference:</b>	<b>603.3, 604.4</b>
<b>Estimated Cost:</b>	<b>\$274.70</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> The mirrors in the Men's and Women's restroom require mounting adjustment. New coat hooks are required at the accessible stalls. An estimate has been developed for the items listed.	



<b>ADA Standard Reference:</b>	<b>606.5, 606.4</b>
<b>Estimated Cost:</b>	<b>\$2,202.84</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> 2 lavatories in the Men's and 2 lavatories in the Women's restrooms do not have pipe insulation. They also have knob type faucet hardware. An estimate has been developed to install pipe insulation to the pipes and to remove and replace the faucets with lever type hardware.	



<b>ADA Standard Reference:</b>	<b>604.4</b>
<b>Estimated Cost:</b>	<b>\$1,012.78</b>
<b>Priority Level:</b>	<b>Medium</b>
<b>Barrier Description/Proposed Solution:</b> The water closets in the Men's and Women's accessible stalls are noncompliant and require replacement. An estimate has been developed for the item noted.	



<b>ADA Standard Reference:</b>	<b>604.8.1.2</b>
<b>Estimated Cost:</b>	<b>\$215.62</b>
<b>Priority Level:</b>	<b>Low</b>
<b>Barrier Description/Proposed Solution:</b> The Men's and Women's accessible stall toilet partitions require mounting adjustment and doors are not self-closing. An estimate has been developed for the items listed.	





**Additional Access**

Accessibility barriers were not identified for this category.

## **Appendix F**

# **Doña Ana County ADA Grievance Procedure**



## **Doña Ana County Grievance Procedure Under The Americans with Disabilities Act**

This grievance procedure is established to meet the requirements of the Americans with Disabilities Act of 1990 ("ADA"). It may be used by anyone who wishes to file a complaint alleging discrimination on the basis of a disability in the provision of services, activities, programs, or benefits by Doña Ana County. The County's Human Resources Policies and Procedures govern employment-related complaints of disability discrimination.

A grievance form is available, upon request. **Failure to use this form in no way compromises the grievance procedure.** The complaint should be in writing and contain information about the alleged discrimination such as name, address, phone number of complainant and location, date, and description of the problem. Alternative means of filing complaints, such as personal interviews or tape recording the complaint will be made available for persons with disabilities upon request.

The complaint should be submitted by the grievant and/or his/her designee as soon as possible but no later than 60 calendar days after the alleged violation to:

***HR Department, ADA Coordinator, 845 N. Motel Blvd., Suite 2-190, Las Cruces, NM 88007***

The County will acknowledge, in writing, receipt of the written grievance and notify the Doña Ana County Manager of said grievance. Within 15 calendar days after receipt of the complaint, the ADA Coordinator or his/her designee will meet with the complainant to discuss the complaint and the possible resolutions. Within 15 calendar days of the meeting, the ADA Coordinator or his/her designee will respond in writing, and where appropriate, in a format accessible to the complainant, such as large print, braille, or audio tape. The response will explain the position of Doña Ana County and offer options for substantive resolution of the complaint.

If the response by the ADA Coordinator or his/her designee does not satisfactorily resolve the issue, the complainant and/or his/her designee may appeal the decision within 15 calendar days after receipt of the response to the County Manager or his/her designee.

Within 15 calendar days after receipt of the appeal, the County Manager or his/her designee will meet with the complainant to discuss the complaint and possible resolutions. Within 15 calendar days after the meeting, the County Manager or his/her designee will provide final resolution of the complaint in writing, and, where appropriate, in a format accessible to the complainant.

All written complaints received by the ADA Coordinator or his/her designee, appeals to the County Manager or his/her designee, and responses from these two offices will be retained by Doña Ana County for at least three years.

### **Alternative Grievance Procedures:**

Nothing in this procedure prevents any individual(s) who believes they have a grievance under Title II of the ADA from taking other legal action to seek resolution.

Employees of Doña Ana County may also use the Grievance procedure established by the Human Resources Department for any ADA issues related to their specific employment.

### **Waivers:**

Any time lines established in this procedure may be waived by written mutual consent.





**DOÑA ANA COUNTY  
AMERICANS WITH DISABILITIES ACT  
PUBLIC GRIEVANCE FORM**

Please complete this form as completely as possible. If you need help filling out this form, we would be happy to help you.

**Signed complaints should be sent to:**

Human Resources  
Doña Ana County  
845 N. Motel Boulevard  
Las Cruces, NM 88007

Phone: 575-647-7210 (voice)  
575-647-7285 (TTY)

E-mail: [EEO@donaanacounty.org](mailto:EEO@donaanacounty.org)

Your Name: \_\_\_\_\_

Your Address: \_\_\_\_\_

City: \_\_\_\_\_ State: \_\_\_\_\_ Zip: \_\_\_\_\_

Phone Number: \_\_\_\_\_ Alternate Phone Number: \_\_\_\_\_

If completing on behalf of someone:

Organization: \_\_\_\_\_

Contact Person: \_\_\_\_\_ Phone Number: \_\_\_\_\_

Describe in as much detail as possible what happened? \_\_\_\_\_

\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_

When did it happen? \_\_\_\_\_

Where did it happen? \_\_\_\_\_

Can you name anyone involved? \_\_\_\_\_

\_\_\_\_\_  
\_\_\_\_\_

How would you like this resolved? What relief do you seek? \_\_\_\_\_

---

---

---

---

---

---

Signature: \_\_\_\_\_

Date: \_\_\_\_\_

## **Appendix G**

# **Doña Ana County ADA Notice to the Public**





## DOÑA ANA COUNTY NOTICE UNDER THE AMERICANS WITH DISABILITIES ACT

In accordance with the requirements of Title II of the Americans with Disabilities Act of 1990 ("ADA"), Doña Ana County will not discriminate against qualified individuals with disabilities on the basis of disability in its programs, services, or activities.

**Employment:** Doña Ana County does not discriminate on the basis of disability in its hiring or employment practices and complies with all regulations promulgated by the U.S. Equal Employment Opportunity Commission under Title I of the ADA.

**Effective Communication:** Doña Ana County will generally, upon request, provide appropriate aids and services leading to effective communication for qualified persons with disabilities so they can participate equally in Doña Ana County's programs, services, or activities, including qualified sign language interpreters, documents in braille, and other ways of making information and communications accessible to people who have speech, hearing, or vision impairments.

**Modifications to Policies and Procedures:** Doña Ana County will make all reasonable modifications to policies and procedures to ensure that people with disabilities have an equal opportunity to enjoy all of its programs, services, or activities. For example, individuals with service animals are welcomed in Doña Ana County offices, even where pets are generally prohibited.

Anyone who requires an auxiliary aid or service for effective communication or a modification of policies or procedures to participate in a program, service, or activity of Doña Ana County, should contact the Doña Ana County ADA Coordinator, 845 N. Motel Blvd., Suite 2-190, Las Cruces, NM 88007, 575-647-7210 (voice), 575-525-5951 (TDD/TTY) at least two business days prior to the event at which an accommodation is needed.

The ADA does not require Doña Ana County to take any action that would fundamentally alter the nature of its programs, services, or activities or impose an undue financial or administrative burden.

Complaints that a program, service, or activity of Doña Ana County is not accessible to persons with disabilities should be directed to the Doña Ana County ADA Coordinator, 845 N. Motel Blvd., Suite 2-190, Las Cruces, NM 88007, 575-647-7210 (voice), 575-525-5951 (TDD/TTY).

Doña Ana County will not place a surcharge on a particular individual with a disability or any group of individuals with disabilities to cover the cost of providing auxiliary aids/services or reasonable modifications of policy, such as retrieving items from locations that are open to the public but are not accessible to persons who use wheelchairs.

## **Appendix H**

# **Doña Ana County Audit of Programs, Activities, and Services**

**Areas that responded:**

Clerk's- Bureau of Elections  
Clerk's- Recording & Filing  
Community Development- Animal Control & Codes Enforcement  
County Manager- Community & Constituent Services  
Engineering & Road Department  
Facilities & Parks/Vector Control  
Finance- Payroll & AP  
Finance- Purchasing  
Fire & Emergency Services  
Flood Commission  
Finance- Grants  
Health & Human Services- Administration  
Health & Human Services- Court Compliance  
Health & Human Services- Outreach & Education  
Health & Human Services- Program Operations  
Human Resources  
Office of Emergency Management  
Probate  
Public Works/Airport  
Sheriff's Department  
Sheriff's Operations  
Treasurer's Office  
Utilities

**A1. Are there any eligibility requirements?** None

**A2. Does your department have a process for responding to requests for accommodation that would allow people with disabilities to participate in your program?**

- Voting machines are ADA accessible. Voters can bring someone to assist. Curb-side voting is available. *Clerk's- Bureau of Elections*
- Refer person to EEO Specialist/ADA Coordinator. *Human Resources*
- Typically our front desk staff and compliance monitors after some interaction with offenders are able to identify if they have special needs (intake questionnaire). *HHS- Court Compliance*
- Our staff works to meet the needs, and if unable to we contact the ADA Coordinator. *HHS- Program Operations*



- We consult with ADA Coordinator and/or Risk Management if we need assistance. *HHS- Court Compliance*
- All persons are open to receive law enforcement services within the county of Doña Ana. *Sheriff's Office- Operations*
- Interpreter services will be provided. Service animals allowed. *Public Works- Airport*

**Recommendation(s):**

**1. Provide written procedures to Detention Center Officers and Sheriff's Deputies if they do not already exist.**

**2. ADA Coordinator will send out an email to all employees advising them of the ADA Office Webpage and the County notices and services provided.**

**A3. Have you received any complaints regarding physical/program access for people with disabilities?**

- Yes, Project HOME, safe taxi transportation for people who have been drinking was asked if we can accommodate disability so we added a handi-van to each night of service. *HHS- Court Compliance*
- Yes, Compliance officers have voiced that not all cubicles are wheel-chair accessible. *HHS- Court Compliance*
- Yes, at the end of County Senior Resource and Informational Fair, we received some concerns that the vendor tables were too close together making it difficult for people with mobility challenges. We're taking all Recommendation(s) received in the post event evaluations into consideration including the spacing of the tables to improve future events. *County Manager- Community & Constituent Services Office*

**Recommendation(s):**

**1. ADA Coordinator will send out the email mentioned above and will mention the ADA public grievance process. Additionally, ADA Coordinator will request that any complaints handled by the department or program directly be communicated to ADA Coordinator.**

**A4. Have you received any complaints regarding communication issues for people with disabilities? No**

**Recommendation(s):**

**1. ADA Coordinator will send out the email mentioned above and will mention the ADA public grievance process. Additionally, ADA Coordinator will request that any complaints handled by the department or program directly be communicated to ADA Coordinator.**

**B1. How do you notify all persons (employees, applicants, participants, beneficiaries, volunteers, visitors, and other interested parties including those with visual and/or hearing disabilities) of their right to participate in your programs regardless of their disability?**

- Through the application process; on the website; with each meeting notice. *Human Resources*
- We have not made any attempt at outreach. *Airport*
- Our office does not provide programs. *Office of Emergency Management*
- The courts determine our participants regardless of any disability. *HHS- Court Compliance*
- We don't notify them but we take anyone that the courts order to our office. *HHS- Court Compliance*
- Verbally. *Community Development*
- On Request. *Fire Administration*
- Not sure how to answer this question. The public notification of our events and programs are done by the Public Information Office. *County Manager- Community & Constituent Services Office*
- We allow persons to participate in everything that we do at the centers. If there is a person that needs assistance, the center staff will call and we will help provide assistance to the resident. *HHS- Outreach & Education*
- We provide all pertinent information to our Public Information Office and they take care of this for us. *Flood Commission*
- Notices are advertised on all county information. *Facilities, Parks & Vector Control*
- Local Media Notices include disclosures. *Treasurer's*
- Local Paper. *Finance*
- The events are public community events such as festivals. I am not aware of any notices. *Clerk's- Recording & Filing*
- Public and social media. *Sheriff's Office- Operations*
- We have boilerplate language. *Public Information Office*

- Newspaper, mailers and posting on the County website. *Utilities*
- Mandatory orientation new employees. *Probate*
- We have information about ADA voters in our election official training. *Clerk's- Bureau of Elections*
- Training offered by EEO Specialist/ADA Coordinator. *Human Resources*
- HR Training. *Engineering*
- The maintenance worker refers all requests to me. I have only one. *Public Works- Airport*

**Recommendation(s):**

**1. ADA Coordinator will send out information to all departments of required wording that needs to be included on all communication notices for public services, activities, and programs.**

**B2. Do you include the following statement on your County sponsored meeting or event agendas?**

- Yes- *Human Resources*
- Do not sponsor any public programs- *Airport*
- Yes- *Community & Constituent Services*
- Yes- *HHS- Outreach and Education*
- Yes- *Facilities, Parks & Vector*
- Yes- *Grants*
- Yes- *Treasurer's*
- Yes- *Public Information Office*

**Recommendation(s):**

**1. See #1 on B1.**

**2. Periodically hold training for supervisors on what constitutes a program, activity, and service.**

**3. For Airport, since they said no, train on what constitutes services, activities, and programs.**

**B3. How do you notify all persons about how and with whom to file a disability discrimination complaint?**



- Would direct them to the process in policy or to the ADA Specialist- *Human Resources*
- Hasn't happened/ Refer to HR and/or ADA Coordinator- *Engineering*
- We have never received a disability discrimination complaint- *Airport*
- We refer them to the County ADA Coordinator- *Office of Emergency Management*
- We don't as far as I know- *HHS- Court Compliance*
- I am not aware that we make this notification- *HHS- Court Compliance*
- Haven't been asked- *Animal Control & Codes*
- HR Orientation; attending the course is a requirement- *Fire*
- If our office received such a complaint, we would refer the person to Meg Haines, ADA/EEO Specialist, in the HR Dept. – *Community & Constituent Services*
- Staff would refer the complaint to me and I would refer them to HR- *HHS- Outreach & Education*
- We have not had to do this. I assume HR would assist with this- *Flood*
- Public Notice- *Facilities, Parks & Vector Control*
- If I am ever confronted with these questions, I refer them to HR- *Grants*
- Printed disclosures- *Treasurer's*
- If I ever receive a complaint I would call HR and ask whom is the ADA compliance rep and notify them and ask for guidance- *Clerk's- Recording & Filing*
- N/A- *Sheriff's Office- Operations*
- We refer them to HR and the ADA Coordinator- *Public Information Office*
- Never had to, but I would refer them to our HR ADA Coordinator- *Utilities*

**Recommendation(s):**

**1. See #1 on A4**

**B4. What documents do you publish? Please provide copies.**

- Doña Ana Basic Plan Final 1-20-11.pdf- *Office of Emergency Management*
- Vado De. Calendar.doc- *HHS- Outreach & Education*
- ADA Disclosure template.docx- *Treasurer's*

- EXHIBIT 1-QCDBG Public Hearing Notice close out.doc- *Utilities*

**B5. Do you make the content of documents and publications available in simple, easy-to understand language for individuals with learning disabilities?**

- Yes- *Human Resources*
- Yes- *Engineering/Road Department*
- Yes- *Office of Emergency Management*
- Yes- *HHS- Court Compliance*
- Yes- *HHS- Program Operations*
- Yes- *Community Development*
- Yes- *Fire Administration*
- Yes- *HHS- Outreach & Education*
- Yes- *Facilities, Parks & Vector Control*
- Yes- *Grants*
- Yes- *Treasurer's*
- Yes- *Finance*
- Yes- *Public Information Office*

**B6. Does your department prepare audiovisual or televised presentations for the public or make audiovisual presentations to the public? B7. How do you make audiovisual or televised presentations prepared or presented by your department to the public accessible to individuals with disabilities?**

- If a request is made from an individual with a disability, we would go through the county and request whatever support is needed for the request through the County ADA Coordinator- *Office of Emergency Management*
- The presentations that our office typically does involves PowerPoint and; at times, video production developed by the IT Department- *Community & Constituent Services Office*
- We work with the ADA Coordinator- *Public Information & Special Projects*

**B8. List the audiovisual presentations (film, videotape, or television).**

- Emergency Preparedness Presentations, Training, Emergency Operations Center (EOC) - *Office of Emergency Management.*

- Video by the IT department, PowerPoint Presentations- *Community and Constituent Services Office*.

**B9. Does your department's website include any information about the programs you offer? If yes, please describe briefly what information is provided.**

- Full-service airport serving Doña Ana County and the El Paso area. Practice field for helicopters from Biggs Army Airfield and local law enforcement agencies. The Customs facility is open and the Jetport is an aircraft port of entry. The Doña Ana County International Jetport hosts many special events during the year including hosting the Experimental Aircraft Association (EAA B-17, B-25 and Ford Tri-Motor aircraft that give tours and rides to the public. The War Eagles Air Museum is one of the finest in the country- Airport
- It gives information about the probation process and resources to completing sanctions. It then goes in to describing the various components of the program- HHS- Court Compliance
- There is information on the Community and Constituent Services Office page about the grand workshop and the senior fair- Community & Constituent Services
- Not programs but services that are provided- Grants
- Generally speaking, yes. The website directs issues related to this questionnaire to the ADA Coordinator- Public Information & Special Projects

**B10. Does your department's website include information about the accessibility of facilities where programs are offered?**

- Yes. Part of the County's site- *HHS- Program Operations*

**C1. How have staff members/volunteers that have contact with the public and need to be aware of department and County policies that enable persons with disabilities to participate in programs, activities, or services been trained to handle requests?**

- Mandatory orientation for new employees- *Probate*
- We have information about ADA voters in our election official training- *Clerk's Bureau of Elections*
- Training offered by EEO Specialist/ADA Coordinator- *Human Resources*
- HR Training- *Engineering-Road Dept.*
- The maintenance worker refers all requests to Director- *Airport*
- Through regular County training- *Office of Emergency Management*



- If the situation arises document technicians at the front desk or compliance monitor would bring the situation to the lead compliance monitor and/or division manager- *HHS- Court Compliance*
- Through our HR department- *HHS- Program Operations*
- At past staff meetings- *Animal Control & Codes Enforcement*
- No training- *Fire Administration*
- As County employees, we're also supposed to know or refer to County policies. However, no one has had specific training on the ADA, except with relationship to employment- *Community & Constituent Services*
- Training is needed- *HHS- Outreach & Education*
- The only training is what is made available by HR- *Flood*
- County training- *Facilities, Parks & Vector Control*
- RAP Training- *Treasurer's*
- They have not had any training- *Clerk's Recording & Filing*
- The County offers training on this and other issues- *Public Information & Special Projects*
- Upon hiring all staff members attend a mandatory 2-day orientation with HR- *Sheriff's Office*
- No training- *Utilities*

**C2. Is program staff that regularly interact with the public familiar with the County's ADA grievance/complaint procedures when an incident of disability discrimination is alleged?**

- Yes- Office of Emergency Management
- Yes- Sheriff's Office
- Yes- Community Development
- Yes- Facilities, Parks & Vector Control
- Yes- Treasurer's
- Yes- Purchasing
- Yes- Public Information & Special Projects

**C3. Does anyone on your staff have experience working with people with disabilities? Please describe.**

- We have had a couple of situations in the past with a hearing impaired individual and more often with someone in a wheelchair or mobile device. With the hearing impaired we were able to work with ADA Coordinator to obtain services and with those with mobility issues we have a couple of cubicles that are wheelchair accessible and we use those if needed- *HHS- Court Compliance*
- Yes- *Sheriff's Office*
- Yes. Staff work with peers in the mental health programs and assists people in accessing state services- *HHS- Program Operations*
- Yes. Past HR experience- *Animal Control & Codes Enforcement*
- Yes. Providing medical care to individuals- *Fire Administration*
- Yes. There are many people whom we encounter during the course of our lives that may have visible or invisible disability. I'm not aware of all my staffs experience in this area; I can say that in my prior employment, I collaborated with the Superior Alliance for Independent Living (SAIL) on numerous constituent cases; I also reached out to Sally Conway at the U.S. Department of Justice, who I consider an ADA guru- *Community & Constituent Services*
- Yes. In my previous employment, our mission was to hire individuals with disabilities and help them to have a productive life- *Grants*
- Yes. We have a handicap station that is manned at all times by a member of the staff to attend to people with disabilities- *Treasurer's*
- Yes. All of our officers receive the required state amount of training in dealing with people- *Sheriff's Operations*
- Yes. One of my staff has experience- *Public Information & Special Projects*
- Yes. Some of our customers have disabilities, our payment window is wheelchair accessible- *Utilities*

#### **Recommendation(s):**

##### **1. Provide sensitivity training.**

#### **C4. Does your department emergency evacuation plan reflect assisting any people with disabilities? Please describe.**

- Yes. If elevators are reasonably believed to not be imperiled by fire, and the electrical system is not compromised, the elevator may be used to evacuate the handicapped to

the first floor. If the elevators are not available, the individual will need to be helped down the stairs in the safest means possible- *Office of Emergency Management*

- Yes. Newly hired staff, typically document technicians, that run the front desk are oriented in the process of evacuating the lobby area during an emergency situation and to assist anyone that may have a difficult time understanding or being able to evacuate in a timely manner. The emergency devices such as fire extinguishers, AED and stairway assistance devices are pointed out in the area- *HHS- Court Compliance*
- I do not know. We recently moved into the Government Center. Staff was trained on what door to go out and where to meet during a fire drill or other emergency evacuation- *Animal Control and Codes Enforcement*
- Yes. Facilities Staff response to emergency when it comes to the buildings- *Facilities, Parks & Vector Control*
- No. I believe there should be a plan posted adjacent to the emergency exit plan- *Grants*
- Yes. Take them to the assigned area- *Payroll and Accounts Payable*
- Yes. As prescribed by County- *Sheriff's Office Operations*
- No. We would create a plan in the event a person with disabilities were on our staff and subject to participation in a departmental evacuation- *Public Information & Special Projects*
- Yes. The department doesn't have a specific plan, we have a County plan that we follow- *Utilities*

#### **Recommendation(s):**

**1. Disabled Occupants** - If a disabled occupant is unable to exit the stairs from the second floor, they should wait for emergency response personnel at the Disabled Rescue Area. This area is located between the stairways on the second floor in the rotunda and has been identified by our fire department. Transporting of disabled individuals up or down stairwells should be avoided unless imminent life-threatening conditions exist. A more comprehensive plan for the government center is in the process of being prepared.

**D1. If there are forms that are required for the admission process to the program(s), please attach them.**

- Ride Along procedures and application.doc- *Animal Control & Codes Enforcement*

#### **Recommendation(s):**



**1. For the ACO & Codes ride along application, include required wording that needs to be included on all communication notices for public services, activities, and programs.**

**D2. & D3. Do you provide transportation to volunteers, program participants, visitors, etc? List and describe.**

- Transportation for OEM volunteers and medical reserve corp volunteers during supporting events- Office of Emergency Management
- Through a contract with Las Cruces Transportation for safe rides home for people that have consumed alcohol- *HHS- Program Operations*
- Our division offers a ride a long program as education to community- *Animal Control & Codes*
- Fire volunteers have a wide variety of county units they drive; engines, trucks, brush trucks, tenders and SUVs- *Fire Administration*
- Transportation of visitors to tour community centers and colonias. In the past we have provided transportation to participants and volunteers but we no longer do this- *HHS- Outreach & Education*
- When transportation is needed we use the office vehicles- *Flood*

**D4., D5. & D6. Do you use consultants or vendors to conduct programs on behalf of your department? If yes, do your department contracts reflect ADA compliance language from service providers/contractors? How do you monitor consultants/vendors to ensure compliance?**

- Yes. Yes. Contract department reviews all contracts for proper language prior to signing- *Airport*
- Yes. It is listed in Section 1, Article 9 of the contract template the County has in place. Program Operations staff and other HHS assigned staff perform random spot checks and scheduled site visits. This helps open up conversation to any issues vendor may be having and we can offer assistance or information if needed. Also if any issues are brought to light from a consumer or other they can be discussed and together we can come up with a plan of action if needed- *HHS Court Compliance*
- Yes. ADA is referenced in Section 1, which is the standard language provided by the Purchasing Office. Monthly reports, site visits, and public input- *HHS Program Operations*
- Yes. Yes. Do not have process for this specific compliance with ADA, have process for service compliance with contracts- *Animal Control & Codes Enforcement*

**D7. Does your department organize special events or do you help facilitate special events?**

- Have gone to County-sponsored information fairs- *Probate*
- Equipment Roadeo skills test (only open to government entities)- *Engineering & Roads*
- Emergency Action Planning for special events- *Office of Emergency Management*
- Roadside cleanups with school groups- *Animal Control & Codes Enforcement*
- Some fire districts host special events- *Fire Administration*
- Most of the events we plan, I guess, are considered special. They are mentioned above in question number seven- *Community & Constituent Services*
- When we have public meeting to discuss projects we work with the facilities department to obtain the meeting space- *Flood*
- We assist with Community & Constituent services events that are open to the public- *Grants*
- Public meetings with the Sheriff- *Sheriff's Operations*

**Recommendation(s):**

**1. Ensure all departments that organize special events are aware of ADA accessibility requirements. Request departments contact ADA Coordinator prior to event.**

**D8. Does your department contract with others to offer special events on County property?**

- Air shows, aircraft display, cross-county run- *Airport*
- Medical providers offer classes and some services at community centers- *HHS Program Operations*

**Recommendation(s):**

**1. Ensure all departments that contract with others are aware of ADA accessibility requirements. Request departments contact ADA Coordinator prior to event.**

**D9. How do you ensure staff and outside organizations are aware of their obligations to facilitate participation of individuals with disabilities in these special events held on County property?**

- Again, mandatory new employee orientation should cover this- *Probate*
- Training by ADA Coordinator and HR Policy- *Human Resources*



- War Eagle Air museum is primary sponsor of events and they are aware of ADA regulations- *Airport*
- Through County training- *Office of Emergency Management*
- For our division/program, courts mandate individuals to our program and we make accommodations as we see fit depending on the individual- *HHS- Court Compliance*
- Verbally- *Animal Control & Codes Enforcement*
- We do not- *Fire Administration*
- We have never been asked to do this- *Flood*
- Training- *Facilities, Parks & Vector Control*
- Information is delivered prior to the start of an event- *Grants*
- Yearly training- *Sheriff's Operations*
- The County offers training- *Public Information & Special Projects*
- No process is used- *Utilities*

**Recommendation(s):**

**1. Continue ADA training at new hire orientation and continue periodic training.**

**E1. & E2. Does your department allow the public to use electronic equipment such as copy machines, personal computers, etc? If yes, how do you ensure that the equipment is accessible to individuals with disabilities?**

- We have public computers available. We have never had any complaints but this is good to get trained on and make sure it is accessible- *HHS- Outreach & Education*
- Title companies use the copier. The public use computers provided to them in our records room (vault). We also have a customer service desk outside the vault to assist- *Clerk's Recording & Filing*

**Recommendation(s):**

**1. Ensure these areas are aware of the obligation to provide accessibility when requested.**

**E3. Does your department provide any auxiliary aids to assist individuals with disabilities? List and describe.**

- Voting machines are ADA accessible and have auxiliary ports for disabled voters to plug their equipment in to- *Clerk's Bureau of Elections*



- They are available if requested but are not maintained or owned by the HR department- *Human Resources*
- TTY- *Office of Emergency Management*
- If auxiliary aids are requested, we would contact Meg Haines and discuss the request with her- *Community & Constituent Services*

**E4. & E5. Does your department work with any outside agency/organization that assist individuals with disabilities? List and describe.**

- Yes for translation services (e.g. sign language)- *Human Resources*
- Often through our referrals to treatment (alcohol/substance abuse or domestic violence counseling or programs) other agencies may come in to play to assist if disability is identified or are in play if offender already has services with other agencies- *HHS- Court Compliance*
- Medical providers and other social services agencies, including the State of New Mexico- *HHS- Program Operations*
- Our office works with and refers constituents to a variety of external agencies that assists individuals with disabilities; such as the New Mexico Health Department and the Disability Rights of New Mexico to name a few- *Community & Constituent Services*
- We work with a variety of outside organizations and entities. I have no list to provide- *Public Information & Special Projects*

**Overall Findings**

- Overall, employees understand to contact the ADA Coordinator for any specific requests or complaints.
- Continue periodic training to ensure DAC's programs, activities, and services are accessible.
- Conduct sensitivity training in Detention and DASO.
- Periodically send out information on required wording for public events.

## **Appendix I**

# **Doña Ana County Self-Evaluation Public Outreach**



**DOÑA ANA COUNTY**  
**HUMAN RESOURCES DEPARTMENT**

*845 N. Motel Blvd. Las Cruces, New Mexico 88007 (505) 647-7210*

April 24, 2017

NAME  
TITLE  
COMPANY  
ADDRESS  
ADDRESS

Dear :

Doña Ana County is conducting a self-evaluation study of all county-owned facilities and programs for compliance with the Americans with Disabilities Act (ADA). Title II of the ADA requires that each of the County's services, programs, and activities be readily accessible and usable by individuals with disabilities. Title II also requires public outreach to the community, especially persons with disabilities, and advocacy groups for the disabled to solicit their input in identifying and offering corrective measures to ensure accessibility.

The County is asking for your comments in identifying any barriers that may exist for persons with disabilities to access county-sponsored facilities or programs. Comments may be submitted to Meg Haines, EEO Specialist/ADA Coordinator through e-mail at [megh@donaanacounty.org](mailto:megh@donaanacounty.org) or through mail at 845 N. Motel Boulevard, Las Cruces, NM 88007. Additionally, Doña Ana County has regular meetings of the Doña Ana County ADA Advisory Committee and comments are welcome during public input. To sign up to receive e-mail notification of ADA Advisory Committee Agendas, please visit the following Website: <https://www.donaanacounty.org/Notifications-Instructions>.

All comments received for the self-evaluation study will be reviewed, considered, and may be included in the final document. Please feel free to pass this information to others who might be interested in providing input. The comment period will be open from April 24, 2017 through May 12, 2017.

Doña Ana County will ensure effective communication with individuals with disabilities and will, upon request, provide auxiliary communication aids and services to afford those individuals equal opportunity for participation in Doña Ana County sponsored meetings, events, or activities. Any request should be made to the Americans with Disabilities Act Coordinator, in writing, or by phone, at least two business days prior to the event at which accommodation is needed. If you have any questions regarding examples of reasonable accommodations, please contact the ADA Coordinator, at 525-5884 (voice) or 525-2951 (TTY), 845 N. Motel Blvd., Las Cruces, NM 88007.

Thank you for your consideration. I look forward to your comments.

Sincerely,

Meg Haines, EEO Specialist/ADA Coordinator  
Doña Ana County



<b>Public Outreach for Self-Evaluation Letter - Mailing List</b>		<b>4/12/2017</b>		
<b>Entity</b>	<b>Person</b>	<b>Title</b>	<b>City</b>	
1 Tresco	Gail Estell	VP of Administrative Services	Las Cruces	
2 Division of Vocational Rehabilitation	Shirley Gonzales	Program Director	Las Cruces	
3 The Ability Center for Independent Living	Albert Montoya		Las Cruces	
4 The Beloved Community	Kay Lilley	Project Manager	Las Cruces	
5 Department of Health-Developmental Disabilities Supports Division	Deborah Lassiter	Community Inclusion Coordinator	Las Cruces	
6 Disability Rights New Mexico	Minnie Montoya	Advocate	Las Cruces	
7 New Mexico Commission for Deaf and Hard of Hearing	Sandra Williams	Las Cruces Field Office Coordinator	Las Cruces	
8 New Mexico Commission for the Blind	Edwardo Lizarraga		Las Cruces	
9 Blinded Veterans	Terry Kebbel	N/A	N/A	
10 GISD-Special Education	Randall Rapanut	Director of Special Education	Anthony	
11 State of NM Governor's Commission on Disability	Karen Peterson	Director	Santa Fe	

Content brought to you by:



# Doña Ana County 'Your Partner in Progress'



### Taking the DARE

Doña Ana County Sheriff's Department Deputy Jamar Cotton places a ribboned pendant on Loma Linda Elementary student Kayla Melendrez, who was among 49 students who graduated April 21 from the 10-week Drug Abuse Resistance Education curriculum at her school. Kayla will represent her school at the state DARE conference this summer. The DARE program is part of Doña Ana County Sheriff Kiki Vigil's on-going community outreach initiative.



## Control mosquitoes now!

The monsoon and irrigation seasons are getting underway in Doña Ana County. Large-area irrigation reaches a peak with the scheduled water releases. Each year, Doña Ana County Vector Control partners with farmers to prevent standing open water, where mosquitoes can breed. The farmers assist by keeping drains, ditches, and culverts free of weeds and trash to facilitate proper drainage.



Safe and effective products to treat mosquitoes are available at all major hardware stores. Large, unused swimming pools are easy to treat with floating discs that release a chemical to prevent mosquitoes from breeding successfully. Rainwater cisterns should be screened or regularly treated to prevent breeding.

Vector Control personnel also work in residential neighborhoods, and offer a range of educational support to help residents avoid standing water in flower pots with deep saucers, trash barrels and old tires. Large areas of standing water can be reported to (575) 526-8150 for inspection and treatment.

Vector Control personnel advise that water in children's wading pools should be kept fresh to dissuade mosquito breeding. Livestock watering troughs can be treated with various mosquito-control products.

Natural mosquito control in ponded water can also be controlled with gambusia minnows. Deep-water rain ponds and backyard fountains can be stocked with minnows that eat mosquito larvae. Doña Ana County provides free minnows to residents who visit the minnow ponds at 4605 West Picacho Avenue. Vector staff is onsite Tuesday mornings from 8-10 a.m. to bag fish for residents who want them. It's advised to bring a bucket to prevent leaks in transport.

Mosquitoes are most active in early mornings or evenings, and they're attracted to light. Residents are advised to use effective repellents to reduce the risk of mosquito bites.

## Comment period open for ADA accessibility input

Doña Ana County is conducting a self-evaluation study of all county-owned facilities and programs for compliance with the Americans with Disabilities Act (ADA).

Title II of the ADA requires that each of the county's services, programs and activities be readily accessible and usable by individuals with disabilities. Title II also requires public outreach to the community—especially persons with disabilities and advocacy groups for the disabled—to solicit input in identifying and offering corrective measures to ensure accessibility.

The county is asking for comments in identifying any barriers that may exist for persons with disabilities to access county-sponsored facilities or programs.

Comments may be submitted to Meg Haines, EEO Specialist/ADA Coordinator through e-mail at [megh@donaanacounty.org](mailto:megh@donaanacounty.org) or through mail at 845 N. Motel Boulevard, Las Cruces, NM 88007.

Additionally, Doña Ana County has regular meetings of the Doña Ana County ADA Advisory Committee, and comments are welcome during public input. To sign up to receive e-mail notification of ADA Advisory Committee Agendas, please visit the following Website: <https://www.donaanacounty.org/Notifications-Instructions>.

All comments received for the self-evaluation study will be reviewed, considered, and may be included in the final document. Please feel free to pass this information to others who might be interested in providing input. The comment period will be open until May 12, 2017.

Doña Ana County will ensure effective communication with individuals with disabilities and will, upon request, provide auxiliary communication aids and services to afford those individuals equal opportunity for participation in Doña Ana County sponsored meetings, events, or activities. Any request should be made to the Americans with Disabilities Act Coordinator, in writing, or by phone, at least two business days prior to the event at which accommodation is needed.

For more information, call 525-5884 (voice) or 525-2951 (TTY).

JOIN US ON SOCIAL MEDIA!



May 5, 2017

Visit our award-winning website at [www.donaanacounty.org](http://www.donaanacounty.org), or contact us at (575) 647-7200

L17-03786





## Comment period open for ADA accessibility input

Doña Ana County is conducting a self-evaluation study of all county-owned facilities and programs for compliance with the Americans with Disabilities Act (ADA).

Title II of the ADA requires that each of the county's services, programs and activities be readily accessible and usable by individuals with disabilities. Title II also requires public outreach to the community – especially persons with disabilities and advocacy groups for the disabled – to solicit input in identifying and offering corrective measures to ensure accessibility.

The county is asking for comments in identifying any barriers that may exist for persons with disabilities to access county-sponsored facilities or programs.

Comments may be submitted to MegHaines, EEO Specialist/ADA Coordinator through e-mail at [megh@donaanacounty.org](mailto:megh@donaanacounty.org) or through mail at 845 N. Motel Boulevard, Las Cruces, NM 88007.

Additionally, Doña Ana County has regular meetings of the Doña Ana County ADA Advisory Committee,

and comments are welcome during public input. To sign up to receive e-mail notification of ADA Advisory Committee Agendas, please visit the following Website:

[https://www.donaanacounty.org/ Notifications-Instructions](https://www.donaanacounty.org/Notifications-Instructions).

All comments received for the self-evaluation study will be reviewed, considered, and may be included in the final document. Please feel free to pass this information to others who might be interested in providing input. The comment period will be open until May 12, 2017.

Doña Ana County will ensure effective communication with individuals with disabilities and will, upon request, provide auxiliary communication aids and services to afford those individuals equal opportunity for participation in Doña Ana County sponsored meetings, events, or activities. Any request should be made to the Americans with Disabilities Act Coordinator, in writing, or by phone, at least two business days prior to the event at which accommodation is needed.

For more information, call 525-5884 (voice) or 5252951 (TTY).



April 25, 2017

**COUNTY ADA COORDINATOR SEEKS COMMENTS**

Doña Ana County is conducting a self-evaluation study of all county-owned facilities and programs for compliance with the Americans with Disabilities Act (ADA). Title II of the ADA requires that each of the County's services, programs, and activities be readily accessible and usable by individuals with disabilities. Title II also requires public outreach to the community, especially persons with disabilities, and advocacy groups for the disabled to solicit their input in identifying and offering corrective measures to ensure accessibility.

The County is asking for your comments in identifying any barriers that may exist for persons with disabilities to access county-sponsored facilities or programs. Comments may be submitted to Meg Haines, EEO Specialist/ADA Coordinator through e-mail at [megh@donaanacounty.org](mailto:megh@donaanacounty.org) or through mail at 845 N. Motel Boulevard, Las Cruces, NM 88007. Additionally, Doña Ana County has regular meetings of the Doña Ana County ADA Advisory Committee and comments are welcome during public input. To sign up to receive e-mail notification of ADA Advisory Committee Agendas, please visit the following Website: <https://www.donaanacounty.org/Notifications-Instructions>.

All comments received for the self-evaluation study will be reviewed, considered, and may be included in the final document. Please feel free to pass this information to others who might be interested in providing input. The comment period will be open from April 24, 2017 through May 12, 2017.

Doña Ana County will ensure effective communication with individuals with disabilities and will, upon request, provide auxiliary communication aids and services to afford those individuals equal opportunity for participation in Doña Ana County sponsored meetings, events, or activities. Any request should be made to the Americans with Disabilities Act Coordinator, in writing, or by phone, at least two business days prior to the event at which accommodation is needed. If you have any questions regarding examples of reasonable accommodations, please contact the ADA Coordinator, at 525-5884 (voice) or 525-2951 (TTY), 845 N. Motel Blvd., Las Cruces, NM 88007.

\*\*\*\*\*

Reporters seeking more information or interviews may call county Public Information Director Jess Williams at (575) 525-5801.

## **Appendix J**

# **Doña Ana County ADAAC Notification Distribution List**





## **Appendix K**

### **Job Accommodation Network (JAN)**

### **Snap Tool Results**

**Result Key:**

**GREEN:** This element passes online accessibility recommendations.

**YELLOW:** This element needs improvement to pass online accessibility recommendations.

**RED:** This element fails online accessibility recommendations.

**URL:** <https://careers-donaanacounty.icims.com>, <https://internal-donaanacounty.icims.com>

**Tester:** LR

**Date:** 04/18/17

STEP #	RESULT	STEP DESCRIPTION	RELEVANCE OF THIS STEP
1	GREEN	Does the site allow navigation with screen reading software?	Screen reading software provides computer access for users who are blind or who have low vision. The software reads aloud all text information on the computer screen while the user listens through speakers or headphones. For a site to be fully accessible and usable, it needs to be compatible with screen reading software so the user can hear all of the content on the site.
2	GREEN	Does the site provide text alternatives for all non-text content?	Non-text content (e.g., charts, diagrams, pictures, animations, image maps, submit buttons) should be made accessible using a text alternative, or description of the meaning of the object. Text alternatives are a primary way for making information accessible because they are convertible into other forms people need, such as large print, Braille, speech, symbols, or simpler language conveying the intent of the object to those who cannot see it. For example, people who cannot see a picture can have the text alternative read aloud by their screen reading software.

STEP #	RESULT	STEP DESCRIPTION	RELEVANCE OF THIS STEP
3	n/a	Does the site provide accessible multimedia (audio/visual (A/V) or alternatives) that allow users to understand the content?	For individuals who have difficulty perceiving visual or audio content, it is essential to provide captions, text alternatives, audio descriptions, and other alternatives. For individuals who are blind or have low vision, assistive technology (AT) can read text alternatives aloud, present them visually, or convert them to Braille. Accompanying audio description can also be a helpful alternative to video content. For people who are deaf or hard of hearing, text alternatives and captions properly synchronized with the main content can convey all of the audio information (including dialogue, identification of the speaker, and meaningful sound effects).
4	GREEN	Does the site use other means of conveying information besides color?	People with partial sight often experience limited color vision, and many older users do not see color well. People using text-only, limited-color, or monochrome displays and browsers are unable to access information presented only in color. Therefore, color should not be the only visual means of conveying information, indicating an action, prompting a response, or distinguishing a visual element (e.g., "required fields are red" or "Bill's sales are in red, Nancy's are in blue"). Providing the information conveyed with color through another visual means without color insures users who cannot see color can still perceive the information.
5	n/a	Does the site allow users to lower the volume or completely turn off any background audio content?	Individuals who use screen reading software can find it difficult to hear the speech output of their device if there is other audio playing at the same time. This difficulty worsens when both audio outputs have the same volume control as the overall computer sound. Therefore, it is important that the user be able to pause, stop, turn off, or lower the volume of the background sound while still listening to the screen reader.



STEP #	RESULT	STEP DESCRIPTION	RELEVANCE OF THIS STEP
6	GREEN	Does the site allow navigation by a user who does not use a mouse?	Wherever possible, content should be able to be accessed through a keyboard only. When content is accessible via a keyboard, it can be accessed by people with no vision who cannot use devices such as mice that require eye-hand coordination, as well as by people who must use alternate keyboards or input devices that act as keyboard emulators. Keyboard emulators include speech input software, sip-and-puff software, on-screen keyboards, scanning software, and a variety of other assistive technology (AT) tools.
7	GREEN	Does the site provide users with enough time to read, understand, and interact with online content?	All users must be given adequate time to read, understand, and interact with online content. People with disabilities such as blindness, low vision, dexterity impairments, and cognitive limitations may require more time to read content or perform functions such as filling out online forms. If there is a time limit associated with a particular function, it could be difficult for some users to perform the required action before the time limit occurs. Examples of time limits include partial or full updates of content (e.g., page refresh), changes to content, or the expiration of a window of opportunity for a user to react to a prompt for input. Animated, moving, or scrolling content also introduces a time limit on a user's ability to read content because the content may move at a rate beyond the user's ability to read and/or understand it.
8	GREEN	Does the site avoid content that flashes or blinks too quickly?	Any elements that flash, flicker, or blink more than three times during any one second period may induce seizures. Regardless of flash speed, these elements may also present accessibility challenges for users with low vision.
9	GREEN	Does the site allow the default human language of each page to be programmatically determined?	Allowing the default language to be programmatically determined allows greater ease of use for users who rely on Braille translation software and speech synthesizers and allows easier access to dictionary tools that a user may need to consult.

STEP #	RESULT	STEP DESCRIPTION	RELEVANCE OF THIS STEP
10	GREEN	Does the site present content in an organized manner that avoids unexplained changes in context?	<p>Content is often more accessible when it is presented in a predictable order from page to page and when the functional and interactive components of a site operate predictably. Users with cognitive limitations may become confused if components appear in different places on different pages. Placing repeated components in the same relative order within a set of pages allows users with reading disabilities, for example, to focus on an area of the screen rather than spending additional time decoding the text of each link. It also makes the content more understandable for users with screen readers and screen magnifiers. Anytime a link could change the context of a page, such as opening a new window, it should be explained in advance with adequate cues (e.g., "clicking here will take you to our corporate diversity page") so as to avoid the disorienting and confusing effects of an unexpected and unexplained change in context.</p>
11	GREEN	Does the site help users avoid and correct mistakes?	<p>Individuals with certain types of disabilities may have more difficulty avoiding mistakes, particularly when interacting with items such as online forms. For any part of a site that requires input from the user, there should be adequate instructions, labels for the form fields, and cues for entering information, such as a selection of the available choices (if applicable) or examples of expected data formats. For input in a required form field such as "Date of Birth," labels should clearly indicate that the field is "Required" and that it calls for the inputting of "Date of Birth," and there should be information on the expected data format (that the date must be in the "MM/DD/YYYY" format, for example). For users who have difficulty noticing error messages or understanding their errors, it is important that error messages be noticeable and provide the user with sufficient guidance to re-enter the information correctly.</p>



STEP #	RESULT	STEP DESCRIPTION	RELEVANCE OF THIS STEP
12	RED - Skip link is present and visible when focused, but leads back to main content of site, not of current page	Does the site allow users to skip repetitive content?	For individuals who use screen readers and/or who only navigate sites with the use of a keyboard, the content on pages appears sequentially, often in a top-to bottom, left-to-right fashion. Because sites typically have repeated blocks of content, such as navigation links, header graphics, or advertising frames, a method to skip the recurring content should be included in the site design. This ensures that those with visual disabilities do not have to listen to and those using keyboards do not have to tab through this type of content repeatedly as they navigate the site.
13	GREEN	Does the site provide fully accessible PDFs, PowerPoint documents, and online forms?	PDF and PowerPoint documents may be inaccessible to users with disabilities (particularly those who rely on screen readers) if they are not developed in the correct manner.
14	GREEN	Does the site display the company's equal employment opportunity (EEO) policy statement?	The EEO statement sets out the company's stated position with regard to its legal obligations and desire to employ individuals with a wide array of backgrounds and abilities.
15	GREEN - It doesn't appear that the accommodation request form leaves room for accommodations in applying for the job. A best practice would be to include an email address with the listed phone number for individuals who experience limitations in telephone use.	Does the site explain to people with disabilities how they can get help using it and where to get reasonable accommodation if they cannot apply online?	The site should present information for how people with disabilities who may rely on assistive technology (AT) or need assistance navigating the site can request assistance using or navigating it. If the site is not fully accessible it should present instructions for how a person with a disability can request a reasonable accommodation in the application process. This information should be included in the EEO policy statement addressed in Question 14.



## **Appendix L**

# **Doña Ana County Road Inventory 2017**

DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
1st	Street													
2nd	Street			3/4	Town of Organ	0.19	0.03	0.19	0.03	0.22	Paved & Unpaved	Telephone Pole	Unknown Point	yes
3rd	Street			3/4	Town of Organ	0.13	0.02	0.13	0.02	0.15	Paved & Unpaved	Telephone Pole	Highway 70	yes
4th	Street			4	Town of Organ	0.22	0.55	0.22	0.55	0.77	Paved & Unpaved	Highway 70	Route 26	yes
5th	Street			4	Town of Organ	0.21	0.04	0.21	0.04	0.25	Paved & Unpaved	Highway 70	Telephone Pole	yes
A	Street			3/4	Town of Organ	0	0.2	0	0.2	0.2	Paved	A Street	Telephone Pole	yes
A. J. Miller	Road				Town of Organ	0.22	0	0.22	0	0.12	Paved	5th Street	Private Drive	yes
A. G.'s	Court					0.12	0	0.12	0	0	Unpaved	Remington	Charles Russell	yes
Abanico	Place					0	0	0	0	0	Unpaved			no
Abbey	Road					1	0	1	0	0	Paved	Lechuga		no
Aberdeen	Way				4 Cattleland Estates	0	0.26	0	0.26	0.26	Unpaved	B-048 Sign	Sales Road	yes
Abeyta	Circle			1		0.11	0.11	0.11	0.11	0.11	Unpaved	Longhorn Blvd.	Highway 70	yes
Abeyta	Road			1	Dona Ana	0.63	0	0.63	0	0.63	Paved	Abeyta Rd	Joe Gutierrez	yes
Abiding	Place			4		0	0	0	0	0	Unpaved	El Torto	graveyard	yes
Abraham	Avenue			1		0	0	0	0	0	Unpaved	Blair Canyon		no
Acacia	Road			3	Las Alturas Subdivision	0.46	0.17	0.46	0.17	0.63	Paved & Unpaved	Grand Ave	End of road	no
Academy	Court			1	Coronado Ridge	0.18	0	0.18	0	0.18	Paved	Telbrook	Soito	yes
Acala	Street			3	South Park Subdivision	0.1	0	0.1	0	0.1	Paved	Constitution	Cul-de-sac	no
Acelunas	Lane			1		0	0	0	0	0	Paved	Carver Rd		yes
Achenbach Canyon	Road			3	Talavera Subdivision	0	0.19	0	0.19	0	Unpaved	NM228	end of road	no
Addington	Road			3		1.21	0	1.21	0	1.21	Paved	Soledad Canyon	Highway 85	yes
Adobe	Lane			1	Adobe Acres	0.16	0	0.16	0	0.16	Paved	Highway 28		yes
Adrian	Road			2	Charles F. Davis Subdivision	0	0.24	0	0.24	0.24	Unpaved	Oasis	El Paseo	yes
Aerosmith	Lane			4	Kissiah Parrigin	0	0.09	0	0.09	0	Unpaved	NM 292		no
Aflon	Road			1/2		11.24	2.36	11.24	2.36	13.6	Paved & Unpaved	Parrigin Way	Montes Road	yes
Aggie Rodeo	Drive			3		0	0	0	0	0	Unpaved	B-007		no
Agua Fria	Street			3	Valle Del Rio Subdivision	0.06	0	0.06	0	0.06	Paved	Dripping Springs	Rio Dorado Drive	no
Agulia	Street			2	Town of La Union	0	0.13	0	0.13	0	Paved	Valle del Rio	Alvarez	yes
Aire	Drive			2	Desert Aire Estates	0	0.81	0	0.81	0.81	Unpaved	Sentenario	Shiprock	yes
Airport	Road			2		1.32	0	1.32	0	1.32	Paved	War Road	airport	yes
Alamo	Court			2		0	0	0	0	0	Unpaved	A-17	N. of Borderland	no
Alamo Mine	Trail			3	Talavera Subdivision	0	0	0	0	0	Unpaved	Ada		no
Alamo Seco	Road			2		0	0.07	0	0.07	0	Unpaved	Soledad canyon		no
Alargo	Drive			1	Alto de Las Flores	0.48	0	0.48	0	0.48	Paved	Montana Azul	end of road	no
Albidrez	Street			1	Placitas	0.16	0	0.16	0	0.16	Paved	NM 28	End of Pavement	yes
Aldaz	Road			1		0.75	0	0.75	0	0.75	Paved	Route 26	6th Street	yes
Alegria	Court			2		0	0.08	0	0.08	0	Unpaved	Opitz Road	Joy Road	yes
Alejandra	Road			1		0	0	0	0	0	Unpaved	B-49		no
Alejo	Lane			1	Kilgore Subdivision	0.13	0	0.13	0	0.13	Paved	Calle Hojas	Bluestem	no
Alexander	Lane			2	De Lara Estates N. Unit 2	0.23	0	0.23	0	0.23	Paved	Saltbush	Sunny Sands	yes
Alfalfa	Road			5	Mesilla Acres	0.34	0	0.34	0	0.34	Paved	Edna		yes
Alhambra	Court			1	Picacho Hills	0.06	0	0.06	0	0.06	Paved	Camino Blanco	Center of Court	yes
Aliyah	Road			5		0.31	0	0.31	0	0.31	Paved	Mayfield		yes
Alluvial	Lane			2		0	0	0	0	0	Unpaved	McNitt		no
Alma	Road			3		0	0	0	0	0	Unpaved	Wind Dancer	end of road	no
Aloe Vera	Lane			1		0	0	0	0	0	Unpaved	Picacho		no
Alpine	Court			3	Blair Canyon Acres No.4	0	0.09	0	0.09	0	Unpaved	Porcupine		no
Alta Mira	Court			1	Sharrn Doren Estates	0	0.1	0	0.1	0	Unpaved	Valley Vista Dr.	Cul-de-sac	no
Alta Vista	Drive			3		0	0.42	0	0.42	0	Unpaved	Rim Rock	Buenos Diaz	no
Alto Grande	Drive			1	Las Vistas #4	0	0	0	0	0	Paved	Las Vistas	Cul-de-sac	no
Altos	Drive			2	Desert Aire Estates	0	0.34	0	0.34	0.34	Unpaved	Aire	El Centro	yes

DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
Alvarez	Road				2 Town of La Union	3.99	0.94	3.99	0.94	4.93	Paved and Unpaved	McKnut	Little Rd	yes
Alvillar	Road				1 Mirasol II-C	0.45	0	0.45	0	0.45	Paved	Fence Line	D-028	yes
Amapola	Court				4 Mirasol Subd. Phase #2A	0.7	0	0.7	0	0.7	Unpaved	Amanil del sol	Camino de Flores	yes
Amarillo Del Sol	Drive				4 Kissiah Parrigin No 10 re#1	0	0.19	0	0	0	Unpaved	Topaz	Millard	no
Amber	Drive				3 Chaparral Subdivision	2.62	0	2.62	0	2.62	Paved	Dripping Springs	Lisa Drive	no
Amistad	Court				4 Amber Mesa	0.03	0.11	0.03	0	0.03	Paved	State Line Drive	Prop. line	yes
Amstar	Road				5 Rancho Del Gallo Unit	0.03	0.44	0.03	0.44	0.44	Unpaved	Church Street	Cul-de-sac	yes
A-Mountain	Road				2 Enchanted Hills Subdivision	0	0.44	0	0.44	0.44	Unpaved	Eagle Pass	Cul-de-sac	yes
Amparo	Road				3 Anazasi Estates	0.36	0	0.36	0	0.36	Paved	Angel Fire Place	Cul-de-sac	no
Ampere	Avenue				2 Anazasi Estates	0.09	0	0.09	0	0.09	Unpaved	Off Yucca b-51	end of road	no
Ancona	Road				2 Brazito Area	0	0.12	0	0.12	0.09	Unpaved	Delara Dr	Unknown	yes
Andres	Place				2 Angle Wings	0	0.09	0	0.09	0.09	Unpaved	NM 460	Plumeria	no
Angel Fire	Court				2 Angostura	0	0.11	0	0.11	0.25	Unpaved	Route 85	End of Pavement	yes
Angel Fire	Court				1 Ansellia	0	0.25	0	0.25	0.25	Unpaved	Koogel	Plumeria	no
Angie	Lane				4 Antares	0	0.17	0	0.17	0	Unpaved	Moongate	End of Pavement	no
Angie's Dream	Lane				1 Comado Ridge	0.16	0	0.16	0	0.16	Paved	Barcelona Ridge	Cul-de-sac	yes
Angostura	Road				5 Rancho Del Gallo Unit	0.05	0.05	0.05	0.05	0.05	Paved	Catalana Drive	Cul-de-sac	yes
Ansellia	Road				4 Lomada Acres	0.1	0	0.1	0	0.1	Paved	Carlton	Navajo	yes
Antares	Street				1 Vista Robledo 1	0.25	0	0.25	0	0.25	Paved	D-032	Sunland Avenue	yes
Anthem	Road				1 Vista Robledo 2	0.09	0	0.09	0	0.09	Paved	s end	n end	yes
Apache	Drive				1 Vista Robledo 2	0.09	0	0.09	0	0.09	Paved	N Valley Dr	west end	yes
Apache Canyon	Drive				2 Santa Teresa	0.16	0	0.16	0	0.16	Paved	Apache Canyon Court	800' north	yes
Apache Canyon	Drive				3 Desert Mirage	0.13	0	0.13	0	0.13	Paved	Hatch City Line	south end	yes
Apache Gold	Loop				3 Talavera Subdivision	0	0.38	0	0.38	3.95	Unpaved	Soledad canyon	End of road	no
Apache Plume	Court				1 Country Squire Estates	1.02	0	1.02	0	1.02	Paved	Snow Road	Highway 28	yes
Apache Plume	Court				1 U.S.R.S. Tract 4-6B, Replat	0.11	0	0.11	0	0.11	Paved	Union	Highway 28	yes
Apalo	Way				1 Apple Orchard	0.14	0	0.14	0	0.14	Unpaved	Grape Vinyard	End of Road	yes
Apex Mine	Trail				1 Apple Tree	0.17	0	0.17	0	0.17	Paved	N Hwy 85	End of Road	yes
Aplo	Lane				4 April	0	0	0	0	0	Unpaved	Barnert Drive	End of Road	yes
Apodaca	Road				4 Amber Mesa	0	0.07	0	0.07	0.2	Unpaved	Taylor	Bishops Cap Rd	no
Apple Cross	Place				2 High Valley Farms	0	0.2	0	0.2	0.2	Unpaved	Moore Cr	Bishops Cap Rd	yes
Apple Orchard	Lane				1 Arbor	0	0.14	0	0.14	0	Unpaved	Salantia Road	End of Road	no
Apple Tree	Place				1 Archer	0.17	0	0.17	0	0.17	Paved	Alejandra Road	End of Road	yes
Apple View	Place				2 Meadow Vista Subdivision	2.1	0	2.1	0	2.1	Unpaved	Watson	Baja	no
Aquamarine	Place				1 Archer Farm	0	0.12	0	0.12	0.12	Unpaved	Castillo Dr	Lister	no
Arapaho	Way				1 Arco	0	0.13	0	0.13	0.12	Unpaved	Selene Ct	north end	yes
Arbol	Way				2 Arco de Goya	0.39	0	0.39	0	0.39	Paved	Harper	End of Cul-de-Sac	yes
Arbor	Street				4 Arco Iris	0	0.12	0	0.12	0.12	Unpaved	Vista Del Reino	End of Cul-de-Sac	yes
Archer	Road				2 Ardivino	0	0.2	0	0.2	0	Unpaved	Hondo Rd.	End of Cul-de-Sac	yes
Archer Farm	Road				2 Arellano	0	0.2	0	0.2	0	Unpaved	Anthony Dr	Dead End	no
Arquilla	Place				1 Argus	0	0.18	0	0.18	0	Unpaved	Watson	Baja	no
Arco	Place													no
Arco de Goya	Street													no
Arco Iris	Street													no
Ardivino	Road													no
Arellano	Road													no
Argus	Street													no



DAC Road Inventory 2017

3/10/2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Maint
Arizona	Street				1 Pure Water Addition	0	0	0	0	0	0 Unpaved			no
Armaddollo	Lane				2	0	0	0	0	0	0 Unpaved	Barela		no
Armeria	Road				2	0	0.06	0	0	0	0 Unpaved	Singh		no
Armsstrong	Road			1/4/5	4 Arroyo Acres No. 15	0.4	0	0.4	0	0.4	0.4 Paved	El Camino Real	Dona Ana Road	yes
Arrowhead	Road				4	0	0.88	0	0	0	0 Unpaved	McArthur	End of road	no
Arroyo	Road				4 Wagnons East	0.11	0	0.11	0	0.11	0.11 Paved	Weisner	300' east	yes
Arroyo	Road				4 Inspiration Heights Phase 1	0.28	0	0.28	0	0.28	0.28 Paved	Holman Road	0.28 miles east of Holman	yes
Arroyo	Street				4	0.15	0	0.15	0	0.15	0.15 Paved	Las Alturas	C-095	yes
Arroyo	Road				4 Moongate	0	1.95	0	0	0	0 Unpaved	Hanger Lake	0.28 miles east of Holman	yes
Arroyo Cuervo	Court				4 Arroyo Acres No. 15	0	0	0	0	0	0 Paved	Arroyo Rd	Brahman	no
Arroyo Cuervo	Road				1	0	0	0	0	0	0 Unpaved	CR E-42		no
Arroyo Seco	Road				4	0	0.61	0	0	0	0 Unpaved	Durn Dr	End of Road	no
Artesia	Court				5 Brazito Acres, ph 2	0.55	0	0.55	0	0.55	0.55 Paved	NM436	End of pavement	yes
Artifect	Lane				5 Adobe Acres	0.12	0	0.12	0	0.12	0.12 Paved	NM292	End of Road	yes
Ashtray	Road				2	0	0.09	0	0	0	0 Unpaved	CR B-43	End of Road	no
Astor	Drive				3 Pecan Valley Acres	0.27	0	0.27	0	0.27	0.27 Paved	NM 80	Mimosa	yes
Atlas	Street				2 Rocket Valley	0	0	0	0	0	0 Unpaved	Sea Pines Drive	Silverado Drive	yes
Augusta	Drive				2 Viewpointe Subdivision	0.12	0	0.12	0	0.12	0.12 Paved	Arrowhead	Cul-de-sac	no
Aurora	Road				4	0	0.07	0	0	0	0 Unpaved	E-020	Unknown Point	yes
Autumn Fire	Road				1	0.87	0	0.87	0	0.87	0.87 Paved	Palmas St	State line Dr	yes
Autumn Sage (was S) Lane	Drive				2 Colquit Subd	0.3	0	0.3	0	0.3	0.3 Paved	Avenida Creel	End of Pavement	yes
Avenida Chihuahua Pacifico	Drive				2 Santa Teresa Intermodal	0.61	0	0.61	0	0.61	0.61 Paved	Industrial Road	End of Pavement	yes
Avenida Creel	Drive				2 Verde Logistics Industrial P	0.42	0	0.42	0	0.42	0.42 Paved	San Pablo	NM 28	yes
Avenida De Quintas	Drive				3	0.77	0	0.77	0	0.77	0.77 Paved	NM 28	B-041 Sign	yes
Avenida Del Pantleon	Drive				1	0.07	0	0.07	0	0.07	0.07 Paved & Unpaved	Industrial Road	Avenida Chihuahua Pacifico	yes
Avenida Del Sol	Drive				4 Ranchos De Dona Ana Phas	0.6	0	0.6	0	0.6	0.6 Paved	Industrial Road	Avenida Chihuahua Pacifico	yes
Avenida Divisadero	Drive				2 Santa Teresa Intermodal	0.49	0	0.49	0	0.49	0.49 Paved	Industrial Road	Avenida Chihuahua Pacifico	yes
Avenida Mirador	Drive				2 El Mirador Subdivision	0.68	0	0.68	0	0.68	0.68 Paved	Enriquez Road	A-017	no
Aviation	Road				2	0	6.68	0	6.68	6.68	6.68 Unpaved	Enriquez Road	A-017	yes
Avis	Drive				5	0	0.23	0	0	0	0 Unpaved	Carmino Real	Prop. line	no
Aztec	Drive				4	0	0.25	0	0	0	0 Unpaved	Deserwind Way	unknown	no
Aztec	Drive				2	0	0.25	0	0	0	0 Unpaved	Deserwind Way	unknown	no
Azui	Avenue				2 Cielo Dorado	0	0	0	0	0	0 Paved	2nd Street	Dead End	no
B	Street				4 Town of Organ	0.3	0	0.3	0	0.3	0.3 Paved	El Camino Real	Prop. line	yes
B & J	Lane				5	0	0.14	0	0	0	0 Unpaved	Hwy 85 (N)	Hwy 85 (S)	no
B B Romig	Drive				1 Salem	0	0.54	0	0	0	0.54 Paved	Dona Ana Road	Prop. line	yes
Baca	Road				1	3.39	0	3.39	0	3.39	3.39 Paved	Dona Ana Road	Hwy 85 (S)	yes
Bad Archer	Lane				1	0	0.08	0	0	0	0 Unpaved	Diaz Rd	Prop Line	no
Baines	Street				1	0.19	0	0.19	0	0.19	0.19 Paved	Monticello	west end	yes
Baja	Avenue				1	0	0.28	0	0	0	0 Unpaved	Arbor	Argus	no
Baker	Street				1 Rincon	0.09	0	0.09	0	0.09	0.09 Paved	NM 140	End of pavement	yes
Bald Eagle	Court				2 Delara Est. North - #3	0.09	0	0.09	0	0.09	0.09 Paved	Golden Eagle	Cul-de-sac	yes
Baldy Peak	Way				3 Organ Mesa Subd, ph1	0.04	0	0.04	0	0.04	0.04 Paved	Organ Mesa Loop	Cul-de-sac	yes
Bales	Road				1	0	0.37	0	0	0	0 Unpaved	Burke Road	Runalong Rd.	no
Barnert	Drive				1	0.45	0	0.45	0	0.45	0.45 Paved	Picacho	C-051 Sign	yes
Barnigas	Road				1	0	0.08	0	0	0	0 Unpaved	US 85	Property line	yes
Banna	Court				5 San Ban	0.05	0	0.05	0	0.05	0.05 Paved	San Ban	Cul dr Sac	no
Bar B Que	Road				3	0.21	0	0.21	0	0.21	0.21 Paved	Richardson	Center Of Court	yes
Bar Circle M	Road				1	0	0	0	0	0	0 Unpaved	Richardson	Center Of Court	yes
Bar X	Road				3	0.25	0	0.25	0	0.25	0.25 Paved	Richardson	Center Of Court	no
Baraka	Court				3 Blair Canyon Acres #5	0	0.09	0	0	0	0 Unpaved	St. Michael	Center Of Court	yes
Barbia	Lane				2 De Lara Estates	0	0.24	0	0	0	0 Unpaved	Delara	Pine Valley	no
Barcelona Ridge	Road				1 Barcelona Ridge Subd	1.38	0	1.38	0	1.38	1.38 Paved	Picacho Hills Dr	dead end	yes

DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
Barella	Drive			1		1.23	0	1.23	0	1.23	Paved	D-050	Thorpe Road	yes
Barksdale	Loop			4		0	0.55	0	0.55	0	Unpaved	Holman Road	End of road	no
<b>Barred Rock Court</b>	<b>Court</b>			<b>5</b>	<b>Rancho Del Gallo Unit</b>	<b>0.16</b>		<b>0.16</b>			<b>Paved</b>	<b>Catalana Drive</b>	<b>Cul-de-sac east end</b>	<b>yes</b>
Barrel Cactus	Court			4	Desert Mirage II	0.03		0.03		0.03	Paved	Desert Mirage Dr		yes
Barrio	Road			2		0	0.33	0	0.33	0	Unpaved	Three Saints		no
Bason	Drive			1	Mesilla Park	0.25	0	0	0	0	Paved	Capri East	Capri West	no
Bay Club	Drive			2		0	0	0	0	0	Paved	Pinehurst		no
Baylor Canyon	Road			3/4		1.6	5.3	1.6	5.3	6.9	Paved & Unpaved	C-77	Highway 70	yes
Baylor Peak	Road			3		0	0	0	0	0	Unpaved	Baylor Canyon		no
Bear Claw	Road			1		0	0.1	0	0.1	0	Unpaved	Crawford Rd		no
Bedrock	Place			1		0.3	0	0.3	0	0.3	Paved	Mantooth		no
Beehive	Lane			1		0	0.29	0	0.29	0	Unpaved	Desert Wind Way	arroyo ditch	yes
Belen	Place			1		0	0.14	0	0.14	0	Unpaved	Glass Rd.		no
Bella Vista	Place			1		0	0	0	0	0	Unpaved			no
Bellman	Street			2	Meadow Vista Subdivision	0	0	0	0	0	Unpaved			no
Berlino Torres	Street			1	La Mesa	0.29	0.07	0.29	0.07	0.36	Paved & Un	W.of Rosales	San Jose	yes
Benito P. Juarez	Street			1	Rodey	0.14	0.48	0.14	0.48	0.62	Paved & Un	Victor Duran	Cemetery	yes
Berrio Trevino	Road			2		0	0	0	0	0	Unpaved	Desert Wind Way	arroyo	no
Bent Bow	Road			1		0	0.13	0	0.13	0	Unpaved	Anthony Dr		no
Bent Willow	Place			1		0	0.88	0	0.88	0.88	Unpaved	Highway 85	Landfill	yes
Berino School	Road			2		0	0.06	0	0.06	0	Unpaved	Red Rock		no
Berriore	Place			2	Casas Bella De Santa Teres	0	0.25	0	0.25	0	Unpaved	Shrode Rd	Los Olivos	no
Berry	Road			2		0	0	0	0	0	Paved			no
Berry Patch	Avenue			4	Butterfield Park	0.58	0	0.58	0	0.58	Unpaved	Washington Found Ave	Desert Park Road	no
Bertailes	Lane			4		0	0	0	0	0	Paved	Brahman		yes
Berza	Lane			2		0	0	0	0	0	Unpaved			no
Beyer	Road			4		0	0	0	0	0	Unpaved	Lechuga		no
Bienes	Place			4		0	0.35	0	0.35	0	Unpaved	Cortez Dr	Dead end	no
Big Tree	Road			1		0	0	0	0	0	Unpaved	Bleimeyer	End of road	no
Bighorn	Road			1		0	0	0	0	0	Unpaved	Bleimeyer	End of road	no
Bighorn	Street			2		0	0.4	0	0.4	0	Unpaved	Taylor Rd (D-17)		no
Bilbo	Lane			1		0	0.19	0	0.19	0.19	Unpaved	Hwy 478	El Nogal	no
Bi-National	Avenue			2	Santa Teresa	1.09	0	1.09	0	1.09	Unpaved	Mesilla Hills	Private Drive	yes
Bishops Cap	Road			2	High Valley Farms	0	0.24	0	0.24	0.24	Paved	Avenida Casas Grande	Via De Pancho Papen	yes
Black Hills	Rd			3	Talavera	0	0	0	0	0	Unpaved	Arapaho Road	High Valley Rd	yes
Black Quartz	Road			3	Talavera Subdivision	0	0.44	0	0.44	0	Unpaved	Lost Padre	end of road	no
Blackfoot	Road			1	River Court Subdivision	0.02	0	0.02	0	0.02	Unpaved	Soladad Canyon	End of road	no
Blackhawk	Street			3		0.14	0.21	0.14	0.21	0.35	Paved & Unpaved			yes
Blacktail Deer	Avenue			4	Los Venados Estates	0	0	0	0	0	Paved	San Miguel	Fence Line So. San Felipe	yes
Blair Canyon (Organ)	Drive			4	Blair Canyon Acres	0	0.31	0	0.31	0.31	Unpaved	El Camino Real	Sitka Deer Street	no
Blair Canyon Peak	Road			3		0	0.25	0	0.25	0	Unpaved	D-071	Starfly	yes
Blazing Tr.	Road			1	Fort Selden	0	0	0	0	0	Unpaved	Baylor Canyon		no
Bleimeyer	Road			4	Sky View Terrace	0.21	0	0.21	0	0.21	Paved	Desert Edge		no
Blossom	Place			2		0	0	0	0	0.21	Paved	Elks Road	End of Road	yes
Blue Hawk	Road			4		0	0	0	0	0	Unpaved	Vine	End of Road	yes
Blue Jay	Place			1		0	0	0	0	0	Unpaved	NM 28	End of Road	no
Blue Sky	Place			1		0	0	0	0	0	Unpaved	Dona Ana Rd		no
Blue Sky	Lane			2		0	0	0	0	0	Unpaved	NM 478		no
Blue Topaz	Avenue			4	Amber Mesa	0	0.82	0	0.82	0.82	Unpaved	Holman	Grouse Run	yes
Bluewater	Road			4		0	0.82	0	0.82	0.82	Unpaved	Baylor Canyon		no
Bluestem	Drive			1	Kligore Subdivision	0.27	0	0.27	0	0.27	Paved	NM 226	Feathergrass	yes
Bluet	Lane			2		0	0.05	0	0.05	0	Unpaved	Yucca		yes
Bluet	Court			4		0	0.09	0	0.09	0	Unpaved	Kissiah	cul-de-sac	no
Bob Taylor	Court			1		0	0	0	0	0	Unpaved	Frontage rd		no
Bogart	Lane			1	Hales Center	0	0.09	0	0.09	0.09	Unpaved	Cochita	Private Drive	yes

DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
Boggy				3		0.22	0	0.22		0.22	Paved	Lamar	Center of Court	yes
Boling	Lane			1	Linda Vista Estates	0.33	0	0.33		0.33	Paved	Barcelona Ridge	End of pavement	yes
Boone	Circle			2		0.2	0	0.2		0.2	Paved	NM 225 (East)	NM 225 (West)	yes
Borderland	Road			2		1.14	0	1.14		1.14	Paved	McNitt Road	State Line	yes
Borin Queen	Road			4		0	0.11	0		0	Unpaved	Peachtree Hills	End of court	no
Bosque	Road			1/2		1.07	0	1.07		1.07	Paved	Three Saints	Joy Rd	yes
Bosque Farms	Court			5	Brazito Acres, ph 2	0.09	0	0.09		0.09	Paved	Desert Sands		yes
Bougainvillea	Court			3	Desert Mirage	0.08	0	0.08		0.08	Paved	Organ Mesa Loop	cul-de-sac	yes
Boulder Canyon	Court			3	Organ Mesa Subd, ph 1	0.04	0	0.04		0.04	Paved	Boundary Street Sign	Green Meadow Road	yes
Boundary	Street			2	Green Meadow Estates	0.7	0	0.7		0.7	Paved	Taylor Rd (D-17)	End of lane	yes
Bowra	Lane			1		0	0.21	0		0	Unpaved	NM 478		no
Boy	Lane			1		0	0.08	0		0	Unpaved	NM 478		no
Boyer	Road			1		0.33	0	0.33		0.33	Paved	NM 478	NM 478	yes
Bradbury	Court			1	Mesquite	0.06	0	0.06		0.06	Paved	NM 478	Post Street	yes
Braddy	Street			1		0	0.45	0		0	Unpaved	Estanica	Drain	no
Brahman	Road			4	Moongate	1.68	0	1.68		2.29	Paved & Un	Highway 70	Rincon	yes
Brandy	Lane			1		0	0.15	0		0	Unpaved	Barala Rd D-15	Cul-de-sac	no
Bravo	Road			1		0	0.25	0		0	Unpaved	Derest Wind Way	arroyo	no
Breedy Back	Court			1		0	0	0		0	Unpaved	Braddy		no
Breeze	Lane			1		0	0.09	0		0	Unpaved	Southwind		no
Brenna	Court			2		0	0	0		0	Unpaved	Jarmon		no
Brian	Place			1		0.07	0	0.07		0.07	Paved	Shalem Colony	Cul-de-sac	yes
<b>Briareus Drive</b>						<b>0.34</b>	0	<b>0.34</b>		<b>0.34</b>	<b>Paved</b>	<b>Sandy Beach Rd</b>	<b>Cul-de-sac</b>	<b>yes</b>
Bridle Path	Road			1	La Mancha Estates	0.05	0	0.05		0.05	Paved	Route 85	Horseshoe Circle	yes
Bright View	Road			1	Saddle Creek Estates	0	0	0		0	Paved	Vista Del Carro		no
Bristol Grass(was Esp)	Lane			2	Colquilt Subd	0	0.07	0		0.07	Unpaved	Magney	Pampas Grass	yes
Briza	Place			2	Desert Willow MH Park	0	0	0		0	Unpaved	Red Rock		no
Broken Stone	Road			1		0	0	0		0	Unpaved	Soledad Canyon		no
Brook Haven	Court			3	Rios Encantados	0.08	0	0.08		0.08	Paved	Stony Brook Circle	End of Cul-de-Sac	yes
Brothers	Road			2		0.1	0	0.1		0.1	Paved	Gillette RD	El Paso Co. Line	yes
Browning	Road			1	Rodey	0.56	0	0.56		0.56	Paved	Route 140	Route 85	yes
Bryant	Street			3	Mesquite	0.15	0	0.15		0.15	Paved	NM 228	St. Thomas Avenue	yes
<b>Buckeye Place</b>						<b>0.12</b>	0	<b>0.12</b>		<b>0.12</b>	<b>Paved</b>	<b>Plymouth Rock Rd</b>	<b>Cul-de-sac</b>	<b>yes</b>
Buckskin	Loop			2	Santa Teresa #1A	0	0	0		0	Unpaved	El Camino Real	End of Drive	no
Bud way	Lane			1		0	0.1	0		0	Unpaved	Alta Vista		no
Buenos Dias	Court			3		0	0.12	0		0.12	Unpaved	NM 157		no
Buffalo Estates	Road			1		0.52	0	0.52		0.52	Paved	Joy Road	Opitz Road	yes
Bullock	Road			1		0.86	0	0.86		0.86	Paved	Hondo Rd	Tres Yucca	yes
Bumpy	Lane			4		0	0.13	0		0	Unpaved	D-014	Picacho Blvd.	no
Burke	Road			5		1.43	0	1.43		1.43	Paved	Benavidez	High Hopes	yes
Burnut	Road			1		0	0.22	0		0	Unpaved	Holman		no
Bushland	Avenue			4		0	0	0		0	Unpaved	Harper		no
Buster	Place			3		0	0.09	0		0	Unpaved	Byrum Road	Edna Road	no
Buiter Heights	Road			2	Lake Section Subdivision #2	0	0.49	0		0.49	Unpaved	Kildeer	Edgemont Road	yes
Butie	Drive			2	The Bluffs Subdivision	0.22	0	0.22		0.22	Paved	NM 28	Fence Line	yes
Buttercup	Lane			1		0	0.24	0		0.24	Unpaved	Water Tank Fence Line	Private Property Fence	yes
Butterfield	Blvd.			4	Butterfield Park	0.76	0	0.76		0.76	Paved	Vista del Cerro	End of road	no
Butterfield Ridge	Road			1	Butterfield Ridge	0.38	0	0.38		0.38	Paved	Berry Patch		no
Butterfly	Lane			4		0	0.24	0		0.24	Unpaved	Tale Pole At End of Road	Wicker Road	no
Buitonwillow	Place			4		0	0.01	0		0.01	Unpaved	Warring	Carlton	yes
Byrum	Road			2	Lake Section Subdivision	0	1.96	0		1.96	Unpaved			no
C.A. Ridge	Drive			5	Jornada Acres	0.11	0	0.11		0.11	Paved			yes



DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Maint
Cactus Patch	Way			1		0	0.37				0 Unpaved	N Valley		no
Cadena	Street			1	Town of Berino	0.21	0	0.21			0.21 Paved		Fourth Street	yes
Caesar's	Avenue			1	Brentwood Estates	0	0.48				0 Unpaved	La Reyna	Dead End	no
Caifey	Lane			3	Mesilla Park	0	0.05				0 Unpaved	McDowell	End of Road	no
Calabazilla	Drive			3	Las Alturas Subdivision	0.16	0	0.16			0.16 Paved	Telle Poite Before 90° turn	Cholla	yes
Calico	Drive			4		0.11	0.64				0 Paved & Un	Willt Dr	Holman	no
Calle Al Rumbo				2		0	0				0 Unpaved	NIM 28	Dead End	no
Calle Alegre				1		0	0.22				0 Unpaved	Fourth Street	Fourth Street	no
Calle Artesano	Circle			2	Dos Lagos	0	0.06				0	San Jacinto		no
Calle Bambu				1		0	0				0 Unpaved	Burke Road		no
Calle Bedado				5	Bosque Bedado Subd	0.14	0	0.14			0.14 Paved	Parrigin Way	Cul-de-sac	yes
Calle Bronce				4	Kassiah Parrigin #12 rep#1	0	0.08				0 Unpaved	Calle Contento (E)		no
Calle Calmado				1	Casas Escondidas	0.26	0	0.26			0.26 Paved	Coyote	Calle Contento (W)	yes
Calle Chica				4		0	0				0 Unpaved	Parrigin Way		no
Calle Cobre				4	Kissiah Parrigin #12 rep #1	0	0.08				0 Unpaved	Hwy 85	Calle Calmado (E)	no
Calle Contento				1	Casas Escondidas	0.4	0	0.4			0.4 Paved	Harper	Yucca Road	yes
Calle De Brazito				1		0.49	0	0.49			0.49 Paved	Parrigin Way		yes
Calle De Cuarzo				4	Kissiah Parrigin #13	0	0.09				0 Unpaved	Burke		no
Calle De Fira				1		0	0				0 Unpaved	Center of Court	Fence Line N. of Cristo	no
Calle De la Cruz	Street			1	Del Cerro Estates	0.29	0	0.29			0.29 Paved	Alargo	Center of Court	yes
Calle De Las Flores				1	Alto De Las Flores	0.1	0	0.1			0.1 Paved	Watson	Center of Court	yes
Calle De Las Margaritas				3	Dunlap Summary	0.28	0	0.28			0.28 Paved	Calle De Las Flores	NM 28	yes
Calle De Lucero				1	Alto De Las Flores	0.18	0	0.18			0.18 Paved	Chelsea Dr	Center of court	yes
Calle De Oro				5	Golden Valley Acres	0.27	0	0.27			0.27 Paved	Calle De Oro	End of Road	no
Calle De Oso				3	Ames' Acres Subd.	0	0.06				0 Paved	Roadrunner Ln	Culde Sac	yes
Calle De Plata				5	Golden Valley Acres	0.05	0	0.05			0.05 Paved	Dona Ana School Road	Mirsol	yes
Calle De Pompeii				5	Rancho del Coyote Unit 1	0.15	0	0.15			0.15 Paved	CR B-24		no
Calle De Rosas				5	Miraso Subdivision	0.19	0	0.19			0.19 Paved	San Andres Dr (north)	San Andres (south)	yes
Calle De Tonzantzin				4		0	0.11				0 Unpaved	Main Street	Private Property Gate	yes
Calle De Valerquez	Street			2		0	0				0 Unpaved	D-28	Cul-de-Sac	yes
Calle De Vista				1	Mansiones de Galicia Subdi	0.23	0	0.23			0.23 Paved	Hwy 28	end of prmt	yes
Calle De Vista				5	San Elena	0.42	0	0.42			0.42 Paved	NIM 185	0.09 miles west	no
Calle Del Centro				1	Old Picacho	0.1	0.02	0.1	0.02		0.12 Paved & Unpaved	Parrigin Way	Alejandra	no
Calle Del Valle				1	Ranchitos Del Valle #2	0.09	0	0.09			0.09 Paved	East Sloan		no
Calle Delphi				2	Valle Hermoso	0.24	0	0.24			0.24 Paved	Parrigin Way	D-054	no
Calle Escondida				1		0	0				0 Paved	D-103	Private Property	yes
Calle Fiorista				3	Mesilla Park	0.15	0	0.09	0.19		0.25 Unpaved	D-036 Sign		yes
Calle Hierro				4	Kissiah Parrigin #12 rep#1	0	0.08				0 Unpaved	Holman		no
Calle Hojas				1		0	0				0 Unpaved	Visita Del Reino	Cul-de-sac	yes
Calle Lamina				4	Kissiah Parrigin No 9 rep#1	0	0.1				0 Paved	Thurmond	End of Road	yes
Calle Las Lomas				4		0.53	0	0.53			0.53 Paved	Calle Delphi	Cul-de-sac	yes
Calle Las Yonke				4		0.06	0.19	0.06	0.19		0.25 Unpaved	East Organ Rd	Private prop.	no
Calle Linda				4	Kurian Acres	0	0.06				0 Unpaved	Thurmond	Calle Rancho Caballo	yes
Calle Murrillo	Street			4		0	0				0 Unpaved	Mercantile Ave	North End	no
Calle Murrillo				1	Mansiones de Galicia Subdi	0.16	0	0.16			0.16 Paved	Parrigin Way		no
Calle Paraiso				4	Visita Del Paraiso	0.26	0	0.26			0.26 Paved	Del Rey	Center of Court	no
Calle Pequena				2	Valle Hermoso	0.16	0	0.16			0.16 Paved	NIM 28	Center of Court	yes
Calle Picasso				2		0	0.05				0 Unpaved			no
Calle Pico Gemelo				4	Village at Ranchers	0.28	0	0.28			0.28 Paved			yes
Calle Plano	Road			2	Valle Hermoso II	0.17	0	0.17			0.17 Paved			no
Calle Plomo				4	Kissiah Parrigin Subd 11 rep	0	0.09				0 Paved			no
Calle Porton				1	Porton del Norte Subdivision	0	0				0 Paved			no
Calle Princesa				4	Lisa Subd	0	0.09				0 Unpaved			no
Calle Querido				1	Casas Escondidas	0.03	0	0.03			0.03 Paved			yes
Calle Ranchito				1	Ranchitos Del Valle #1	0.08	0	0.08			0.08 Paved			yes

DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Maint
Calle Rancho Caballo						0.18	0	0.18	0	0.18	Paved			no
Calle Sereno	Court				4 Village at Ranchers	0.03	0	0.03	0	0.03	Paved	Mt Baldie St	end	yes
Calle Tenebroso					1 Casas Escondidas	0	0.2	0	0.2	0	Unpaved	Camino Contento	Center of Court	yes
Calle Vista Bella					1	0.03	0	0.03	0	0.03	Paved	Camino Seco	unknown point	no
Callejon De Mechco					1	0	0	0	0	0	Unpaved	Picacho	Cul-de-Sac	no
Calo	Lane				1	0	0	0	0	0	Unpaved	Burke Rd		no
Camargo	Street				2	0	0.54	0	0.54	0	Unpaved	San Ysidro	Joy Rd	no
Camino Alegre					1	0	0	0	0	0	Unpaved	Shorde		no
Camino Atajo		B	50		1	0.42	0	0.42	0	0.42	Paved	NM 28		no
Camino Blanco					see Co Rd B 50	0	0	0	0	0	Paved	Snow Road	B-048	yes
Camino Bonito	Road				1 Picacho Hills	0.56	0	0.56	0	0.56	Paved	Via Norte	Tuscany Dr	yes
Camino De Flores					3 Dripping Springs Subd	0.13	0	0.13	0	0.13	Paved	Mirasol	Edge of Pavement	yes
Camino De Nosotros					1 Mirasol Subdivision	0.14	0	0.14	0	0.14	Paved	Camino Real	Prop. line	yes
Camino de Pavos	Court				1	0	0.14	0	0.14	0	Unpaved	Tres Semdas	end of road	no
Camino Encanto					2 Rancho Rosinante	0.12	0	0.12	0	0.12	Paved	Rosinante Dr.		yes
Camino Entierro					1 La Mesa Grande Subd	0	0.19	0	0.19	0	Unpaved	W. Afton Rd		no
Camino Feliz					1 San Miguel	0	0	0	0	0	Unpaved	Hwy 28	Gate	no
Camino Leon					1 La Mesa Grande Subd	1.55	0	1.55	0	1.55	Paved	Camino Tesoro		no
Camino Nuevo Mejico	Court				3 Tierra Escondida, ph 1	0.13	0	0.13	0	0.13	Paved	Sonoma Ranch S	cul de sac	yes
Camino Santo	Street				1 La Mesa Grande Subd	0.23	0	0.23	0	0.23	Paved	Afton Rd		no
Camino Secreto					1 La Mesa Grande Subd	0	0.31	0	0.31	0	Unpaved	Soledad Canyon	cul desac north	yes
Camino Seguro					3 Solidad Vista Replat 8	0	0.5	0	0.5	0	Unpaved	Camino Blanco		yes
Camino Serena					1 Picacho Hills	0	0	0	0	0	Unpaved	Three Saints	River	no
Camino Sin Buella					2	0	0	0	0	0	Unpaved	Union	Salente	no
Camino Tesoro					1 La Mesa Grande Subd	0	0	0	0	0	Unpaved	Camino Seguro		no
Camp Cody	Trail				1 Buffalo Estates	0.1	0	0.1	0	0.1	Paved	Del Rey		no
Campbell	Rd				1	0	0.34	0	0.34	0	Unpaved	W. Afton Rd		no
Campesino	Court				1 Crossroads Subdivision	0	0.46	0	0.46	0	Unpaved	LB Lindbeck	Cul-de-Sac	yes
Camposanto	Avenue				2 Town of La Union	0.09	0	0.09	0	0.09	Paved	Taylor rd	Grider	no
Camunez	Road				1 San Miguel	0	0.39	0	0.39	0	Unpaved	Burke		no
Canal Bend	Road				3 S. of Mesilla Park	0	0.3	0	0.3	0	Unpaved	Main Street	Telles Street	yes
Canary	Court				1	0	0.1	0	0.1	0	Unpaved	NM 28	Dead End	no
Candelaria	Street				1 Town of Berno	0.21	0	0.21	0	0.21	Paved	Hwy 478		no
Cantabria	Court				1 Barcelona Ridge Subd	0.07	0	0.07	0	0.07	Paved	D-52	end of court	no
Canyon Ct					3 Summit Chase 8&9	0.03	0	0.03	0	0.03	Paved	Fourth Street	NM 226	yes
Canyon Vista	Road				1	0	0.6	0	0.6	0	Unpaved	Barcelona Ridge	Cul-de-Sac	yes
Capital	Drive				2	0	0	0	0	0	Unpaved	Hunters Chase		yes
Capri	Road				3 Mesilla Park	0	0	0	0	0	Unpaved	Soledad		no
Capri Arc	Road				3 Mesilla Park	0	0	0	0	0	Paved	Desert Aire	Capri Arc A	no
Care Bear	Lane				4 Desert Rose Subd	0	0.13	0	0.13	0	Paved	McDowell Road	Capri Arc A	no
Carjac	Road				4	0	0.34	0	0.34	0	Unpaved	Holmen	Tasmania	no
Carlsbad	Court				1 Brazito Acres Ph 2	0.09	0	0.09	0	0.09	Paved	Napolito	Saromi Rd	no
Carlton	Road				4/5 Golden Valley Acres	0.3	0	0.3	0	0.3	Paved	Clovis	Roswell	yes
Carnation	Court				1	0	0.22	0	0.22	0.22	Unpaved	El Camino Real	Dona Ana Road	yes
Carol	Lane				2 De Lara Estates	0.2	0	0.2	0	0.2	Paved	B-030	NM 478	yes
Carol Ann	Court				1 Taylor Farms	0.07	0	0.07	0	0.07	Paved	Delara	Center of Court	yes
Carr	Street				1	0	0	0	0	0	Paved	Route 85		yes
Carriage Hill	Road				1	5.12	0	5.12	0	5.12	Paved	Route 187	Route 187	no

DAC Road Inventory 2017

3/10/2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co.
Carrillo	Court			1	Carrillo Subdivision	0	0.09				0 Unpaved	Hwy 28	End of road	no
Carver	Road			3		1.22	0	1.22			1.22 Paved	Highway 28	Highway 85	yes
Casad	Road			2	Casas Bella De Santa Teres	1.68	0	1.68			1.68 Paved	Alvarez Road	McNutt Road	yes
Casas Bella	Court			2	Casas Bella De Santa Teres	0	0	0			0 Paved			no
Casas Linda	Lane			2	Casas Linda	0	0	0			0 Paved			no
Cascade	Avenue			2	Casas Flores	0.23	0	0.23			0.23 Paved	Sanderling Dr	NM 273 (McNutt)	yes
Castaneda	Road			1	Allo De Las Flores	0.22	0	0.22			0.22 Paved	Nm 28	Fence line	yes
Castile	Court			1	Ranchos de Picachos Ph. 1	0.98	0	0.98			0.98 Paved	Canal Road	Hwy 26	yes
Castillo	Place			1	Ranchos de Picachos Ph. 1	0.1	0	0.1			Paved	Mira Montes	Cul-de-Sac	no
Castillo	Road			1	Castillo Estates	1.56	0	1.56			1.56 Paved	Castillo Dr	Cul-de-sac	yes
<b>Catalana Drive</b>				<b>5</b>	<b>Rancho Del Gallo Unit</b>	<b>0.75</b>	<b>0</b>	<b>0.75</b>	<b>0</b>	<b>0.75</b>	<b>0.75 Paved</b>	<b>Harvey Farm Road</b>	<b>Plymouth Rock Rd</b>	<b>yes</b>
Catalonia	Court			1	Barcelona Ridge Subd	0.11	0	0.11			0.11 Paved	Barcelona Ridge	Cul-de-Sac	yes
Catamount	Drive			3	Dorada Place	0.3	0	0.3			0.3 Paved	Soledad Canyon	Cul-de-Sac	yes
Cattlemans	Drive			2		1.53	0	1.53			1.53 Paved	Via De Panco Papan	East end	yes
Cattle Guard	Trail			4		0	4.02	0	4.02		4.02 Unpaved	D-067	D-064	yes
Cavalry	Trail			1		0	0	0			0 Unpaved	South Track		no
Cebolla	Lane			1		0	0.13	0	0.13		0 Unpaved	Drain	Lateral	no
Cedar Grove	Street			1		0	0.64	0	0.64		0 Unpaved	E-391	E-039	yes
Cedarwood	Court			1		0.44	1.63	0.44	1.63		2.07 Paved & Unpaved	Desert Wind Way	Cul-de-Sac	no
Cemetery	Street			4	Sagewood Hills Subdivision	0	0.22	0	0.22		Paved	San Francisco Street	Perea Avenue	yes
Center Valley	Road			2	Town of Chamberino	0.28	0	0.28			0.28 Paved	Boyer	Lechuga Sands	yes
Centerline	Drive			2	Desert Aire Estates	0.49	0	0.49			0.49 Paved	Desert Aire Dr		yes
Central	Avenue			1	Pure Water Addition	0	0.24	0	0.24		0 Unpaved			yes
Cerrito	Road			1		0.01	7.04	0.01	7.04		7.05 Paved & Unpaved	Cattleguard	Unknown Point	yes
Cerro	Lane			1		0.05	0.15	0.05	0.15		0.2 Unpaved & Paved	Chavez Rd.	End of road	yes
Chagar	Court			2	Hacienda Chiagar	0.15	0	0.15			0.15 Paved	Taylor	Cul-de-sac	yes
Chalk Mountain	Court			2		0	0	0			0 Paved	McNutt	Cul-de-sac	no
Challenger	Place			4		0	0.53	0	0.53		0 Unpaved	US 70	Arroyo Rd.	no
Chama	Drive			4		0	1	0	1		0 Unpaved	Blue Topaz		no
Chamberino	Road			2		0	0.42	0	0.42		0.42 Unpaved	NM 28	Dirt Road Intersection	yes
Charniso	Place			4		0	0.12	0	0.12		0 Unpaved	Lisa Ln.		no
Charnizal	Road			4		0	0.15	0	0.15		0 Unpaved	Carjac	Arroyo Seco	no
Chaparral	Drive			2	Chaparral Subdivision	0	2.51	0	2.51		2.51 Unpaved	Lisa Drive	State Line Drive	yes
Chaparral Landfill	Road			2	Chaparral Subdivision	0	0.25	0	0.25		0 Unpaved	Lisa Road	Telephone Pole	no
Chaparrita	Court			3		0	0.04	0	0.04		0 Unpaved	Soledad		no
Charles Russel	Road			3		0.5	0	0.5			0.5 Paved	Las Piedras		yes
Charolais	Drive			4	Cattleland Estates	0	0.21	0	0.21		0.21 Unpaved	Highway 70	Longhorn Drive	yes
Charter	Lane			2		0	0	0			0 Unpaved	McNutt		no
Chase	Place			3	Summit Chase Subd. 3 & 4	0.08	0	0.08			0.08 Paved	Remington		yes
Chasing Hawk	Road			2	Santa Teresa #2A	0	0	0			0 Paved			no
Chavez	Road			1		0.29	0	0.29			0.29 Paved	C-052	Fence	yes
Chelsea	Drive			3	Micander Acres	0	0.18	0	0.18		0 Unpaved	Ave. De Quintas		no
Cherokee	Trail			1	Westmoreland Addition	0	0	0			0 Unpaved	Westmorland		no
Cherry Cider	Lane			1		0	0.17	0	0.17		0 Unpaved	Banegas		no
Cherry Hill	Lane			2	Sunny Ridge Subd	0	0	0			0 Unpaved	Trevino		no
Cheyenne	Road			2	Visia Del Rey Subd.	0	0	0			0 Unpaved			no
Chia	Court			4	Desert Mirage II Phase IV	0.03	0	0.03			0.03 Paved	Dripping Springs	End of Cul-de-Sac drain	yes
Chihuahua	Avenue			2		0	0.19	0	0.19		0 Unpaved	NM 478		no
Chile Farm	Road			1		0	2.41	0	2.41		2.41 Unpaved	County Line	NM436	yes
Chile Patch	Lane			2		0	0.35	0	0.35		0 Unpaved	Kriegel		no
Chill	Lane			2		0	0.07	0	0.07		0 Unpaved	A059		no
Chimuri	Street			1	La Mesa	0.22	0	0.22			0.22 Paved	San Jose	NM 28	yes



DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
Chippewa	Trail				3 Talavera Subdivision	0	0.99				0 Unpaved	End Road South of Soledad	End Road North of Soledad	no
Chiricahua	Trail				4 Mesa La Jolla #2			0.28			0.28 Paved	Westmoreland	Webb	yes
Chiricahua	Trail				4 Mesa La Jolla #2			0.13			0.13 Paved	south end		yes
<b>Chivalry</b>	<b>Lane</b>				<b>1 La Mancha Estates</b>	<b>0.14</b>		<b>0.14</b>			<b>0.14 Paved</b>	<b>S Fairacres Rd</b>	<b>Sandy Beach Rd</b>	<b>yes</b>
Choclaw	Trail				4 Westmoreland Addition	0	0.09				0 Paved			no
Cholla	Road				3 Las Alturas Subd. Phase #6	0.55	0	0.55			0.55 Paved	Las Alturas	Ocotilla Road	yes
Chonte	Road				1 Mesquite	0.36	0	0.36			0.36 Paved	E-005	Requerdo	yes
Chonte	Avenue				1 La Mesa	0.45	0	0.45			0 Unpaved	NM478		no
Chula Vista	Road				3 Desert Mirage	0	0.35	0	0.45		0 Paved	San Jose	End of Pavement	yes
Chuparrosa	Court				1 Lane	0.04	0	0.04			0 Unpaved	Ortega Rd	Peachtree Hills	no
Cielito	Lane				5 Tierra Del Sol	0.04	0	0.04			0 Unpaved	Cielo Vista		yes
Cielo	Circle				2 Cielo Dorado	0	0	0	0.04		0 Paved	La Luz	Center of Court	yes
Cielo Azul	Avenue				2 Cielo Dorado	0	0	0	0		0 Paved			no
Cielo Celestial	Drive				2 Cielo Dorado	0	0	0	0		0 Paved			no
Cielo Dorado	Drive				2 Cielo Dorado	0	0	0	0		0 Paved			no
Cielo Dorado	Drive				2 Cielo Dorado	0	0	0	0		0 Paved			no
Cilantrio	Lane				1 Lane	0	0.12	0	0		0 Unpaved	Lechuga		no
Circuit	Lane				4 Amber Mesa	0	0.23	0	0		0 Unpaved	Paetz Ln		no
Citrine	Avenue				1 Tuscan Villas	0	0.13	0	0		0 Unpaved	Millard		no
City Lights	Place				4 Mirasol Subd. Phase #2B	0.39	0	0.39			0 Paved	Camino Blanco	Ruby	no
Clark	Lane				4 Mirasol Subd. Phase #2B	0.14	0	0.14			0.39 Paved	Picacho	Fence Line Past foster	yes
Clavel	Street				4 Lane	0	0.08	0	0.14		0.14 Paved	Mirasol	Center of Court	yes
Clear Creek	Lane				4 Court	0	0.12	0	0		0 Unpaved	US 85	End of lane	no
Cleanwater	Court				1 Trail	0.17	0	0.17			0 Unpaved	Kissiah	Cul-de-sac	no
Cliff	Trail				2 Santa Teresa #2A	0	0	0	0		0.17 Paved	Wienreich	Dead End	yes
Cliff Dwellings	Road				4 Woodburn #5/ ETZ Minor	0	0.1	0	0		0 Paved	Hanger Lake		no
Cliffhanger	Court				2 Anasazi Estates	0	0.71	0	0		0 Unpaved	NM 478	drain	no
Cline	Road				2 Santa Teresa Unit 1-A	0	0	0	0		0 Paved			no
Cloud Dancer	Avenue				2 Chaparral North Acres	0	0.1	0	0		0 Paved	Bullock		no
Cloud Song	Lane				3 Pacan Valley Acres	0.18	0	0.18			0 Unpaved	Prescott Anthony	Moonview	no
Cloudbuster	Road				1 Brazito Acres - ph1 and 2	0.37	0	0.37			0.18 Paved	Mimosa	Violet Way	yes
Cloudview	Drive				2 Santa Teresa	0	0	0	0		0.37 Paved	Hobbs	Missionary Ridge	yes
Clover	Road				4 Mesa La Jolla #2	0.23	0	0.23			0 Paved	North End of Cul-de-Sac		no
Clovis	Road				1 Northwind Circle Subdivisor	0.11	0	0.11			0 Unpaved	Barela/Northwind Inter.	Center of Circle	yes
Clubhouse	Trail				4 El Nido	0	0.21	0	0		0 Unpaved	Ward St.	Drain	no
Clubhouse	Road				1 Vado Area	0	0.95	0.5	0.95		0 Unpaved	Lisa Drive	Hermosa Drive	yes
Cochise	Trail				2 Chaparral Subdivision	0.5	0	0.5			1.45 Paved & Unpaved			no
Cochita	Lane				1 Pure Water Addition	0	0	0	0		0 Unpaved			no
Codomiz	Road				4 Tealbrook Subdivision	0.43	0	0.43			0 Unpaved	Fairland Rd		no
Coleman	Road				2 Sleepy Farms	0	0.24	0	0.24		0.43 Paved	Tellbrook	Las Alturas	no
Colas	Road				4 EBLT	0.12	0	0.12			0.24 Unpaved	Franco Rd	Palomino Rd	yes
Colobrado	Street				4 Mesa La Jolla	0.25	0	0.25			38.11 Paved	International Blt	Luna County Line	yes
Colosseo	Circle				1 Town of Benito	0.43	0	0.43			0.12 Paved	Webb	Cul-de-sac	yes
Colt	Street				3 Mission Bell	0	0	0	0		0.25 Unpaved	Westmoreland	Sunland Avenue	yes
Colt	Street				2 Town of La Union	0.25	0	0.25			0 Unpaved	Mooringate	Cul-de-sac	no
Columbus Rd Hwy 9	Trail					0	0	0	0		0.43 Paved	Thompson	Vargas	yes
Comanche	Trail					0.11	0	0.11			0 Unpaved	Red River	End of Road	no
Comanche	Trail					0.11	0	0.11			0.11 Paved	Falcon	End of Road	yes
Comanche	Street					0.25	0	0.25			0.25 Unpaved	Virginia Avenue	South Street	yes
Comet	Place													
Concepcion	Avenue													
Conchas	Place													
Condor	Street													
Conejo	Street													

DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
Conejo	Way				4 Airport Acres No. 5	0				0	0			no
Conroy	Trail				1 Coronado Ridge	1.7	0	0			0	Dona Ana School	End of Road	no
Constitution	Road				1 Barcelona Ridge Subd	0.11	0	0.11			0	Anthem	Barcelona Ridge	no
Contana	Court				1 Kilgore Subdivision	0.13	0	0.13			0.11	Barcelona Ridge	Cul-de-sac	yes
Contreras	Lane				2 Town of Chamberino	0.18	0	0.18			0.18	Bluestem Dr	Saltbunch Dr	yes
Convent	Street				3 Mesilla Park	0.13	0	0.13			0.13	Perea	Lopez	yes
Conway	Avenue					0	0					McDowell	City limits	yes
Coolidge	Avenue					0	0					E-043		yes
Coors	Road				1 Mountain View Acres	0	0.45				0	Eatancia	drain	no
Copa	Lane				1 Talavera Subdivision	0	0.12				0	Hwy 28	End of road	no
Copper Bar	Road				3 Talavera Subdivision	0	0.14				0	Soledad Canyon	End of Road	no
Coral	Road				1	0	0.47				0	Shaelm Colony	Marrillo Rd	no
Coralitos	Road				1	3.06	0	3.06			3.06	Corralitos	C-007	no
Cordomiz	Road				1	0.1	0				0	N. cul-de-sac		yes
Cordova	Circle				1 Via Emma Subdivision	0.16	0	0.16			0.16	Via Emma (East)	Via Emma (West)	no
Corea	Street				1 Rincon	0.13	0	0.13			0.13	NM 140	End of Pavement	yes
Corkscrew	Street				1 Mountain Valley Subdivision	0.16	0	0.16			0.16	NM 226(West)	End of Road	yes
Corona	Road				4 Arroyo Acres Number 12	1	0				1	Hanger Lake	Moongate	yes
Corona	Road				4 Moongate	0	1				0	Moongate	Moongate	yes
Corpening	Road				1 La Mesa Subd	0.33	0	0.33			0	Moongate	Brahman	no
Corre Caminos	Street				1 Journey Acred Replat #1	0	0				0	San Jose	End of Road	no
Cotton Blossom	Avenue				2	0	0				0	Optiz Rd	end of road	yes
Cotton Bloom	Court				1	0	0				0	Thorpe	end of road	no
Cottonweed	Road				1	0	0				0	Taylor Rd		no
Coues Deer	Avenue				4 Los Venados Estates	0	0				0	Blacktail Deer Avenue	Cul-de-sac	no
Cougar	Lane				1	0.24	0	0.24			0	Rincon	Tres Yuccas	no
Country	Place				1 Country Acres Subdivision	0.07	0	0.07			0	Center of Circle	Hummingbird Drive	no
Country Club	Place				2 Country Club Business Park	0.24	0	0.24			0.07	Rio Grande Road (S)	Rio Grande Road (N)	yes
Country Cove	Circle				2 Country Cove Subdivision	0	0				0	Jornada	McGuffy	no
Country Pride	Road				4	0	0				0	State Line Drive	Laredo Road	no
County Line	Drive				2 Chaparral North Acres Ph. 1	2.87	0	2.87			2.67	Holman	Dead End	yes
Cowboy	Ave				4	0	0				0	D-028	West Drain	yes
Cox	Lane				1	0	0.31		0.31		0	Hwy 28	San Augustine Ranch	no
Cox Farm	Road				2	0	0				0	Aguirre Springs Road	El Centro	no
Cox Ranch	Road				4	0	2.78				0	Arroyo Rd	Borderland	no
Coyote	Road				4 Moongate	0	1.03		2		2	Estancia	Drain	yes
Crawford	Road				2	0	0				0	Webb Road	Westmoreland	no
Crazy Horse	Avenue				1	0	0.36				0.49	Webb (south)		yes
Creek	Trail				4 Mesa La Jolla	0.49	0	0.49			0.21	Holman	Hunters Chase	no
Creek	Trail				4 Westmoreland M.H.P	0	0.21		0.21		0	Killdeer	Edgemont	yes
Creosote	Court				4 Holman Manor	0	0.09				0	Las Vistas	Las Vistas	no
Creosote Run	Road				3 Summit Chase 8&9	0	0				0	Cherry Hill Ln	Mother Lode	no
Crest	Drive				2 Desert Shadow	0.24	0	0.24			0.24	Rincon Ave.	Plaza Ave.	yes
Cresta	Court				1	0	0.21				0.21	Dusty	Ledesma	yes
Cresta	Court				2 Sunny Ridge Subd	0	0				0	Valley Vista		no
Cripple Creek	Road				3	0.61	0	0.61			0.61	Baca Rd	Guillermo	no
Cristo	Avenue				1 Del Cerro Estates	0.36	0	0.36			0.36	Delicias St	Guillermo	no
Cristo Rey	Avenue				1 Dona Ana	0.11	0	0.11			0.11	Hwy 9	A 17	yes
Cristo Vista	Avenue				2	0	0.7				0	Shalem Colony	Lateral	yes
Crittenden	Street				2	0	0				0			no
Crittler	Lane				1	0	0				0			no
Crossroads	Avenue				2	0	0.12				0			no
Cross Tie	Road				2	0	7.12		7.12		7.12			no
Crow	Road				1	0	0.28				0			yes

DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
Cuates Canyon	Road			3	Organ Mountain Heights	0	0				0 Unpaved	Ladera Canyon		no
<b>Cubalaya</b>	<b>Place</b>			<b>5</b>	<b>Rancho Del Gallo Unit</b>	<b>0.13</b>		<b>0.13</b>			<b>0.13 Paved</b>	<b>Plymouth Rock Rd</b>	<b>Cul-de-sac</b>	<b>yes</b>
Cuesta	Trail			1		0	0.12	0.12			0.12 Unpaved	C-54-Ladera Ave	Puerta lane	yes
Cueva Mine	Trail			3	Talavera Subdivision	0	0				0 Unpaved	Soledad Canyon		no
Cunningham	Road			3		0.41	0	0.41			0.41 Paved	Canal	Highway 85	yes
Cynthia	Lane			2	Charles F. Davis Subdivisor	<b>0.24</b>		<b>0.24</b>			<b>0.24 Paved</b>	Tornillo	County Line	yes
D. Banegas	Road			1		0	0.28				0 Unpaved	Hwy 28	end of road	no
D. E. Rodriguez	Lane			1	San Miguel	0	0.22				0 Unpaved	NM 28		no
Daisy	Lane			1		0.13	0	0.13			0.13 Paved	Miller	Morton	yes
Dalia	Drive			2		0	0.14				0 Unpaved	Valley Vista	End of road	yes
Dairymple	Road			5		0.56	0	0.56			0.56 Paved	Dona Ana Road	Mayfield Lane	yes
Dandellion	Avenue			1		0	0.64		0.64		0.64 Unpaved	Fence	Highway 85	yes
Daniel	Court			1	Fort Selden Acres	0.15	0	0.15			0.15 Paved	E. cul-de-sac	W. cul de sac	yes
Denny	Lane			1	Sky View Terrace	0	0.06				0 Unpaved	Boyd/Taylor	End of lane	no
Dairy Farm	Road			2		1.8	0	1.8			1.8 Paved	Farm Road	NM 225	yes
Daili	Court			1	EBL&T "A" Replat #30	0	0				0 Paved	Elks		yes
Davis	Street			1		0	0				0 Paved	Main	Canal	no
Dawson	Road			1		0.85	0	0.85			0.85 Paved	Monies Road	NM 28	yes
Day Lily	Court			2		0	0				0 Unpaved	Westside		no
De Beers	Drive			1	Fort Selden	1.14	0	1.14			1.14 Paved	Desert Edge	D-61	yes
De La O	Road			1	Lyons Country Estates	0.14	0	0.14			0.14 Paved	Romero	Garcia	yes
De Lara Estates	Road			2	De Lara Estates	1.02	0	1.02			1.02 Paved	Lisa Road	Ruby Road	yes
De Vacca	Court			4		0	0.28				0 Unpaved	St. Anthony	Prop Line	no
Deadwood Camp	Court			3		0.09	0	0.09			0.09 Paved	Mother Lode Tr	cul de sac	yes
DeAnza	Place			1		0	0				0 Unpaved	Trails End		no
Deer Grass	Lane			2	Colquilt Subd	0	0.27				0.27 Unpaved	Palma	Old Sequoia	yes
Deer Ridge	Court			1	Picacho Hills	0	0		0.27		0 Paved	Desert Blossom		no
Del Norte	Court			4	Del Norte Country Estates	0.02	0	0.02			0.02 Paved	Katie Ct	Cul-de-sac	yes
Del Oro	Lane			2		0	0				0 Unpaved	NM 460		no
Del Prado	Drive			2	Meadow Vista Subdivision	0	0				0 Unpaved			no
Del Rey	Boulevard			4		2.03	3.4	2.03	3.4		5.43 Paved & Unpaved	City Limits	Goat Hill Rd.	no
Del Rio	Court			5	Bosque Bedado, replat 4, ph	0.05	0	0.05			0.05 Paved	Del Rio Dr	Cul-de-sac	yes
Del Rio	Drive			5	Bosque Bedado, replat 4, ph	0.16	0	0.16			0.16 Paved	Burke Rd		yes
Del Rose	Court			4	Skyview Terrace	0.06	0	0.06			0.06 Paved	Taylor	Cul-de-Sac	yes
Delicias	Street			2		0	0.24				0 Unpaved	Shorde	Mesquite	no
Delphi	Lane			1		0	0.17				0 Unpaved	Run Along Rd		no
Denali	Drive			2		0	0.4		0.4		0.4 Unpaved	Sands	Shiprock	yes
Denny	Court			5	Wildwood Mt-P	0	0				0 Paved	Wiley Ave		no
Derby	Avenue			1		0.49	0	0.49			0.49 Paved	Weinreich	Sandy Hill	yes
Derry	Avenue			5	Rincon	0.22	0	0.22			0.22 Paved	Kingman St.	Harlan St.	yes
Desert Aire	Drive			2	Desert Aire Estates	1.38	0.38	1.38	0.38		1.76 Paved & Unpaved	NM 213	Finley	yes
Desert Blossom	Road			1		0	0				0 Paved	Vista Carro		no
Desert Broom	Court			3	Desert Mirage	0	0.18		0.18		0.18 Unpaved	cul-de-sac	Cul-de-sac	yes
Desert Edge	Road			1	Fort Selden	0.75	0	0.75			0.75 Paved	Tel High	De Beers	yes
Desert Garden	Drive			2	Santa Teresa Unit 1-A	0	0				0 Paved			no
Desert Mirage	Road			3	Desert Mirage	0.82	0	0.82			0.82 Paved	Dripping Springs		yes
Desert Mountain	Road			3	Desert Mirage	0	0				0 Paved	Pena Blanco Loop		no
Desert Park	Avenue			4	Butterfield Park	0.52	0	0.52			0.52 Paved	Smith Lane	Highway 70	yes
Desert Plum	Road			4		0	0.54				0 Unpaved	La Reina	Goat Hill Rd.	no
Desert Ridge Rise	Road			4	Brentwood	0	0.27				0 Unpaved	La Reina	Nuggett PL	no
Desert Sands	Drive			3	Desert Mirage	0	0				0 Paved	Soledad Canyon		no
Desert Sparrow	Place			2	Desert Shadow	0.06	0	0.06			0.06 Paved	Casas Linda Ln	Red Legs Court	yes



DAC Road Inventory 2017

3/10/2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
Desert Springs	Road			4		0	0				0 Unpaved	La Reina		no
Desert Star	Road			2		0	0				0 Unpaved	Mesilla Hills Dr		no
Desert Valley	Court			1	Desert View Ridge Subdivision						Paved	Tingo Circle	Cul-de-sac	no
Desert View	Lane			1		0.13	0	0.13			0.13 Paved	Westview	Southview	yes
Desert Walk	Court			4		0	0				0 Unpaved	Talavera		no
Desert Wind	Way			4		1.05	0.34	1.05	0.34		0 Unpaved & Unpaved	La Reyna	Cattle Guard	yes
Desperado	Court			4		0	0.06				0 Unpaved	Saddle Mt. Rd.	Prop Line	yes
Devils Claw	Road			4		0	0				0 Unpaved	Eclipses		no
Dia Y Noche	Avenue			4		0	0				0 Unpaved	Holman		no
Diamond	Circle			4		0	0				0 Unpaved			no
Diamond Mine	Road			3	Vista Diamante	0	0				0 Paved	Soledad Canyon		no
Diamondback	Drive			3	Cassidy at Sundance Acres	0.25	0	0.25			0.25 Paved	Redman Road	Cul-de-sac	yes
Diane	Lane			4		0	0.04				0 Unpaved	Joseph H. Lane	Saddle Mount. Rd	no
Diaz	Road			2		0	0.34				0 Unpaved	Barela Rd (D-40)	End of road	no
Dillon	Road			2		0	0				0 Unpaved	Hantacker	Canal	no
Doc Bar	Road			3		0	0				0 Unpaved	Addington		no
Doc Lobos	Court			1	Mason Acres Subd	0	0.12				0 Paved	Engler		no
<b>Dominiques</b>	<b>Place</b>			<b>5</b>	<b>Rancho Del Gallo Unit</b>	<b>0.11</b>		<b>0.11</b>			<b>0.11 Paved</b>	<b>Plymouth Rock Rd</b>	<b>Cul-de-sac</b>	<b>yes</b>
Don Miguel	Drive			1		0.24	0	0.24			0.24 Paved	Hwy 28	end of road	yes
Dona Ana	Road			1		13.4	0	13.4			13.4 Paved	City Line Drainage Ditch	Leesberg Dam Rd	yes
Dona Ana School	Road			1/4		1.02	0	1.02			1.02 Paved	D-028	Elks Road	yes
Dona Elayna	Court			3		0	0				0 Unpaved	Silver King Rd		no
Dona Villa	Drive			1	Dona Villa	0.33	0	0.33			0.33 Paved	Rancho Algodones	Leasburg	yes
Doolittle	Road			5		0.15	0	0.15			0.15 Paved	Mayfield	Route 85	yes
Dormilon	Road			1	Butler Subd./ ETZ Minor	0	0.18				0 Unpaved	El Camino Real		no
Dormilon	Road			4	Los Venados Estates	0	0.52				0 Unpaved	El Camino Real	Coues Deer Avenue	no
Dos Amigos	Road			2		0	0.12				0 Unpaved	Three Santis	river levee	no
Dos Equis	Road			4		0	0				0 Unpaved	Ortega	Epic	no
Dos Lobos	Road			3		0	0				0 Unpaved	A-030		no
Double Eagle	Road			2		0	0				0 Unpaved	Leeberry		no
Doubletree	Street			4		0	0.4				0 Unpaved	Co Rd B4	West Afton Rd	no
Douglas Munro	Road			2		6.71	0	6.71	6.71		6.71 Unpaved			yes
Dove	Road			2		0	0				0 Unpaved			no
Dr. Moore	Circle			4		0	0				0 Unpaved			no
Dragonfly	Avenue			4	Moongate	0.3	0.67	0.3	0.67		0.97 Unpaved	Moongate	Brahman	yes
Dream Spirit	Way			2	Santa Teresa Unit 1-A	0	0				0 Paved			no
Dream Walker	Drive			2		0	0				0 Unpaved			no
Dreams	Way			2		0	0				0 Unpaved	Joy Dr		no
Dressage	Court			4	El Camino Real Estates-ph1	0.08	0	0.08			0.08 Paved	El Camino Real	Cul-de-sac	yes
Dripping Springs	Road			3/4		5.5	2.23	5.5	2.23		7.73 Paved & Unpaved	End of Pavement	Gate	yes
Dropsseed	Lane			1	Kigore Subdivision	0.13	0	0.13			0.13 Paved	Bluestem Dr	Saltbrush	yes
Dry Harbor	Court			4	Kissiah-Parrigin #6/ ETZ Mir	0	0.11				0 Unpaved	Kissiah	Cul-de-sac	no
Desert Mirage	Drive			4	Desert Mirage II	0.2	0	0.2			0.2 Paved	Dripping Springs Rd to north end		yes
<b>Dulcinea</b>	<b>Drive</b>			<b>1</b>	<b>La Mancha Estates</b>	<b>0.29</b>		<b>0.29</b>			<b>0.29 Paved</b>	<b>Sandy Beach Rd</b>	<b>Cul-de-sac</b>	<b>yes</b>
Dune	Road			4		0	0.06				0 Unpaved	Saddle Mountain Rd		no
Dunlap	Road			3	Dunlap Summary	0	0.08				0 Unpaved	Calle Las Margaritas		no
Dunnin	Drive			2	Desert Shadow	0.15	0	0.15			0.15 Paved	Casas Lindas	Sanderling	yes
Dusty	Lane			1	Dona Ana	0.27	0	0.27			0.27 Paved	Ledesma	Thorpe	yes
Dusty Prints	Road			1	Ruby Pointe	0.93	0				0 Unpaved	Weinreich		no
E. Afton	Road			1	Alberto Salinas Property						0 Unpaved	Montes	Cul-de-sac	no
E. Berfno	Road			2		1.46	0	1.46			1.46 Paved	Rte 478	Stern Dr	no
E. Lisa	Drive			2	Chaparral Subd	1.82	0	1.82			1.82 Paved	County Line	McCombs	yes

DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
Eagle	Road				4 Moongate	0	0.51				0 Unpaved	Luna Vista	El Centro	no
Eagle Pass	Road				3 Cassidy at Sundance Acres	0.22	0	0.22			0.22 Paved	Superstition Drive	Las Piedras	yes
Eagle Wings	Road				1	0	0				0 Unpaved	N. Hwy 85	River	no
Eagles Nest	Road				2 Santa Teresa Business Park	0.17	0	0.21			0.21 Unpaved	Dona Ana Rd	Wind Chime Ln	yes
Earhardt	Way				1	0	0	0.17			0.17 Paved	Airport	Runway Dr	yes
Eaton	Lane				4	0.6	0	0.6			0.6 Paved	Berry Patch		yes
East Drain	Drive				2 Green Meadow Estates	0.13	0.1	0.13	0.1		0.23 Paved & Unpaved	Whispering Dove		yes
East Organ	Road				3	1.08	0	1.08			1.08 Paved	Willow	85 State Land	yes
East Plaza	Drive				1 Herrera Acres	0.3	0	0.3			0.3 Paved	Co Rd B 56	Mesquite Drain	yes
East Side Canal	Road				1	0	5.17		5.17		5.17 Unpaved	NM 478	B-030 Sign	yes
East Sloan	Road				1	0.79	0	0.79			0.79 Paved	Montes Road	NM 28	yes
Eastbend	Arc				1	0	0				0 Unpaved	Hwy 187		no
Eastview	Avenue				1	0.16	0	0.16			0.16 Paved	Fairview	Northview	yes
Easy	Lane				4 Butterfield Park	0.56	0	0.56			0.56 Paved	Isaacks Avenue	Private Property Fence	yes
Echidna	Avenue				4	0	0				0 Unpaved	Saint Michales		no
Echo Canyon	Road				3 Cassidy at Sundance Acres	0.35	0	0.35			0.35 Paved	Superstition Drive	cul-de-sac	yes
Eclipse	Road				4	0	0.65				0 Unpaved	La Reina	Goat Hill Rd.	no
Edgemont	Drive				2 Desert Shadow	0.11		0.11			0.11 Paved	Sanderling Dr	west end	yes
Edgemont	Road				2 The Bluffs Subdivision	0.23	0	0.23			0.23 Paved	Sanderling Rd	McNutt Road	yes
Edgewater	Court				1 Peaceful Valley Estates	0.09	0	0.09			0.09 Paved	End of cul-de-sac	End of cul-de-sac	yes
Edgewood	Drive				2 Meadow Vista Subdivision	0	0				0 Unpaved			no
Edna	Drive				2 Chaparral Subdivision	0.99	0	0.99			0.99 Paved	Lisa Drive	Wicker Street	yes
Edward	Avenue				1 Mesquite	0.12	0	0.12			0.12 Paved	NM 228	NM 478	yes
Efrain	Lane				5 Duran Estates-USRS 9A-9B	0	0.09				0 Unpaved	Dalrymple Rd		no
Egler	Road				4	0.25	0	0.25			0.25 Paved	Mount Baldie to east		yes
Egret	Road				2	0	0				0 Unpaved	Alvarez	South End	no
Egyptian	Street				3 South Park Subdivision	0.45	0	0.45			0.45 Paved	Carver		yes
Ehler	Road				2 Chaparral Subdivision	0	0				0 Unpaved			no
Elder	Lane				1	0	0				0 Unpaved	Taylor		no
Eisenhower	Avenue				1 Salem	0.24	0.06	0.24	0.06		0.3 Unpaved	E-49	Truman	no
El Apajo	Way				1	0.22	4.03	0.22	4.03		4.25 Paved & Unpaved	NM 26	Corral	yes
El Carmino Real	Road			1/4		4.13	0	4.13			4.13 Paved	Thorpe Road	Bridge S. of Navajo Road	yes
El Capitan	Drive				2	0	0.35				0 Unpaved	Red River	Luna	no
El Centro	Road				4 Moongate	2.97	0	2.97			2.97 Paved	Moongate	Brahman	yes
El Chavo	Lane				2	0	0				0 Unpaved	A-020		no
El Colorado	Avenue				1 Rodey	0.31	0.16	0.31	0.16		0.47 Paved & Unpaved	Route 85	Unknown Point	yes
El Faro	Street				3	0.28	0	0.28			0.28 Paved	Avenida de Quimias	E. of Drain	yes
El Gato	Road				2	0.42	0	0.42			0.42 Paved	Borderland Road	State Line	yes
El Milagro	Road				2	0	0.25				0 Unpaved	East Organ (B-057B)		no
El Nido	Road				1	0	0.08				0 Unpaved	Taylor	Zeertuche	no
El Nogal	Lane				2	0	0.18				0 Unpaved	Bighorn		no
El Norte	Road				4 Moongate	0	0.1				0 Unpaved	McArthur	End of road	no
El Pescado	Road				1	0	0.13				0 Unpaved	NM 28		no
El Pitallo	Road				1	0	0				0 Unpaved	Savannah		no
El Suspiro	Court				1	0	0				0 Unpaved	Frontage road		no
El Tonfo	Lane				1 Lyons Country Estates	0.08	0	0.08			0.08 Paved	Ledesma	Ma. Bell Cable Box	yes
Eleanor	Avenue				1 Vista Del Sol Subdivision	0	0				0 Paved			no
Elks	Road				4	1.68	0	1.68			1.68 Paved	El Carmino Real	City Limit	yes
Ella Mae	Road				2	0	0.2				0 Unpaved	NM 227		no
Elm	Court				1 Riverside Subdivision	0	0				0 Unpaved			no
Elm	Street				1 Powers Subdivision	0	0				0 Paved			no
Elsie	Lane				1	0	0.09				0 Unpaved	Picacho		no
Embarcadero	Rd				1	0	0.64		0.64		0.64 Unpaved	Private Property line	Dona Ana Rd	yes

DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co.
Ermerison	Avenue			1/3	Mesquite	0.17	0	0.17		0.17	Paved	End of Road	RR Tracks	yes
Emilia	Street			3		0.22	0	0.22		0.22	Paved	San Felipe	Tortugas Street	yes
Enchantment	Drive			2	Desert Aire Estates	0	0.79	0		0	Unpaved	Santa Fe St.	Franklin St	no
Encino	Drive			2	Meadow Vista Subdivision	0	0	0		0	Unpaved			no
Englehardt	Drive			4		0.24	0	0.24	0	0.24	Paved	Hanger Lake Road	Galaxy Road	yes
Engler	Road			1/5		0.82	0	0.82		0.82	Paved	Dona Ana Road	Route 85	yes
Enriquez	Avenue			1	2 Town of La Union	deleted 2/12					Paved & Unpaved	NM 28	Alvarez Road	yes
Enriquez	Lane			1		0	0.16	0		0	Unpaved	Motel Prk. lot	end of road	no
Ensson	Road			4		0	0.33	0		0	Unpaved	Jeffries	Hanger Lake	no
Ermitta	Road			4		0	0.2	0		0	Unpaved	Benevidez		no
Ernesto	Road			2		0	0.34	0		0	Unpaved	Links		no
Escondido	Lane			1		0	0.23	0		0	Paved	S. Fairacres		no
Espalin	Court			1		0	0	0		0	Unpaved	Dona Ana Road		no
Esperanza	Avenue			1	Pure Water Addition	0	0	0		0	Unpaved			no
Espiga	Place			2		0	0.13	0		0	Unpaved	Honeysuckle		no
Espinaca	Lane			1		0	0	0		0	Unpaved	Lechiuga		no
Esquina	Road			1		0	0.07	0		0	Unpaved	NM 227		no
<b>Essinger</b>	Street			1		1.51	0	1.51	0	1.51	Paved	San Jose Road	NM 28	yes
Estancia	Street			1		0	0.42	0		0	Unpaved	McCrimmon		no
Estancia	Court			1		0.08	0	0.08		0.08	Paved	s end	n end	yes
Esterlina	Place			1		0.11	0	0.11		0.11	Paved	N Fairacres Rd	Esterlina Court	yes
Estrellita	Court			2	USRS Tract 15-64A1 & 15-7	0	0.11	0		0	Unpaved	CR B-52		no
Elta	Court			1		0	0	0		0	Unpaved			no
Eugenio	Street			3		0.05	0	0.05		0.05	Paved	Tortugas	San Francisco	yes
Evano	Drive			1		0	0.04	0		0	Unpaved	NM28	privte prop	no
Evening	Court			4	El Camino Real Estates-ph1	0.13	0	0.13		0.13	Paved	El Camino Real	Cul-de-sac	yes
Evergreen	Court			1		0	0.07	0		0	Unpaved	Moreno	End of Court	no
Evon	Drive			4		0	0.12	0		0	Unpaved	Lisa Ln.	Ronda Ln	no
Excel	Way			2		0	0	0		0	Unpaved	Gillette		no
Fair Lady	Lane			2		0	0	0		0	Unpaved	Union		no
Fairacres	Rd			1		0.66	0	0.66	0	0.66	Paved	Picacho Main Canal	Mesilla Hills	yes
Fairpark	Road			1	Fairpark Acres #2 Rep #1	0	0.44	0		0	Unpaved	Fairview	Fairview	no
Fairview	Drive			1		0.2	0	0.2		0.2	Paved	C-051 Sign	Provate Property	yes
Fairway Village	Drive			1	Fairway Village Subd	0	0	0		0	Paved	Picacho		no
Falcon	Drive			3	Mission Bell	0.52	0	0.52		0.52	Paved	Sandalwood	Center of Court	yes
Fallow Deer	Street			4	Los Venados Estates	0	0	0		0	Paved	Sitka Deer Street	Coues Deer Avenue	no
Fandango	Court			1		0	0.07	0		0	Unpaved	Barela Rd		no
Farm	Road			2		0.97	0	0.97		0.97	Paved	Rio Grande River	Dary Farms Road	yes
Farm View	Road			1	Peaceful Valley Estates	0.15	0	0.15		0.15	Paved	End of cul-de-sac	Edgewater Ct	yes
Farmiland	Road			2		0	0	0		0	Unpaved	NM 478		no
Farside	Street			4		0	0	0		0	Unpaved	E-45	E-49	no
Father Ramon Estivil	Avenue			1		0.42	0.06	0.42	0.06	0.48	Paved & Un	D-059 sign	Route 85	yes
Feagan Canyon	Road			1		0.17	0	0.17	2.83	2.83	Unpaved	lassacks Ln	Cul-de-sac	yes
Feather Moon	Circle			2	Santa Teresa #4	0	0	0		0	Paved			no
Feather Moon	Drive			2	Santa Teresa #4	0	0	0		0	Paved	Saltbrush	Bluestem	no
Feathergrass	Lane			1	Kligore Subdivision	0.17	0	0.17		0.17	Paved	Elks Road	School Property	yes
Ferguson	Road			4	El Nido	0.07	0	0.07		0.07	Paved	Singh	end of road	no
Fern	Court			1		0	0.08	0		0	Unpaved			no
Fierro	Road			1		0	0	0		0	Unpaved	Apodaca		no
Fiesta	Drive			1		0	0.41	0		0	Paved	Alvarez		no
Fig Tree	Lane			2		0	0	0		0	Unpaved			no
Finally	Drive			1		0	0.04	0		0	Unpaved	Barela Rd (D-40)	End of road	no



DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
Finley	Street				2 Mountain View Estates	0.49	1.01	0.49	1.01	1.51	Paved & Unpaved	Wicker Road	San Carlos Street	yes
Fir	Street			1		0	0.44	0	0.44	0.44	Unpaved	Route 26	E-037-Cedar Grove	yes
Fir	Court			2	Riverside Subdivision	0	0	0	0	0	Unpaved			no
Firebird	Lane			3		0	0.14	0	0	0	Unpaved	Starfly		no
Firefly	Road			1		0	0.08	0	0	0	Unpaved	NM State Road 228	End of Road	no
Firehouse	Road			1		0	0.5	0	0	0	Unpaved	Desert Sq		yes
Firehorn	Court			3	Desert Mirage	0.1	0	0.1	0	0.1	Paved	I-10 Frontage Road	NM 478	yes
First	Street			2		0	0	0	0	0	Unpaved	Route 85	Telephone Pole	no
Fischer	Street			5	Meadow Vista Subdivision	0.38	0	0.38	0	0.38	Paved	Watson Lane		yes
Five Sisters	Street			1		0	0.02	0	0	0	Unpaved	Holman	End of road	no
Flatland	Road			4		0	0.28	0	0	0	Unpaved	Snow Rd	RR crossing	no
Flecha Doble	Road			1		0	0.2	0	0	0	Unpaved	Flecha Doble	Monroe Avenue	yes
Flechador	Road			1		0	0.24	0.24	0.24	0.24	Paved	Victor Duran	Mariano Trujillo	yes
Florence	Avenue			1	Salem	0.24	0	0.24	0	0.24	Paved	Hare	end of road	no
Florencio Lopez	Avenue			1	Rodey	0.2	0.1	0.2	0	0.2	Unpaved	Diaz Rd	NM 28	yes
Flores	Road			1		0	0	0	0	0	Unpaved	B-024	Calle Florista	yes
Flores	Court			1		0	0	0	0	0	Unpaved	Linden Ave		yes
Florida	Street			1	La Mesa Subdivision	0.22	0.23	0.22	0.23	0.23	Unpaved	Swannack	Rincon	no
Florist	Street			3		0.09	0.23	0.09	0.23	0.34	Paved	E-44	Cemetery	yes
Flourite	Road			4		0.34	0.23	0.34	0.23	0.34	Paved	V in Road	Highway 85	yes
Flower	Road			2		0.42	0.39	0.42	0.39	0.42	Unpaved	Forest Dr	Dead End	no
Forest	Street			3	Salem	0.34	0.23	0.34	0.23	0.34	Paved	Westwind Road	Ft. Selden	yes
Forest Hills	Court			2		0.22	0.47	0.22	0.47	0.47	Paved	Pecan Orchards	Highway 85	yes
Forest Park	Drive			1	Westwind Pines Estates	0.22	0.47	0.22	0.47	0.47	Paved	LB Lindberck	Buffalo Est. Rd	yes
Fort Cummings	Road			1	Fort Selden Estates	0.47	0.23	0.47	0.23	0.23	Paved	Ft. Cummings	Ft. Selden	yes
Fort Fillmore	Road			3		0.32	0.14	0.32	0.14	0.14	Paved	Ft. Thorn	Ft. Mc Lane	yes
Fort Furlong	Trail			1	Buffalo Estates	0.14	0.23	0.14	0.23	0.23	Paved	Hwy 85	Hayride	yes
Fort Marcy	Trail			1	Buffalo Estates	0.23	0.11	0.23	0.11	0.11	Paved	Morton	Clark	no
Fort McLane	Road			1	Fort Selden Estates	0.59	0.05	0.59	0.05	0.05	Unpaved & Paved	Hwy 185	Higgins Lane	no
Fort McKee	Road			1	Fort Selden Estates	0.41	0.11	0.41	0.11	0.11	Paved	Smith Lane	Higgins Lane	yes
Fort Thorn	Road			1	Fort Selden Estates	0.18	0.11	0.18	0.11	0.11	Paved	Angel Fire Pl	Spirit Hunter Lane	no
Fossil View	Road			1		0.05	0.61	0.05	0.61	0.61	Unpaved & Paved	Indian Head	Arroyo Rd	no
Foster	Lane			1		0.11	0.11	0.11	0.11	0.11	Paved	Northwind	Private prop	no
Foster	Street			1		0.11	0.11	0.11	0.11	0.11	Paved	NM478	Sunshine Ln	no
Foster Canyon	Road			1		0	0	0	0	0	Unpaved	Singer Road	Center of Court	yes
Found	Avenue			4	Butterfield Park	0.11	0.15	0.11	0.15	0.15	Paved	N Hwy 85	B-016 Sign	yes
Four Winds	Street			3	Anasazi Estates	0.08	0.17	0.08	0.17	0.17	Paved & Un	NM 478		no
Fox	Road			4	Moongate	0.08	0.09	0.08	0.09	0.09	Paved	Fairpark Rd	Morton	yes
Foxboro	Court			1		1.24	0.13	1.24	0.13	0.13	Unpaved	Clark		no
Framland	Road			2		0.25	0.09	0.25	0.09	0.09	Paved	Peachtree Hills	Desert Edge	yes
Francine	Road			1	Saddle Creek Estates	0.05	0.09	0.05	0.09	0.09	Paved	De Beers Dr	Dead End	no
Francis Way	Trail			1		0.05	0.13	0.05	0.13	0.13	Unpaved	La Adelia		no
Franco	Road			1	Fairpark Acres II	0.74	0.09	0.74	0.09	0.09	Paved	Corkscrew		yes
Freebird	Road			1		0	0.13	0	0.13	0.13	Unpaved	Trailer Park Entrance	Sly Song Cr	yes
Freeze	Lane			4		0.09	0.13	0.09	0.13	0.13	Unpaved			no
Fresno	Trail			1	Fort Selden	0.8	0.23	0.8	0.23	0.23	Paved			no
Frodo	Place			1	Sunland Park	0.8	0.04	0.8	0.04	0.04	Unpaved			no
Frontiera	Road			2	Mountain Valley Subd	0.04	0	0.04	0	0.04	Paved			yes
Fuego	Avenue			1		0	0	0	0	0	Unpaved			no
Fuentes	Lane			1		0	0	0	0	0	Unpaved			no
Furnace	Street			4	Town of Organ	0.47	0	0.47	0	0.47	Paved			yes

DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
Furrow	Road			1		0	0	0	0	0	Unpaved			
Gabaldon	Road			2		0	0.43	0	0.43	0	Unpaved	N. Valley	Hwy 28	no
Gadwall	Place			4	Inspiration Heights Phase 2	0.06	0	0.06	0	0.43	Unpaved	A-092	NM 273	yes
Galaxy	Drive			4		0.32	0	0.32	0	0.06	Paved	Inca Dove Avenue	End of cul-de-sac	yes
Gallup	Court			3		0	0	0	0	0.32	Paved	Englehardt Road	Highway 70	yes
Gandolf	Lane			1	Raasaf Hills	0	0	0	0	0	Unpaved	Shiprock St	cul-de-sac	no
Gannet	Road			2		0.21	0.56	0	0.77	0	Unpaved & Un	NM 478	Canal	no
Garcia	Drive			1	Dona Ana	0.67	0	0.67	0	0.11	Paved	Romero	Ledesma	yes
Gardenia	Court			4	Mirasol Subd. Phase #2B	0.11	0	0.11	0	0.67	Paved	Mirasol Drive	Amarillo del Sol	yes
Gardner	Road			2		0.7	0	0.7	0	0.7	Paved	State Line Road	McNitt Road	yes
Garfield	Street			1	Pure Water Addition	0	0.09	0	0.09	0.09	Unpaved	Union St.	Grandview	yes
Gavilan	Avenue			1		0.65	0	0.65	0	0.65	Paved	NM28	B-10	yes
Gazelle	Court			2		0	0.14	0	0.14	0	Unpaved	Venadillo Tr.		no
George Catlin	Road			3		0.43	0	0.43	0	0.43	Paved	Las Piedras		yes
Georgia O'keefe	Road			3		0.31	0	0.31	0	0.31	Paved	Las Piedras		yes
Georgianna	Court			1	Taylor Farms	0.09	0	0.09	0	0.09	Paved	Route 85	Center of court	yes
Geothermal	Drive			3	Quail Run	0.38	0	0.38	0	0.38	Paved	Las Alluras	Stop Sign	no
Gerald	Drive			1	Mountain View Acres	0.12	0	0.12	0	0.12	Paved	Lopez Road	Center of Court	yes
Geronimo	Trail			1	Mesa La Jolla #2	0	0	0	0	0.23	Paved	N. cul-de-sac	S. cul-de-sac	yes
Gibson Veck	Road			2	Sunland Park	0.59	0	0.59	0	0.16	Paved	Frontiera Rd.	Race Track Dr.	no
Gillette	Road			2		0.16	0	0.16	0	0.16	Paved	TX state line	TX state line	yes
Girault	Road			4		0	0.08	0	0.08	0	Unpaved	Shoesmithing ranch		no
Girl Scout	Road			2	Sunland Park	0	0.46	0	0.46	0	Unpaved	Frontiera Rd	Dead End	no
Glass	Road			1		0	0	0	0	0	Paved	Snow Road	NM 292	no
Glen Rose	Lane			5	Sky View Terrace	0	0	0	0	0	Paved			no
Glenn	Road			5	Sky View Terrace	0	0.06	0	0.06	0	Unpaved	Boyd/Taylor	End of lane	no
Glenns Grove	Drive			2		0	0	0	0	0	Unpaved	NM 478		no
Glorieta	Drive			3		0	0	0	0	0	Unpaved	NM 213		no
Goat Hill	Road			4		0	0	0	0	1.61	Paved	Dona Ana Rd	Del Ray Blvd	yes
Golden	Street			2	Sun Country Est. Unit #1	0	0	0	0	0.97	Paved		Lisa	yes
Golden Eagle	Street			2	Delara Est. North #3	0.97	0	0.97	0	0.97	Paved	Wicker		no
Golden Sand	Drive			2	Santa Teresa	0	0	0	0	0.45	Unpaved	NM 213	Sand Dr	yes
Golden Sun	Drive			2		0	0.45	0	0.45	0.45	Unpaved	Constitution Rd	cul-de-sac	no
Goldeneye	Court			1	Coronado Ridge Ph III	0.21	0	0.21	0	0.21	Paved	Enriquez Avenue	West Avenue	yes
Golondrina	Street			2	Town of La Union	0	0.1	0	0.1	0	Unpaved	Hwy 478	Dead End	no
Gomez	Road			2		0	0.27	0	0.27	0	Unpaved	NM 28		no
Gonzales	Road			1	San Miguel	0	0.12	0	0.12	0	Unpaved	La Quinta Lp.	Arroyo	no
Good News	Way			1		0	1.24	0	1.24	0	Unpaved	Washington		no
Gopher	Road			4	Mooringate	0	0	0	0	0.15	Unpaved	Autum Sage	Pampas Grass	no
Gracie	Place			2		0	0.15	0	0.15	0.08	Unpaved	Dona Villa	End of Pavement	yes
Grana Grass(was Me Drive	Street			2	Colquit Subd	0	0.88	0	0.88	1.29	Paved & Unpaved	Highway 85	Private Property	yes
Granada	Street			1	Dona Villa	0.08	0	0.08	0	0.07	Unpaved	Glass Rd	Main St./State Rd.	yes
Grand	Avenue			1	Salem	0.41	0	0.41	0	0.07	Unpaved	Garfield St	Osos Del Sol	no
Grandpa's Farm	Road			1	Pure Water Addition	0	0.07	0	0.07	0	Unpaved	Barksdale	Apple Orchard	no
Grandview	Avenue			1		0	0	0	0	0.04	Unpaved	Avillar Rd	Cul de Sac	yes
Grandview	Street			1		0	0.1	0	0.1	0	Unpaved	N Hwy 85		no
Grape Vineyard	Road			3	Organ Mesa Subd. ph2	0.04	0	0.04	0	0.29	Paved	Red Rock		no
Grapevine Canyon	Court			1		0	0.13	0	0.13	0	Unpaved	Fairpark Rd.	cul-de-sac	yes
Gray Fox	Court			2		0	0.15	0	0.15	0	Unpaved	Weisner	End of road	no
Gray Quail	Place			1	Greatview Subdivision	0.29	0	0.29	0	0.06	Unpaved			no
Greatview	Court			1	Fairpark Acres II	0	0.06	0	0.06	0	Unpaved			no
Green Acres	Road			4	Arroyo Acres	0	0.06	0	0.06	0	Unpaved			no
Green Hill	Court			4		0	0.06	0	0.06	0	Unpaved			no

DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
Green Meadows	Road				2 Green Meadows Estates	0.64	0.12	0.64	0.12	0.76	Paved	Gannet Rd.	Willow Ave.	yes
Green Pasture	Court				2 West Valley Farms Subd.	0	0.15	0	0.15	0	Unpaved	NM 273	Drain	no
Green River	Loop				2 Desert Aire Estates	0	0.34	0	0.34	0	Unpaved	Red River	Wheatstone	no
Green Tree	Loop				2 Desert Aire Estates	0	0.29	0	0.29	0	Unpaved	Wheatstone	El Capitlan	no
Green Tree	Lane				4 Rainbow Acres	0.07	0	0.07	0	0	Unpaved	Holman	canal	no
Green Valley	Court				2	0	0.09	0	0.09	0	Unpaved	Hwy 478		no
Greenwood	Road				2	0.74	0	0.74	0	0.74	Paved	State Line	NM 28	yes
Greenwood	Avenue				2 Lake Section Subdivision	0.12	0.61	0.12	0.61	0.73	Unpaved	W. Lisa Drive	Paloma Blanca Drive	yes
Gregorio Miranda	Street				1 Rodney	0.18	0	0.18	0	0.18	Paved	E-019	Telephone Pole	yes
Grunder	Road				1	0	0.34	0	0.34	0	Unpaved	Taylor Road (West)	Campbell	no
Grunder	Road				3	0	0.19	0	0.19	0	Unpaved	Stern Dr	Cul-de-sac	no
Grouse	Run				4 Amber Mesa Subd	0	0.48	0	0.48	0	Unpaved	Blue Topaz		no
Guadalupe	Street				3	0.24	0	0.24	0	0.24	Paved	Casa De Pueblo	Emilia	yes
Guamls	Road				4	0	0.42	0	0.42	0	Unpaved	La Reina	End of road	no
Guillermo	Drive				1 Kilgore Subdivision	0.03	0	0.03	0	0.03	Paved	Feathergrass	Edge of pavement	yes
Guylen	Avenue				2	0	0.14	0	0.14	0	Unpaved	Thompson		no
Gypsy	Road				2	0	0	0	0	0	Unpaved	Shorde		no
Haase	Road				2	0	1.18	0	1.18	1.18	Unpaved	Enriquez Road	NM 28	yes
Haasville	Road				2	1.25	0.8	1.25	0.8	2.05	Paved & Unpaved	Little Rd	NM 28	yes
Haines	Road				5	0	0	0	0	0	Unpaved	Ray Luchini		no
Half Dome	Road				1	0	0	0	0	0	Unpaved	Wheatstone		no
Hall	Street				1	0.37	0	0.37	0	0.37	Paved	City Line	Lisa Lane	no
Hanger Lake	Road				4	0	0.26	0	0.26	0	Unpaved	Englehardt Lane	Lisa Lane	yes
Hanger Lake	Road				4 Woodburn #5/ETZ Minor	0	0.07	0	0.07	0.07	Paved	Hamelson Street	Linden Avenue	yes
Hanks	Drive				3 Bumgarner	0.06	0	0.06	0	0.06	Paved	Poel St	NM 478	yes
Hannah	Court				1 Mesquite	0	0.08	0	0.08	0	Unpaved	Willow Creek	Prop Line	no
Happy	Place				1	1.29	0	1.29	0	1.29	Paved	NM 478	Bosque Road	yes
Harding	Road				3 Talavera Subdivision	0	0	0	0	0	Unpaved	Culvert	Flores Road	no
Hardrock	Road				1 Mountain View Add.	0.25	0	0.25	0	0.25	Paved	B-010	NM 28	yes
Hare	Road				1	1.63	0	1.63	0	1.63	Paved	NM 140	0.15 miles north	yes
Harfacker	Road				5 Rincon	0.15	0	0.15	0	0.15	Paved	Parrigan Way		yes
Harlan	Street				4 Kissiah Parrigin No 10 rep 1	0	0.08	0	0.08	0	Unpaved	I-10 Frontage Road	NM 478	no
Harmony	Court			1/3		1.72	0	1.72	0	1.72	Paved	City line on n end	Hanks Dr	yes
Harper	Road				3	0.21	0	0.21	0	0.21	Paved	Airport Rd	Cul-de-sac	yes
Harrelson	Street				2 Santa Teresa Ind. Park	0.26	0	0.26	0	0.26	Paved	Mayfield Lane	Cul-de-sac	yes
Harrier	Drive				5 Harris Farm Subdivision	0.27	0	0.27	0	0.27	Paved			yes
Harris	Road				1 Bucklew Subdivision	0	0	0	0	0	Unpaved			yes
Hartman	Street				2	0	0.14	0	0.14	0	Paved	D-051 Sign	D-028	no
Harvest Moon	Place				1	1.03	0	1.03	0	1.03	Paved	Jarrman		yes
Harvey Farm	Road				2	0	0	0	0	0	Unpaved	CR E-10	End of Road	no
Hatheyway	Lane				1 Rincon	0	0.11	0	0.11	0	Unpaved	El Centro		no
Hauser	Street				4 Moongate	0	0.09	0	0.09	0	Unpaved	Windmill Rd		no
Hawk	Road				3 Organ Mesa Subd, Ph2	0.12	0	0.12	0	0.12	Paved	3rd St	Cul de Sac	yes
Hawk Eye	Place				3 Mesquite	0.06	0	0.06	0	0.06	Paved	St. Tomas	San Miguel	yes
Hawkeye Canyon	Court				1 Salem	0.24	0	0.24	0	0.24	Paved	E-44	Monroe	yes
Hawthorne	Street				3 Summit Chase 8&9	0.91	0	0.91	0	0.91	Paved	Huntiers Chase	Dona Ana Rd	yes
Hayes	Street				2	0.04	0	0.04	0	0.04	Paved	Vinton	cul-de-sac	yes
Hayride	Road				1 Helios Farm	0	0.11	0	0.11	0	Unpaved	Hwy 28	dead end	no
Haynde	Court				3 Organ Mesa Subd, ph 2	0.08	0	0.08	0	0.08	Paved	S Fairacres	cul de sac	yes
Hazen	Court					0	0.02	0	0.02	0.02	Unpaved	Organ Mesa Loop	Cul de Sac	yes
Heavenly	Lane					0	0.1	0	0.1	0.1	Paved			no
Helen's	Place					0	0.08	0	0.08	0.08	Paved			yes
Helios Farm	Court					0.08	0	0.08	0	0.08	Paved			yes
Hembrillo Canyon	Court					0.08	0	0.08	0	0.08	Paved			yes



DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
Hembrillo Pass	Road				3 Organ Mesa Subd, ph 2	0.12	0	0.12	0	0.12	paved	Organ Mesa Loop	Soledad Canyon ct	yes
Hendrich	Road				2 Lake Section Subdivision #2	0	0.49	0	0.49	0	Unpaved	Byrum Road	Echna Road	yes
Heno Mine	Trail				3 Talavera Subdivision	0	0.31	0	0.31	0	Unpaved	Soledad Canyon	End of road	no
Heneford	Boulevard				4 Cattleland Estates	0.01	0.51	0.01	0.51	0	Paved & Unpaved	Charolais Road	Highway 70	yes
Hermanitas	Place				4	0	0	0	0	0	Unpaved	Windmill	County Line Drive	no
Hermosa	Drive				2 Charles F. Davis Subdivision	1.96	0	1.96	0	1.96	Paved	Chaparral	Franklin Street	yes
Herrera	Road				1	1.11	0	1.11	0	1.11	Paved	Route 140	Franklin Street	yes
Hidalgo	Place				3	0	0	0	0	0	Unpaved	Red River		no
Hidden	Lane				1	0	0	0	0	0	Unpaved	San Ysidro		no
Higgins	Lane				4 Butterfield Park	0.58	0	0.58	0	0.58	Paved	Property Line	Desert Park Ave.	yes
High Hopes	Road				1	0	0.17	0	0.17	0	Unpaved	Jornada		no
High Valley	Road				2 Vista Del Rey Subd.	0	0.32	0	0.32	0	Unpaved	Santania Rd	B-19	yes
Highland	Lane				1	0	0	0	0	0	Unpaved	Dona Ana Road		no
Highline	Road				1	0	0.4	0	0.4	0	Unpaved	NM 227	end of road	no
Hilda	Road				1	0	0	0	0	0	Unpaved	NM 228	Red River	no
Hildaigo	Place				3	0	0	0	0	0	Udeveloped	Weinreich	Westview	yes
Hillcrest	Avenue				1	0.12	0	0.12	0	0.12	Paved	Weinreich	Westview	yes
Hilltop	Avenue				1	0.12	0	0.12	0	0.12	Paved	Weinreich	Clovis	yes
Hobbs	Road				1 Brazito Acres	0.13	0	0.13	0	0.13	Paved	Ma Bell Cable Box	Western View	yes
Holcomb	Road				1	0.65	0.1	0.65	0.1	0.75	Paved & Unpaved	NM478	NM 478	yes
Holguin	Road				1	1.28	0	1.28	0	1.28	Paved & Unpaved	Union	Linden Avenue	yes
Hollyhook	Avenue				3 Bumgarmer	0.06	0.08	0.06	0.08	0.14	Paved & Unpaved	Hwy 70	Unknown Point	yes
Holman	Road				4	7.65	0	7.65	0	7.65	Paved	Joyce Lane	NM 70	yes
Holsome	Drive				4 June Acres	0.76	0	0.76	0	0.76	Paved	NM 478	private prop	no
Holy Cross	Road				2	0	0.58	0	0.58	0	Unpaved	NM 228	Cul-de-sac	yes
Homestake	Road				1 Valle De Oro	0.1	0	0.1	0	0.1	Paved	Motherlode Tr	cul de sac	yes
Homestead	Court				3	0.09	0	0.09	0	0.09	Paved	Ladera Canyon	Macarthur Road	yes
Honda Real	Road				3	0	0	0	0	0	Unpaved	Moongate Road (D-069)	Espiga	no
Hondo	Road				4 Moongate	0	0.49	0	0.49	0	Unpaved	9255 sign	D-052	yes
Honeysuckle	Lane				2	0	0.18	0	0.18	0	Unpaved	Venadito	Gate	no
Hoover	Street				1 Salem	0.18	0.07	0.18	0.07	0.25	Paved & Unpaved	Desert Aire	Hot Peppers	no
Hope	Road				1	0.43	0.65	0.43	0.65	1.08	Paved & Unpaved	Holsome Road (East)	Holsome Road (West)	no
Hope Farm	Road				2	0	0.24	0	0.24	0	Unpaved	Boiling Lane	End of Pavement	no
Hopi	Street				3	0	1.49	0	1.49	0	Unpaved	N. 85	river	no
Horace	Lane				4 June Acres	0	0.28	0	0.28	0	Unpaved	Stern Dr	End of road	no
Horizon	Arc				1 Linda Vista Estates	0.03	0	0.03	0	0.03	Paved	El Nogal Lane		no
Hornor	Road				1	0	0.15	0	0.15	0	Unpaved	Lake Lucero Loop	Cul de Sac	yes
Horny Toad	Road				2	0	0	0	0	0	Unpaved	Horseshoe (East)	Horseshoe (West)	yes
Horse Ride	Place				3 Organ Mesa Ranch Phase 3	0.22	0	0.22	0	0.22	Paved	Picacho	end of drive	no
Horse Springs	Court				1 Saddle Creek Estates	0.61	0	0.61	0	0.61	Paved	Finley	Shiprock	no
Horseshoe	Cr				2 Mountain View Est.	0	1.99	0	1.99	0	Unpaved	Hummingbird Drive	Center of Court	yes
Hoskins	Lane				1 Country Acres Phase #2	0.03	0	0.03	0	0.03	Paved	Donna Ana Road	End of Pavement	yes
Huaco	Road				1 Country Acres Phase #2	0.22	0	0.22	0	0.22	Paved	Stanley	Prop Line	no
Huemac	Street				2 Country Acres Phase #2	0	0.12	0	0.12	0	Unpaved	Desert Edge	Dead End	no
Hummingbird	Court				3 Summit Chase	0.1	0	0.1	0	0.1	Paved	Organ Mesa Loop	Cul-de-sac	yes
Hummingbird	Drive				3 Summit Chase	0.82	0	0.82	0	0.82	Paved	Constitution Rd	Cul-de-sac	no
Hunt	Drive				2 Guy Keating Village	0	0	0	0	0	Unpaved			no
Hunters	Court				1 Fort Seiden	0.46	0.18	0.46	0.18	0.64	Paved & Unpaved			no
Hunters Chase	Road				3 Organ Mesa Subd, ph1	0.11	0	0.11	0	0.11	Paved			yes
Hurd	Road				1 Coronado Ridge Ph III	0.13	0	0.13	0	0.13	Paved			no
Hurt	Road													
Ice Canyon	Lane													
Idyll	Court													

DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
Inca	Street			1		0	0.51				0 Unpaved	NM154	End of road	no
Inca Dove	Avenue			4	Inspiration Heights Phase 1	0.2		0.2			0.2 Paved	Phonix Street	Gadwall Place	yes
Indian	Lane			1	N. of Mesquite	0	0.16				0 Unpaved	NM 478	private prop.	no
Indian Head	Road			4	Moongate	0	0.49				0 Unpaved	Moongate	McArthur	no
Indian Trails	Road			1	Fort Selden	0	0				0 Unpaved	Desert Edge	Tel High	no
Indigo	Lane			2	Indigo Estates	0	0.24		0.24		0 Unpaved	Lisa	cul-de-sac	yes
Indio	Way			1		0	0.06				0 Unpaved	B-20	Strauss Road	no
Industrial	Road			2		1.58		1.58			1.58 Paved	Airport Rd	end of road	yes
Inez	Court			1							0 Unpaved	San Ysidro	end of road	no
International	Bleway			2		4.98		4.98			4.98 Paved	A-03A	Temp. port	yes
Iron Shoe	Road			1		0	0.38				0 Unpaved	US Hwy 85	Cristo Rey	no
Isaac Garcia	Lane			1	Lyons Country Estates	0.15	0	0.15			0.15 Paved	Ledesma	Feagen Alley	yes
Isaacks	Avenue			5		0.35	0	0.35			0.35 Paved	Route 85	Landfill Road Block	yes
Isaacks	Avenue			4		0.67	0	0.67			0.67 Paved	Highway 70	End of road	yes
Isia Vista	Avenue			2		0	0				0 Unpaved	Optiz Rd	Cul-de-sac	no
Island	Court			1	Coronado Ridge	0.08	0	0			0 Paved	Constitution Rd	End of road	no
Isolation Point	Road			4		0	0.21				0 Unpaved	Holman	End of road	no
Ivory Wing	Lane			4		0	0				0 Unpaved	Hwy 70	Hanger Lake Rd	no
Ivy	Place			1		0	0				0 Unpaved	Vine		no
Ivy Hill	Court			2	Sunny Ridge Subd	0	0				0 Paved	Cherry Hill		no
J H Sharp	Road			3		0.13	0	0.13			0.13 Paved	Georgia O'keefe		yes
J.D. Ranch	Court			1	J.D. Ranch Est.	0	0				0 Unpaved	Station		no
J.J.	Lane			1		0	0				0 Unpaved	El Camino Real (C-075)	Ditch	no
Jack Rabbit	Road			4	Moongate	0	1.38				0 Unpaved	Corona Rd	Hondo	no
Jackson	Lane			1	Sundown Acres	0	0.1				0 Unpaved	E. End Jackson	Dead End	no
Jacobs	Lane			4		0	0.12				0 Unpaved	Luna Vista	Spur Ln	no
Jacquez	Road			2		0	0				0 Unpaved	Three Saints		no
Jaeger	Place			4	Inspiration Heights Phase 1	0.08	0	0.08			0.08 Paved	Arroyo Rd.	End of Pavement, Subdivis	yes
Jaime	Place			2	Paradise Hills	0.26	0	0.26			0.26 Paved	C-052	Center of Court	yes
Jamaica	Lane			2		0.16	0	0.16			0.16 Paved	Las Palamers	Palm Tree	yes
Jamez	Way			1		0	0.08				0 Unpaved	Windmill		no
Jan	Lane			4		0	0.12				0 Unpaved	Tammy Ln	Arroyo	no
Janet Ann	Lane			5		0.31	0	0.31			0.31 Paved	Dolittle	Mayfield	no
Jarron	Road			1		0	0.21				0 Unpaved	Minter	leave	yes
Javelina	Street			2	Mountain View Est.	0	0.99		0.99		0.99 Unpaved	Shiprock	Finley St.	no
Jean	Avenue			1	Vista Del Sol Subdivision	0	0				0 Paved			yes
Jeanie	Court			1	Taylor Farms	0.07	0	0.07			0.07 Paved	Route 85	Center of Court	yes
Jeannie	Lane			2	De Lara Estates	0	0.19		0.19		0.19 Unpaved	Quiet Pines	De Lara	yes
Jeffers	Street			4		0	0.49				0 Unpaved	Arroyo Rd.	Luna Vista	no
Jefferson	Street			1		0	0				0 Paved			no
Jemez	Way			1		0	0				0 Unpaved	Windmill		no
Jester	Place			4	McLind Subd	0	0				0 Paved			no
Jesus Silva	Street			1	Rodey	0.14	0.09	0.14	0.09		0.23 Paved & Unpaved	5th Street	2nd Street	yes
Jeweled Mesa	Drive			2	Santa Teresa	0	0				0 Paved			no
Joe Gutierrez	Street			1		0.47	0	0.47			0.47 Paved	Thorpe	Cristo Rey	yes
Joel	Road			1		0.06	0	0.06			0.06 Paved	NM478	Center of Court	yes
John Grisham	Drive			1/3	Mesquite	0.2	0	0.2			0.2 Paved	St. Tomas	NM228	yes
John Muir	Road			3	Talavera Subdivision	0	0				0 Unpaved	Silver King	C-095 Sign	no
Johnson	Lane			3		0.38	0.13	0.38	0.13		0.51 Paved & Unpaved	Las Alluras	Cattle Guard North of E79	yes
Jornada	Road			4		0	4.45		4.45		4.45 Paved & Unpaved	Thurmond Road	Main Street	yes
Jose Serna	Avenue			1	Rodey	0.13	0	0.13			0.13 Paved	Miranda Street	McGuify	yes
Joseph H	Lane			4		0	0.38				0 Unpaved	Jornada		no
Josephine	Street			1	La Mesa Subdivision	0.22	0.08	0.22	0.08		0.3 Paved & Unpaved	San Jose	Center of Court	yes

DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist.	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co.
Journey	Court					0	0.09				0 Unpaved	Parragin Way	Cul-de-sac	no
Joy	Drive		1/2		4 Kissiah Parragin #10	0.29	0	0.29		0.29	Paved	Joy Road(A-059)	Bosque Road (A-413)	yes
Joy	Drive		1/2			0.71	0	0.71		0.71	Paved	Optiz Road	Monte Vista Drive	yes
Joy	Drive		1/2			1.83	0	1.83		1.83	Paved	Optiz Road	Bosque Road	yes
Joyce	Drive		1/2			0.69	0.35	0.69	0.35	1.04	Paved & Unpaved	Hwy478	Anthony Dr	yes
Juan Diego	Street				4 June Acres	0	0.19	0	0.19	0	Unpaved	Holsome Road (West)	Holsome Road (East)	no
Jupiter	Avenue		3			0.14	0.34	0.14	0.34	0.48	Paved & Unpaved	Stern Drive	Center of Court	yes
Justin	Lane		4		Pioneer Subdivision	0	0			0	Unpaved			no
Justin	Court		1		Linda Vista Estates	0.45	0.57	0.45		0.45	Unpaved and Paved	La Quinta	Boling Ln	yes
Justin	Court		1		Linda Vista Estates	0.09	0	0.09		0.09	Paved	Justin Lane	End of Cul-de-Sac	yes
Kalancho	Court		3		Las Alluras Subd. Phase #6	0.08	0	0.08		0.08	Paved	Sotoi Road	Center of Court	yes
Kalvin	Place		1		Fort Selden Acres	0.07	0	0.07		0.07	Paved	Daniel Court	Fort Selden Road	yes
Kangaroo	Court		4			0	0.1	0		0	Unpaved	Outback Dr		no
Kamie	Lane		1			0	0			0	Unpaved	Travis		no
Katie	Place		1		Del Norte Country Estates	0.12	0	0.12		0.12	Paved			yes
Katydid	Lane		2			0.19	0	0.19		0.19	Paved	Lisa	Cul-de-sac	yes
Keelo	Road		1		Keelo	0.19	0	0.19		0.19	Paved	Dona Ana Road	Ma. Bell Cable Box	yes
Kelli	Cr.		5		Sundown Acres	0.38	0	0.38		0.38	Paved	Kristen Dr (w)	Kristen Dr (e)	yes
Key Deer	Ct		4		Los Venados Estates	0.62	0	0.62		0.62	Paved	Fallow Deer Street	Cul-de-sac	no
Kight	Road		1			0.62	0	0.62		0.62	Paved	Two County rd	end	yes
Kill	Road		2			0	0			0	Unpaved	Provenico		no
Killdeer	Road		2		The Bluffs Subdivision	0.25	0	0.25		0.25	Paved	Cul de Sac	McNutt Road	yes
King Edward	Avenue		1		Royal Valley Unit #1	0.26	0	0.26		0.26	Paved	D-028		yes
King James	Avenue		1		Royal Valley Unit #2	0.22	0	0.22		0.22	Paved	D-28	Royal Valley Drive	yes
Kingman	Street		1		Rincon	0.06	0	0.06		0.06	Paved	NM 140	E-013	yes
Kings	Road		4			0	0.57	0		0	Unpaved	Holman Road	Queen Ann CT	no
Kiowa	Road		4		Vista Del Rey Subd.	0	0			0	Unpaved	Del Rey		no
Kirkpatrick	Ave		1			0	0.67	0	0.67	0.67	Unpaved	B-030	B-049 Sign	yes
Kissiah	Drive		4		Kissiah-Parragin	0.97	0	0.97		0.97	Paved	Peachtree Hillis Road	Telephone Pole	yes
Kil Carson	Road		1			4.7	0	4.7		4.7	Paved	NM 140	Levee Maintenance Road	yes
Kille	Court		2		Desert Shadow	0.08	0	0.08		0.08	Paved	Willet Dr	west end	yes
Kittyhawk	Bld		2		Santa Teresa Business Park	0.19	0	0.19		0.19	Paved	Earhardt	Runway	yes
Knight	Road		1			0.61	0	0.61		0.61	Paved	Two Counties Rd	End of Road	yes
Koogle	Road		2		West Hills Subd.	0.67	0	0.67		0.67	Paved	McNutt	N Valley Vista Dr	yes
Kriegel	Road		2			0	1.11	0	1.11	1.11	Unpaved	NM 28	NM 273	yes
Kristin	Drive		5		Sundown Acres	0.11	0	0.11		0.11	Paved	Dona Ana Road	Kristen Circle	yes
Kristin	Drive		5		Sundown Acres	0.37	0	0.37		0.37	Paved	Kristen Drive	Kristen Drive	yes
Kyle	Road		4			0	0.25	0		0	Unpaved	Stanley	Kings	no
L. B. Lindbeck	Road		1		Radium Springs	0.48	0	0.48		0.48	Paved	Fort Selden	end of road	yes
La Adobe	Lane		2		West Hills Subd	0	0.12	0		0	Unpaved	Tierra Viata Dr.		no
La Cueva Mine	Road		3			0	0			0	Unpaved	Soladad Canyon		no
La Fe	Avenue		1		Del Cerro Estates	0.52	0	0.52		0.52	Paved	I-10 Frontilage Road	Ojito Ave.	yes
La Fleche	Place		3		Rancho Del Gallo Unit 2	0.13	0	0.13		0.13	Paved	Harvey Farm Rd	Cul de Sac	yes
La Jolla	Drive		4		Mesa La Jolla #2	0.08	0	0.08		0.08	Paved	Chincahua		yes
La Luz	Avenue		5			0.23	0	0.23		0.23	Paved	C-064	Center of Court	yes
La Paloma	Court		4		Mirrasol Subd. Phase #2A	0.18	0	0.18		0.18	Paved	Center of Court	Amarillo del Sol	yes
La Pradera	Road		1			0	0.32	0		0	Unpaved			no
La Puente	Lane		3		Barela Subdivision	0	0.13	0	0.13	0.13	Unpaved	Union	End of Road	yes
La Quinta	Street		1		La Quinta	0.61	0	0.61		0.61	Paved	Quisenberry (east)	Quisenberry (west)	yes
La Reina	Road		4			1.02	0.66	1.02	0.66	1.68	Paved & Unpaved	D-026 D-035 Junction	Sunland Avenue	yes
La Rock	Court		2			0	0	0		0	Unpaved			no
La Septia	Court		4			0	0.1	0		0	Unpaved	Runalong Rd	End of road	no



DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
La Union	Street				2 Town of La Union	0.22	0.21	0.22	0.21	0.43	Paved & Unpaved	Visnaga	Mercantile	yes
La Vina	Avenue				2 Town of Chamberino	0	0.58	0	0.58	0.58	Unpaved	Dead End Sign	NM 28	yes
Ladera	Avenue				1 Old Picacho	0.14	0	0.14	0	0.14	Paved	Main Street	Pvt. Property Fence Line	yes
Ladera Canyon	Road				3 Organ Mountain Heights	0	0.69	0	0.69	0	Unpaved			no
Ladera Seca	Court				3 Ladera Seca Subd	0.05	0	0	0	0	Unpaved	Ladera Canyon	End of Cul-de-Sac	no
Ladobe	Court				2 West Hills Subd.	0	0.12	0	0.12	0.24	Unpaved	Tierra Vista	Spritt Hill dr.	no
Lake Lucero	Loop				3 Organ Mesa Ranch Phase 3	0.24	0	0.24	0	0.24	Paved	Sheep Spring	Horse Spring	yes
Lakecity	Ave				4	0	0.48	0	0.48	0	Unpaved	Holman	end of pavement	no
Lakeside	Drive				1	0.34	0	0.34	0	0.34	Paved	NM Hwy 292	end of pavement	no
Lamar	Road				3	0.74	0	0.74	0	0.74	Paved	Pajaro	Ma. Bell Cable Box	yes
Landfill	Road				2	0	0.04	0	0.04	0	Unpaved	Lisa		no
Langford	Avenue				2 Green Meadow Estates	0.4	0	0.4	0	0.4	Unpaved	Green Meadows Rd.	East Drain Drive	yes
Lara	Road				2	0.42	0	0.42	0	0.42	Paved	NM 28	Culvert	yes
Larimer	Lane				4 Butterfield Park	0.47	0	0.47	0	0.47	Paved	Smith Lane	Highway 70	yes
Lark	Place				1 Country Acres Phase #6	0.03	0	0.03	0	0.03	Paved	Lopez	Cul-de-sac	yes
Larkspur	Court				1	0.06	0	0.06	0	0.06	Paved	Larkspur Way	Cul-de-sac	no
Larkspur	Way				1 Ruby Ridge	0.74	0	0.74	0	0.74	Paved/Unp	Dusty Prints	Center of Court	no
Larrea	Court				3 Las Alturas Subd. Phase #6	0.05	0	0.05	0	0.05	Paved	Tobosa	End of Cul-de-Sac	yes
Las Casitas	Court				3 Las Alturas Subd	0.09	0	0.09	0	0.09	Paved	Ladera Canyon	End of Cul-de-Sac	no
Las Casas	Court				1 Picacho Hills	0.03	0	0.03	0	0.03	Paved	Picacho Hills Dr		no
Las Colmenas	Road				1	0	0.28	0	0.28	0	Unpaved	Camunez Rd	Hwy 192	no
Las Flores	Circle				1 Alto De Las Flores	0.36	0	0.36	0	0.36	Paved	Alargo (East)	Alargo (West)	yes
Las Golondrias	Court				4 Mirasol Subd. Phase #2B	0.1	0	0.1	0	0.1	Paved	Center of Court	Mirasol	yes
Las Laureles	Court				4 Mirasol II-C	0.11	0	0.11	0	0.11	Paved	Mirasol	End of Cul-de-Sac	yes
Las Lillas	Way				3	0	0.08	0	0.08	0	Unpaved	Snow	end of road	no
Las Lomas	Drive				2 Meadow Vista Subdivision	0	0	0	0	0	Unpaved	off E. Organ Rd.	Valles rd. E. of Lateral	no
Las Mananitas	Lane				2	0	0.1	0	0.1	0	Unpaved	Amarillo Del Sol	Mirasol	yes
Las Palmas	Street				4 Mirasol Subd. Phase #2C	0.11	0	0.11	0	0.11	Paved	Hwy 478		yes
Las Palmeras	Loop				1 Las Palmeras	0.14	0	0.14	0	0.14	Paved	NM 228		yes
Las Parcelas	Road				1 Herrera Acres	0.3	0	0.3	0	0.3	Paved	Las Alturas	End of Road	yes
Las Piedras	Road				3 Teibrook Subdivision	0.37	0	0.37	0	0.37	Paved	Raasaf Cr.	end of pavement	yes
Las Vistas	Drive				1 Las Vistas Subdivision	0.2	0	0.2	0	0.2	Paved	Stern	Private Property	yes
Lassiter	Road				3	0.67	0	0.67	0	0.67	Paved			yes
Last Chance	Road				3 Talavera Subdivision	0	0	0	0	0	Unpaved			no
Last Chance	Lane				3	0	0.29	0	0.29	0	Unpaved	Hwy 85	Ironshoe Rd	no
Last Chance	Lane				1	0	0.29	0	0.29	0	Unpaved			no
Leasburg	Drive				1 Dona Villa	0.52	0	0.52	0	0.52	Paved	Rancho Algodones	Dona Villa	yes
Leasburg Dam	Road				1	1.01	0.43	1.01	0.43	1.44	Paved/Unpaved	Fort Seldon Road	North End	yes
Lebanon Arc	Road				3 Mesilla Park	0.19	0	0.19	0	0.19	Paved	Conway Ave.	Conway Ave	yes
Lechuga	Road				1	1.13	0	1.13	0	1.13	Paved	NM 478	Private Property Gate	yes
Ledesma	Drive				1 Dona Ana	0.91	0	0.91	0	0.91	Paved	Romero	Joe Gutierrez	yes
Ledesma	Lane				4	0	0.62	0	0.62	0	Unpaved	Holman	Doubletree	no
Leghorn	Loop				5 Rancho Del Gallo Unit	0.33	0	0.33	0	0.33	Paved	Catalana Drive	Catalana Drive	yes
Leifeste	Road				2	0	0.15	0	0.15	0	Unpaved	NM 460	Night Owl	no
Lenny	Lane				1	0	0.13	0	0.13	0	Unpaved	Dona Ana Road	End of Road	no
Leo	Drive				1	0	0.12	0	0.12	0	Unpaved	South Aries	End of Road	no
Leroy	Lane				1	0	0.08	0	0.08	0	Unpaved	Cherry Cider		no
Lexington	Road				1	1.4	0	1.4	0	1.4	Paved	Carnegie Hills	Loma Parda	yes
Leyendecker	Road				3	0.26	0.27	0.26	0.27	0.53	Paved & Unpaved	Del Rio Lateral	Snow Rd	yes
Liberty	Court				2	0	0.32	0	0.32	0	Unpaved	Chambirino lateral		no
Libra	Drive				1	0	0.02	0	0.02	0	Unpaved	South Aires	Virgo Loop	no
Lillian	Court				1 Saddle Creek Estates	0.04	0	0.04	0	0.04	Paved	Singer Road	Celer of Court	yes
Lilly Pad	Lane				3	0	0.09	0	0.09	0	Unpaved	Cummingham		no
Lily	Way				3	0	0.13	0	0.13	0	Unpaved	Singh Rd	Private prop	no

DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
Liminous	Lane					0	0	0	0	0	Unpaved	Moonview		no
Linda Vista	Road					0.25	0	0.25	0	0.25	Paved	Loya	Sandy Hill	yes
Lindbergh	Drive					0.37	0	0.37	0	0.37	Paved	Airport Rd	Cul-de-sac	yes
Linden	Avenue					0.23	0	0.23	0	0.23	Paved	C-033 Sign	Union	yes
Linden Tree	Court					0	0.06	0	0.06	0	Unpaved	McNutt		no
Links	Road					0.57	0	0.57	0	0.57	Paved	Stern	Anthony Dr	no
Lion Den Canyon	Way					0.16	0	0.16	0	0.16	Paved	Organ Mesa Loop	Cul-de-sac	yes
Lino	Lane					0.08	0	0.08	0	0.08	Unpaved	Singh		no
Lisa	Lane					0.05	0	0.05	0	0.05	Paved	Weisner	Wagons East	yes
Lisa	Lane					0.49	0	0.49	0	0.49	Unpaved	Weisner	Hanger Lake	no
Lister	Drive					1.1	0	1.1	0	1.1	Paved	Start of Pavement	B-024	yes
Little	Road					1.8	0	1.8	0	1.8	Paved	Hwy 28	Haasville	yes
Little Crow	Drive					0	0	0	0	0	Unpaved			no
Locust	Street					0.21	0	0.21	0	0.21	Paved	Union	First Street	yes
Loma Bella	Drive					0.18	0	0.18	0	0.18	Paved	Desert Mirage Dr	Cul de Sac	yes
Loma Real	Road					0	0.26	0	0.26	0	Unpaved	Ladera Canyon		no
Loma Vista	Drive					0	0	0	0	0	Unpaved			no
Lomas	Avenue					0.4	0	0.4	0	0.4	Paved	Start of Pymt E. of Plaza	Rincon	no
Lomas Del Valle	Place					0	0.1	0	0.1	0	Paved	Windmill Rd	Prop line	yes
Lonsome	Road					0.07	0.11	0.07	0.11	0.18	Paved & Unpaved	Picacho	Private Drive	yes
Lonesome Pine	Road					0	0.23	0	0.23	0	Unpaved	Westwind		no
Lonewolf	Court					0	0.14	0	0.14	0	Paved	Dunn		no
Long Canyon	Court					0	0.06	0	0.06	0	Unpaved	Pena Blanca		no
Long River	Lane					0	0.29	0	0.29	0	Unpaved	Fairview	end of road	no
Longhorn	Drive					0.69	0	0.69	0	0.69	Paved	Brahman (D-069A)	Center of Court	yes
Longview	Lane					0	1.91	0	1.91	0	Unpaved	Thurmond		no
Lookout View	Place					0.06	0	0.06	0	0.06	Unpaved			no
Loomis	Drive					0	0.18	0	0.18	0	Unpaved	Hwy 28	End of road	no
Lopez	Avenue					0.59	0.4	0.59	0.4	0.99	Paved & Unpaved	Padre Pio Ave	Dead End Sign	no
Lopez	Road					0.84	0	0.84	0	0.84	Paved	Dona Ana Road	Highway 85	yes
Lords Ranch	Road					2.46	0	2.46	0	2.46	Paved	I-10 Inter./B-019 Sign	Cattleguard	yes
Lores Gorney	Way					0	0.07	0	0.07	0	Unpaved	Shoestring Ranch		no
Lorraine	Lane					0	0.39	0	0.39	0.39	Unpaved	De Lara Dr.	Quiet Pine	yes
Los Cocos	Drive					0	0	0.27	0	0.27	Unpaved	Las Palmers		yes
Los Encinos	Way					0	0.11	0	0.11	0	Unpaved	NM460		no
Los Morenos	Court					0	0.08	0	0.08	0	Unpaved	Moreno		no
Los Olivos	Avenue					0	0.39	0	0.39	0	Unpaved	Shrode Rd.		no
Los Pinos	Way					0.26	0	0.26	0	0.26	Paved	N. Vinton Rd.		no
Los Tios	Place					0	0.22	0	0.22	0	Unpaved	Gato Rd		yes
Los Vaqueros	Court					0.03	0	0.03	0	0.03	Paved	Los Vaqueros Dr	Cul-de-sac	no
Los Vaqueros	Drive					0.17	0	0.17	0	0.17	Paved	Baylor Canyon	Roundup Ct	yes
Los Viemes	Boulevard					0	0	0	0	0	Unpaved			yes
Lost	Lane					0	0.28	0	0.28	0	Unpaved	Barela Rd	Willow Creek	no
Lost Dutchman	Drive					0.25	0	0.25	0	0.25	Paved	NM 228	White Oaks Road	yes
Lost Padre Mine	Road					0	1.95	0	1.95	0	Unpaved			no
Lost Wrangler	Way					0	0	0	0	0	Paved	Westwind Rd	end of road	no
Love	Court					0.06	0	0.06	0	0.06	Paved	Linden	Harelson	yes
Loya	Lane					0.2	0	0.2	0	0.2	Paved	Derby	Picacho	yes
Lt. Ralph J. Silva	Street					0	0	0	0	0	Paved	Robert Larson	NM Correctional Fac.	no
Luciano Chavez	Street					0.17	0	0.17	0	0.17	Paved	5th Street Telephone Pole	E-019	yes
Lucky Lindy	Lane					0	0.26	0	0.26	0	Unpaved	San Ysidro	end of road	yes
Lujan	Court					0	0	0	0	0	Unpaved			no

DAC Road Inventory 2017

3/10/2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
Lujan Hill	Road			1		0	0				0 paved			
Luminous	Lane			2		0.15	0	0.15			0.15 Paved		NM 85	no
Luna	Drive			2	Desert Aire Estates	0	0.23	0.15	0.23		0.23 Unpaved		west end	yes
Luna Azul	Drive			2	Chaparral Subdivision	2.48	0	2.48			2.48 Paved & Unpaved		Wheatstone	yes
Luna Serano	Court			3		0	0.07				0 Unpaved		County Line Drive	yes
Luna Vista	Road			4	Moongate	1	0	1	0		1 Paved		Wind Dancer	no
Macarena	Avenue			2		0	0.48				0 Unpaved		Brahaman Rd	yes
MacArthur	Road			4	Moongate	1.02	0.48	1.02	0.49		1.51 Paved & Unpaved		Montana Vista	no
Magic Shadow	Drive			2	Santa Teresa #5	0	0				0 Paved		Luna Vista Drive	yes
Magic Shadow	Lane			2	Santa Teresa #4	0	0				0 Paved			no
Maguay	Street			2	Colquit Subdivision	0	0.17		0.17		0.17 Unpaved		Autum Sage	yes
Maholo	Court			4		0	0.14				0 Unpaved		end of road	no
Main	Street			1	Pure Water Addition	0	0.13		0.13		0.13 Unpaved		Dead End	yes
Main	Street			1	Hatch	0	0				0 Paved			no
Maldonado	Road			2		0	0.15				0 Unpaved			no
Mangas	Avenue			4	Mesa La Jolla 2	0.06	0	0.06			0.06 Paved		Mangas Tr	yes
Mangas	Trail			4	Mesa La Jolla 2	0.1		0.1			0.1 Paved		south end	yes
Mantooth	Loop			1		0.65	0	0.65			0.65 Paved		Loop	yes
Marzana	Avenue			2	Meadow Vista Subdivision	0	0				0 Paved			yes
Maplewood	Ave			1	San Miguel	0.06	0	0.06			0.06 Paved		Rosewood/ie. third	no
Maravilla	Lane			1	Meaquite	0	0.08				0 Unpaved			yes
Marachi	Place			3		0	0				0 Unpaved			no
Mariano Trujillo	Avenue			1	Rodey	0.07	0.11	0.07	0.11		0.18 Paved & Unpaved		Miranda Street	no
Margold	Street			1	Mountain View Add.	0.14	0	0.14			0.14 Paved		Wiley	yes
Marisa	Court			5	Rancho Del Gallo Unit	0.04	0	0.04			0.04 Paved		Catalana Drive	yes
Mark Twain	Court			1	Mesquite	0.06	0	0.06			0.06 Paved		Post	yes
Market	Place			1	Mesa Oeste	0	0.06				0 Unpaved		NM 478	yes
Marwood	Lane			1		0	0.1				0 Unpaved		Frontage rd	no
Mathis	Road			2		0	0.95		0.95		0.95 Unpaved		Morton Ln	no
Mauer	Road			1	Raasaf Hills	0	0.5		0.5		0.5 Unpaved		O'hara	yes
Maverick	Trail			1	Stone Creek Subd.	0.14	0	0.14			0.14 Paved		Mesilla Hills	yes
Maxim	Court			3	Tellbrook Subdivision	0.03	0	0.03			0.03 Paved		Northwind Road	yes
Maxine	Lane			1		0	0				0 Unpaved		Center of Court	yes
Mayfield	Lane			5		0.76	0	0.76			0.76 Paved		Center of Court	no
Mayfly	Lane			4		0	0.1				0 Unpaved		Route 85	yes
McAnally	Avenue			1	Town of Berino	0.5	0	0.5			0.5 Paved		Starry	no
McCombs	Drive			2	Chaparral Subdivision	2.52	0	2.52			2.52 Paved		Center of Court	yes
McCrimmon	Street			2		0.23	0	0.23			0.23 Paved		State Line Drive	yes
McDowell	Road			3	revised length 4.13	0.31	0	0.31			0.31 Paved		Estancia	yes
McGuffey	Road			4	Lake Section Subdivision #2	0	0.1		0.1		0.1 Unpaved		Tapir	yes
McLain	Road			2		0	0.49		0.49		0.49 Unpaved		La Guña Lateral	yes
McRimon	Street			2		0	0.1				0 Unpaved		City Limits	yes
Meador	Drive			1	Fort Selden	0	0.86		0.86		0.86 Unpaved		Echra Road	yes
Meadow	Lane			1	Northfield	0.13	0	0.13			0.13 Paved		Estancia	no
Meadow	Lane			1	Northfield	0.28	0	0.28			0.28 Paved		Desert Edge	yes
Meadow Park	Lane			1		0	0.08				0 Unpaved		D-014	yes
Meadow Vista	Boulevard			2	Meadow Vista Subdivision	0	0				0 Unpaved		Meadow Circle	yes
Medina	Avenue			2	Town of Chamberino	0.33	0.32	0.33	0.32		0.65 Paved & Unpaved		Meadow Lane	yes
Memory	Lane			2		0	0.17				0 Unpaved		Dead End	no
Mendez	Street			2	Town of La Union	0	0.13		0.13		0.13 Unpaved		Fairpark	no
Mesquil	Avenue			2		0	0.07				0 Unpaved		Lara Road	yes
Mercury	Lane			4	Pioneer Subdivision	0	0.3				0 Unpaved		NM 478	no
Merlin	Court			2	Desert Shadow	0.07	0	0.07			0.07 Paved		South Street	yes
													Delicias st	no
													Start of Pavement	no
													Sanderling	yes



DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
Mervs	Lane		1			0.27	0	0.27	0	0.27	Paved	Taylor Rd.	Marron Ct.	yes
Mesa	Street		2		State Line Addition	0	0.6	0	0.6	0	Unpaved	Clark Avenue	Davis Street	yes
Mesa	Drive		4		Mesa de Santa Fe Subd	0	0	0	0	0	Paved & Unpaved	Hwy 70	Peachtree Hills	no
Mesa de Santa Fe	Avenue		4			0.25	0	0.25	0	0.25	Paved	Victorio	Chiricahua Tr.	yes
Mesa Verde	Drive		2		Meadow Vista Subdivision	0	0.42	0	0.42	0	Unpaved	Alvarez		no
Mesa Vista	Road		2			0.05	0	0.05	0	0.05	Unpaved	Desert Mirage Dr	west end	yes
Mescal Bean	Court		4		Mesa La Jolla	0	0.26	0	0.26	0	Unpaved	D-032	Sunland Avenue	yes
Mescalero	Trail		4			1.06	0	1.06	0	1.06	Unpaved	Raasaf Cr.	End of Road	no
Mesilla Hills	Drive		1		Raasaf Hills	1.09	0	1.09	0	1.09	Unpaved	S Fairacres	Raasaf	yes
Mesilla Hills	Drive	C	1			1.51	1.12	1.51	1.12	2.63	Paved & Unpaved	County Line Drive	Greenwood Road	yes
Mesilla View	Drive		2		Chaparral Subdivision	0	0	0	0	0	Unpaved			no
Mesquite	Road		4		Moongate	0	0.13	0	0.13	0.13	Unpaved	Santa Barbara	Paxton	yes
Mesquite Alley	Street		1		Mesquite	0	0.16	0	0.16	0.16	Unpaved	NM 478 North	NM 478 South	yes
Mesquite Park	Street		1		Mesquite	0	11.14.12	0	11.14.12	0	Unpaved		at 213	no
Meyers	Road		1		deleted due to redundancy with Myers	0	0.01	0	0.01	0	Unpaved	road blocked		no
Miami	Drive		3			0	0.06	0	0.06	0	Unpaved	Chelsea Dr.		no
Mican	Court		1		Micander Acres	0	0.06	0	0.06	0	Unpaved	Sallee		no
Mickey	Lane		4			0	0.3	0	0.3	0	Unpaved	Gannat		no
Mil Acres	Street		2			0	0.07	0	0.07	0	Unpaved	El Camino Real	Cul-de-sac	yes
Milestone	Court		4		El Camino Real Estates	0.04	0	0.04	0	0.04	Paved	Weinrich	End of Road	yes
Miller	Road		1			0.3	0	0.3	0	0.3	Paved	Holtman		no
Miller	Court		4			0	0.13	0	0.13	0	Unpaved	Corre Caminos	Valle Lindo	no
Milpas	Street		2			0	0.34	0	0.34	0.34	Paved	City Limit Culvert	Fence Line	yes
Mimbres	Drive		2		Meadow Vista Subdivision	0	0.5	0	0.5	0	Unpaved	Picacho Ave.	canal	no
Mimosa	Lane		3		Pecan Valley Acres	0.34	0	0.34	0	0.34	Paved			no
Mimosa	Lane		3		Talavera Subdivision	0	0.22	0	0.22	0	Unpaved			no
Minnice	Road		3			0	0.45	0	0.45	0.45	Paved	Drain	Jarman	yes
Minnow	Lane		1		Brentwood Estates	0	0.11	0	0.11	0	Unpaved	Harding		no
Mint	Drive		4			0.45	0	0.45	0	0.45	Paved	Picacho Hills Dr	End of Road	yes
Minter	Road		1			0	0.16	0	0.16	0.16	Paved	Desert Mirage Dr	Cul de sac	yes
Mira Loma	Lane		2		Mira Loma Subd	0	0.03	0	0.03	0.03	Paved	Edge of Pavement	Dona Ana School Road	yes
Mira Montes	Court		1		Rancho de Picacho	0.16	0	0.16	0	0.16	Paved	Acosta	Granite	no
Mira Valle	Court		3		La Jolla Del Monte	0.03	0	0.03	0	0.03	Paved	Ledesma		no
Mirasol	Drive		4		Mirasol Subd. Phase #2A	0.68	0	0.68	0	0.68	Paved	Hanger Lake	Jefferies	no
Mirida	Street		2		Tierra Linda Phase 1	0.22	0	0.22	0	0.22	Paved	City Limits	Saddlewood Tr.	yes
Misquez	Circle		1			0	0.21	0	0.21	1.5	Unpaved	Stern	East Side Canal	yes
Mission	Lane		4			0	0.34	0	0.34	0	Unpaved	Armstrong Lane	Dead End	yes
Mission Bell	Avenue		3		Mission Bell	0.27	0	0.27	0	0.27	Paved	Barela		no
Missionary Ridge	Road		1			0	0.99	0	0.99	0.17	Paved	S. Fairacres	end of road	no
Missie	Lane		4		Butterfield Park	0.21	0	0.21	0	0.21	Paved	Falcon	Spanish Dagger	yes
Missie	Drive		3		Rocket Valley	0	0.16	0	0.16	0.16	Paved	End road north of Soledad	End road south of Soledad	no
Misty	Way		1			0	0.55	0	0.55	0	Unpaved	NM226	Fuego	yes
Mitchell	Circle		4			0	0.2	0	0.2	0.2	Paved & Unpaved	Montana Vista	Alamo Seco	no
MJM	Road		1			0	0.22	0	0.22	0.22	Paved	Tele Pole at End of Road	NM 460	yes
Mocking Bird	Street		3		Mission Bell	0.17	0	0.17	0	0.17	Paved	San Luiz	Dead end	yes
Modoc	Road		3		Talavera Subdivision	0	0.22	0	0.22	0	Unpaved	Joy Road	Private prop	no
Mogollon	Street		1		Mountain Valley Subd.	0	0	0	0	0	Unpaved			no
Montana Azul	Street		2			0.35	0	0.35	0	0.35	Paved			no
Montana Vista	Avenue		2		Montana Vista Subdivision	0.35	0	0.35	0	0.35	Paved			yes
Monte Alto	Street		2		Town of Chamberino	0.2	0	0.2	0	0.2	Paved & Unpaved			yes
Monte Bello	Road		2			0	0.22	0	0.22	0	Unpaved			no
Monte Vista	Court		2		Meadow Vista Subdivision	0	0	0	0	0	Unpaved			no
Monte Vista	Drive		2		Meadow Vista Subdivision	0	0	0	0	0	Unpaved			no

DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
Montes	Road					1.51	1.9	1.51	1.9	3.41	Paved & Unpaved	NM 227	NM 226	yes
Monticello	Avenue				1 Placitas	0.16	0	0.16	0	0.16	Paved	Route 26	Bianes Sireet	yes
Montoya	Road				4 Sky View Terrace	0.2	0	0.2	0	0.2	Paved	Elks Road	End of Road	yes
Montoya	Street					0	0	0	0	0	Unpaved			no
Moo	Road					0	0.13	0	0.13	0.13	Unpaved	Riverside	Ray Luchimi Rd	yes
Moon Silver	Avenue				2 Santa Teresa #7A	0	0	0	0	0	Paved	Highway 70	Rincon Road	no
Moongate	Road				4 Moongate	2.62	0	2.62	0	2.62	Paved	Castillo Rd	canal	yes
Moonlight	Road					0	0.18	0	0.18	0	Unpaved	Ambler		no
Moonsong	Circle				4	0	0.74	0	0.74	0	Unpaved	Lisa Dr	Cul-de-sac	no
Moonview	Lane				2 Galaway Subd	0.3	0.12	0.3	0.12	0.42	Paved & Un	Northwind Road	Center of Court	yes
Moraga	Court				1	0	0.04	0	0.04	0	Unpaved	Elks	End of road	no
Moreno	Road				1 Sunrise	0	0.37	0	0.37	0	Unpaved	Northwind		no
Morning Glory	Lane				1	0	0.13	0	0.13	0	Paved			no
Morning Star	Drive				2 Santa Teresa #5	0	0	0	0	0	Unpaved	Singh Rd		no
Moro	Lane				2	0	0.13	0	0.13	0	Unpaved			no
Morrison	Lane				2 Guy Keating Village	0	0	0	0	0	Unpaved			no
Morton	Lane				1	0.76	0	0.76	0	0.76	Paved	Picacho	Miller	no
Mosquito	Court				1	0	0.25	0	0.25	0	Unpaved	Estancia		yes
Mossman	Road				1	0	0.52	0	0.52	0	Unpaved	Hwy 228	B-45	no
Molher Lode	Trail				3	0.67	0	0.67	0	0.67	Paved	Silver King	Cripple Creek	yes
Motor	Lane				1	0	0.06	0	0.06	0	Unpaved	Morton Ln.	end of road	no
Mountain Vista	Drive				2 West Hills Subd	0	0.75	0	0.75	0	Unpaved	Koogle Rd.	runs n/s off Koogle	no
Muhly	Lane				2	0	0.21	0	0.21	0	Unpaved	Westview		no
Mule Creek	Street				1	0	0.08	0	0.08	0	Unpaved	Iron Shoe Rd.		no
Mulle Deer	Trail				2	0	0.21	0	0.21	0	Unpaved	Bighorn		no
Music	Lane				1 Brooks Subd	0	0.06	0	0.06	0	Unpaved	Northwind		no
Mustang	Street				1 Sleepy Farms	0	1.38	0	1.38	1.38	Unpaved	Franco Rd	Center of Court	yes
Muster	Road				2	0	0.45	0	0.45	0	Unpaved	Soukup	Lateral	no
Myers	Road				2	0.14	0.38	0.14	0.38	0.14	Paved & Unpaved	Canal	Ward	no
Myles	Road				5	0.52	0	0.52	0	0.52	Paved	Route 85	Southwind Road	yes
Mystic	Court				3 Cassidy at Sundance Acres	0.02	0	0.02	0	0.02	Paved	Supersition Drive	cul-de-sac	yes
Mystic Canyon	Drive				3 Mystic Winds	0.06	0	0.06	0	0.06	Paved	Dripping Springs Rd	Mystic Winds	yes
Mystic View	Court				3 Mystic Winds	0.21	0	0.21	0	0.21	Paved	East and west of the south end	Mystic Canyon Dr	yes
Mystic Winds	Court				3 Mystic Winds	0.12	0	0.12	0	0.12	Paved	Soledad Canyon Rd	east end	yes
N. Trevino	Road				2 Santa Teresa	0	0	0	0	0	Paved	Country Club	Apache Gold Loop	no
Nana	Trail				4 Mesa La Jolla #2	0.23	0	0.23	0	0.23	Paved	N. cul-de-sac	S. cul-de-sac	yes
Nanez	Road				2	0	0.21	0	0.21	0	Unpaved	Joy Rd.		no
Nasa	Road				4	5.3	0	0	0	0	Paved	Webb Rd	700' south of Webb Rd	no
Navajo	Trail				4 Mesa La Jolla	0.15	0	0.15	0	0.15	Paved	Carlton	Ei Camino Real	yes
Navajo	Road				1 Jornada Acres	0.22	0	0.22	0	0.22	Paved	Suntland Dr	Westmoreland Ave	yes
Navajo	Trail				4 Mesa La Jolla	0.27	0	0.27	0	0.27	Paved	Webb Rd	south end	no
Navajo	Trail				4	0.13	0	0.13	0	0.13	Paved	Indian Head		yes
Navajo	Trail				4	0	0.08	0	0.08	0	Unpaved	Snow		no
Nawarez	Court				1	0	0.45	0	0.45	0	Paved & Un	Hwy 85	End of road	no
Nieve	Lane				1	0.06	0.39	0.06	0.39	0	Paved & Un	Leifeste	Private prop	no
Nieve	Drive				1	0	0.14	0	0.14	0	Unpaved	Highway 85	Unknown Point	yes
Nighthawk	Lane				2	0	0.57	0	0.57	0	Unpaved	Raasaf		no
Nightowl	Lane				1	1.39	0	1.39	0	1.39	Paved	Higgins Lane	Smith Lane	no
Nightwatcher's	Road				1	0	0.8	0	0.8	0	Unpaved	E. end Nike	War road	yes
Nightwind	Drive				1	0.16	0	0.16	0	0.16	Paved	HWY 28	Cul de sac	no
Nike	Avenue				4 Butterfield Park	0	1.02	0	1.02	1.02	Unpaved			yes
Nike Aire(was Nike)	Street				2 Rocket Valley	0	0.11	0	0.11	0	Unpaved			yes
No Name	Court				1	0	0	0	0	0	Unpaved			no

DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
Noche Bella	Loop				3 Las Alturas	0.51	0	0.51		0.51	Paved	Telbrook	Telbrook	yes
Nopal	Lane			1		0	0.06				Unpaved	Castillo Rd		no
Nopalito	Road			4	Hacienda Acres	0	0.51				Unpaved	Private Property Fence	Maint Limit (Arroyo Seco)	no
North Aires	Avenue			1		0	0.17				Unpaved	S. Fairacres	Scorpio	no
North Fairacres	Road			1		1.12	0	1.12		1.12	Paved	W. Picacho	North Aires	yes
North Lake	Road			1		0	0				Unpaved	Del Rio Drain		no
North Villita	Loop			1	Country Walk Estates	0.31	0	0.31		0.31	Paved	US HWY 85	South Villita Loop	yes
Northfield	Road			1	Northfield	0.14	0	0.14		0.14	Paved	D-017	Meadow Lane	yes
Northgate	Road			4		0	0.36				Unpaved	Jornada	McGuffy	no
Northstar	Court			4		0	0.09				Unpaved	Desert Wind Way		no
Northview	Avenue			1		0.16	0	0.16		0.16	Paved	Barnert	Desert View	yes
Northwind	Road			1		1.2	0	1.2		1.2	Paved	Barala Road	Saddle Creek Estates Gate	yes
Nuez	Court			2		0	0.1				Unpaved	Montana Vista		no
Nuggel	Place			1		0	0				Unpaved	Stardust Ave.		no
Oak	Street			3	Bumgarner	0.12	0	0.12		0.12	Paved	County Line Drive	Unlon	yes
Oasis	Road			2	Charles F. Davis Subdivisor	1.84	0	1.84		1.84	Paved	McCombs Drive		yes
Ocaso Mirador	Road			2	El Mirador Subdivisor	0.04	0				Paved			yes
Ocotillo	Drive			3	Las Alturas Subd. Phase #6	0.56	0	0.56		0.56	Paved	Acacia	Senna	yes
Ocotillo	Trail			2		1.15	0	1.15		1.15	Paved	Tele Line N. of Arroyo	Suniland Avenue	yes
Ogaz	Avenue			1	Salem	0.24	0	0.24		0.24	Paved	E-044	Monroe Avenue	yes
O'Hara	Road			2	added 8.1.12	2.03	0	2.03		2.03	Paved	Waterfront Rd	490' west of Hwy 478	yes
Ojito	Street			1	Del Cerro Estates	0.13	0	0.13		0.13	Paved	Cristo Ave	Palmilia Ave	yes
Ojito de Madrid	Drive			2		0	1.41				Unpaved	W. of NM28		no
Old Laredo	Road			2	Chaparral North Acres Ph. 1	0.49	0	0.49		0.49	Paved	County Line Drive	Prescott Anthony Drive	yes
Old Mill	Road			4		0	0.31				Unpaved	Hwy 185	Iron Shoe	no
Old Organ Main	Street			4	Organ	0.1	0	0.1		0.1	Paved	Hwy 70	First	yes
Old Picacho	Road			1	Old Picacho	0.27	0	0.27		0.27	Paved	Private Property Gate	Shalem Colony	yes
Old River	Road			1		0	0.23				Unpaved	Carver Rd		no
Old Sequoia	Drive			2	Chaparral Subdivision	0.77	0	0.77		0.77	Paved	Amparo Road	Tornillo Flats Dr	yes
Old Country	Road			1		0	0.22				Unpaved	Hwy 26	Prop. line	no
Ollin	Lane			2	Casa Del Quinto Sol	0.12	0	0.12		0.12	Paved	Highline Rd	Quinto Sol Ln	yes
Omega	Road			2		0	0				Unpaved	Carver Rd		no
Omnie Acres	Road			3		0	0.64		0.64	0.64	Unpaved	NM 478	Snow Road	yes
Onyx	Circle			4		0	0				Unpaved	Amber Dr.		no
Opitz	Road			1/2		3.06	0	3.06		3.06	Paved	Farm Road	NM 226	yes
Orchard	Avenue			2		0	0.18				Unpaved	NM28		no
Orchid	Way			2		0	0.12				Unpaved	Singh	end of road	no
Organ	Road			2	Mountain View Estates	0	0				Undeveloped			no
Organ Main	Street			4	Town of Organ	0.14	0.08	0.14	0.08	0.22	Paved & Un	Telephone pole	Unknown	yes
Organ Mesa	Loop			3	Organ Mesa Subd. ph1	1.21	0	1.21		1.21	Paved	Dripping Springs	Entire Length	yes
Organ Mtn.	Trail			4		0	0.18				Unpaved	Baylor Tr.	Purify rd	no
Orgot	Road			1		0	0.25				Unpaved	Silver Feather		no
Orgot	Manor			1		0	0.13				Unpaved	Orgot Rd		no
Onole	Lane			3		0	0				Unpaved	Telbrook		no
Orion(Was Saturn)	Street			4	Moongate	0	0.2				Unpaved	Mongate	Cul-de-sac	no
Oteaga	Road			4		0	0.39				Unpaved	Jornada Rd	End of road	no
Osprey	Court			2	Desert Shadow	0.1	0	0.1		0.1	Paved	Willit Dr	west end	no
Otero	Street			1	Town of Berino	0.24	0	0.24		0.24	Paved/Unp	NM 226	Private Property Fence	yes
Our	Way			2		0	0.46				Unpaved	Joy Rd		yes
Outback	Drive			4		0	0.32				Unpaved	Holman		no
Outlaw	Road			4		0	0.12				Unpaved	Spur Ln	Luna Vista	no
Outpost	Lane			1		0	0.14				Unpaved	South Track Tr	end of road	no
Overcast	Street			2		0	0.12				Unpaved	Borderland	Private Prop	no



DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
Overlook	Lane			1		0	0.04				0 Unpaved	Barela Rd (d-15)	End of road	no
Owles Nest	Street			4		0	0.24				0 Unpaved	Jackrabbit	Brahmen	no
Ozark	Road			1		0.11	0	0.11			0.11 Paved	Alargo	South Street	yes
P.G. Lopez	Trail			1		0	0.46	0.46			0.46 unpaved			yes
Pacana	Street			4	Town of Organ	0.43	0	0.43			0 Unpaved	Shalem Colony	Sixth	no
Padre La Rue	Avenue			2		0.15	0	0.15			0.15 Paved	North Medina Rd	North Suacedo Ave	yes
Padre Pio	Lane			4	Butterfield Park	0.2	0	0.2	0		0.2 Paved	Armstrong Lane	Fence	yes
Paetz	Court			2		0	0.11				0 Unpaved	Muslang		no
Pajaro	Road			3		1.05	1.14	1.05	1.14		2.19 Paved & Un	Snow Road	NM 478	yes
Palma	Drive			2	Meadow Vista Subdivision	0	0				0 Unpaved			no
Palmas	Street			2	Chaparral Subdivision	1.31	1.31	1.31	1.31		2.62 Paved & Unpaved	County Line Drive	Greenwood Road	yes
Palmilla	Avenue			1	Del Cerro Estates	0.37	0	0.37			0.37 Paved	Center of Court	Center of Court	yes
Paloma	Street			2	Town of La Union	0.15	0.11	0.15	0.11		0.26 Paved & Unpaved	West Avenue	NM 273	yes
Paloma Blanca	Drive			2	Chaparral	2.7	0	2.7	0		2.7 Paved	County Line	Greenwood	yes
Palomas	Street			5		0	0				0 Paved			no
Palomino	Street			1	Sleepy Farms	0.65	0	0.65			0.65 Paved	Franco Rd	Center of Court	yes
Pamela	Street			1	Paradise Hills	0.08	0	0.08			0.08 Paved	C-052	Center of Circle	yes
Pampas Grass	Street			2	Colquit Subd	0	0.24		0.24		0.24 Unpaved	Prescott Anthony	Tornillo Drive	yes
Pancho	Place			1		0	0.2				0 Unpaved	Forest		yes
Pantera	Circle			1		0	0.35				0 Unpaved	Shalem Colony	farm	no
Paradise	Lane			2	Paradise Valley	0	0.29				0 Unpaved	Joy Rd	Canal	no
Parakeet	Road			1		0.58	0	0.58			0.58 Paved	Shalem Colony	Culvert	yes
Paroquia	Street			3		0	0.28				0 Unpaved	Shalem Colony Tr	Leeve	no
Parque	Avenue			1	Town of Benno	0.37	0	0.37			0.37 Paved	San Miguel	Private Property	yes
Parrigin	Way			4	Kissiah-Parrigin	0.36	0	0.36			0.36 Paved	Vargas	Candalaria	yes
Paseo Apodace				2		0.98	0	0.98			0.98 Paved	Peachtree Hills	Cul-de-sac	yes
Paseo De Paz				2	Estancia De Paz	0.23	0	0.06			0 Unpaved	NM28		no
Paseo Real	Drive			2		1.95	0	1.95			1.95 Paved	Gardner	County Line	no
Patty	Place			2		0	0.1				0 Unpaved	Chaparral Dr.	County Line	yes
Peaceful Pines	Lane			1		0	0.1				0 Unpaved	Harding	end of road	no
Peach Tree Hills	Road			1		0	0.31				0 Unpaved	NM 227		no
Pecan	Drive			3	Kissiah-Parrigin	0	1.5				0 Unpaved	Castillo Rd	Alargo Rd	no
Pecan Grove	Court			2	Pecan Valley Acres	0.21	0	0.21			0.21 Paved	Mesa Drive	D-067	no
Pecanderosa	Court			2	West Valley Farms Subd.	0	0.06				0 Unpaved	NM 80	Mimosa	yes
Pedro Madrid	Road			2	Pecanderosa Subd.	0	0.16				0 Unpaved	McNutt Road	Private Property	no
Pelicano	Trail			1		0.78	0	0.78			0.78 Paved	Ledesma Road	D-028	no
Pena Blanca	Loop			3	Teleavera	0	0.25				0 Unpaved	Del Rey Blvd		yes
Pepper	Road			1		0	1.7				0 Unpaved	Ladera Canyon		no
Pepperment	Place			2		0	0.05				0 Unpaved	Southwind		no
Perrilla	Place			1		0	0.18				0 Unpaved	Minter		no
Perera	Avenue			2	Town of Chambentno	0.27	0.12	0.27	0.12		0.39 Paved & Unpaved	Barela Rd (d-15)	private prop.	no
Peter Hurd	Road			3		1.01	0				0 Unpaved	San Joaquin		yes
Petit	Road			1		0	0.21				0 Unpaved	George Catlin		no
Phenakite	Court			4		0	0.15				0 Unpaved	Haasville		no
Phoenix	Street			4	Inspiration Heights, Phase 1	0.1					0.1 Paved	80' south of Inca Dove	End of pavement sub phases	yes
Picacho Hills	Drive			1	Picacho Hills	1.27	0	1.27			1.27 Paved	Highway 70 (W. Picacho)	Via Norte	yes
Picacho Point	Court			1	Picacho Hills	0.03	0	0.03			0.03 Paved	Picacho Hills Dr		yes
Picacho Vistas	Avenue			1	Picacho Vistas No. 1	0	0.49				0 Unpaved	Hwy 70		no
Picflor	Court			1	Picflor	0.35	0	0.35			0.35 Paved	Blanes Street		yes
Picnic	Court			2		0	0.05				0 Unpaved	Bar BQ Road		no

DAC Road Inventory 2017

3/10/2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist.	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
Pigeon	Road					0	0.12				0 Unpaved	Haines		no
Pinavetes	Court					0	0.09				0 Unpaved	Fairview		no
Pinehurst	Drive					0.12	0	0.12			0.12 Paved	Bay Club Drive	Silverado Drive	yes
Pineview	Road					0	0				0 Unpaved	Westwind		no
Pinkerton	Court					0	0				0 Unpaved	El Camino Real		no
Pinkfly	Road					0	0				0 Unpaved	Baylor Canyon		no
Pinon	Drive					0	0.2				0 Unpaved	Desert Aire		no
Pinos Altos	Street					0	0.14				0 Unpaved	Ortega Rd		no
Pinta	Road					0	0.08				0 Unpaved	NM 478		no
Pipo	Lane					0.3	0	0.3			0.3 paved	Tile	Tepeyac	yes
Piro	Avenue					0.24	0	0.24			0.24 Paved	Route 26	Bianes	yes
Placitas	Avenue					0	0.86				0 Unpaved	Leyendecker	Drain	no
Plant Science	Cir					0	0				0 Undeveloped			no
Platinum	Place					0.1	0	0.1			0.1 Paved	Main Street	Private Property Gate	yes
Playa	Lane					0	0.12				0 Unpaved	Brahman Rd		no
Playground	Court					0.2	0	0.2			0.2 Paved	Palmilla Ave.	Lomas Ave.	yes
Plaza	Street					0	0.12				0 Unpaved	Desert Wind Way	Desert Ridge	no
Pleasant Hill	Court					0	0.1				0 Unpaved	Regatta	Ansellia	no
Plumerias	Court					0	0.21				0 Unpaved	Moongate	Cul-de-sac	no
Pluto	Street					0	0.21				0 Unpaved	Moongate	Cul-de-sac	no
<b>Plymouth Rock</b>	<b>Road</b>					<b>0.34</b>		<b>0.34</b>			<b>0.34 Paved</b>	<b>Leasburg Main Cana</b>	<b>Doña Ana Rd</b>	<b>yes</b>
Poedes	Road					0	0				0 Unpaved			no
Polaris	Street					0	0.2				0 Unpaved	Moongate	Cul-de-sac	no
Polo	Lane					0	0.11				0 Unpaved	Franco		no
Polvadera	Avenue					0	0.94				0 Unpaved	NM185		no
Pomegranate	Lane					0.1	0	0.1			0.1 Paved	Doña Villa	Doña Ana Roas	yes
Pony Express	Court					0	0.17				0 Unpaved	Trails End		no
Poodle	Road					0	0.57	0.57			0.57 Unpaved	NM 28	Culvert	yes
Pool	Road					0	0.14				0 Unpaved	La Reina	Private prop	no
Poplar	Drive					0	0				0 Unpaved			no
Poplar	Street					0	0.06				0 Unpaved	Singh	end of road	no
Poppy	Court					0	0.18				0 Unpaved	St. Michaels	Alpine Ct	no
Porcupine	Trail					0	0.09				0 Unpaved	Shalem Colony	End of road	no
Porcupine	Court					0	0				0 Unpaved			no
Posey	Road					0	0				0 Unpaved			no
Post	Street					0.2	0	0.2			0.2 Paved	St. Thomas Avenue	NM 228	yes
Potrillo	Road					0	0.29				0 Unpaved	Franco	Drain	no
Powell	Place					0	0.18				0 Unpaved	Westside		no
Powers	Street					0.21	0				0 Paved	Mcguffey	Windridge	no
PR-410	Road					0	0.28				0 Unpaved	Hwy 85	Prop line	no
Prairie	Lane					0	0.48				0 Unpaved	NM 80	Private Property	no
Prairie Dog	Road					0	1.02				0 Unpaved	Arroyo Rd	El Centro	no
Presca	Avenue					0	0.24				0 Unpaved	Eslancia	Drain	no
Prescott Anthony	Drive					1.36	1.13	1.36	1.13		2.49 Paved & Unpaved	Old Sequoia Grande	North end Gate end of road	yes
Presidentia	Road					0	0.21				0 Unpaved			no
Price	Street					0	0				0 Unpaved			no
Pricky Pear	Lane					0	0.12				0 Unpaved	Ocotillo Road	end of road	no
Primo's	Court					0	0.05				0 Unpaved	E. Organ		no
Principal	Street					0.44	0	0.44			0.44 Paved	Nevares	Flores	yes
Privada	Avenue					0	0.1				0 Unpaved	Thompson		no
Promotion	Road					0	0				0 Unpaved	De Vacca		no
Prophet	Circle					0	0.78				0 Unpaved			no
Provincia (east)	Road					0.48	0	0.48			0.48 Paved	NM 28	Canal	yes

DAC Road Inventory 2017

3/10/2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co.
Provincia (west)	Road			2		0	0.43	0.43	0.43	0.43	Unpaved	NM 28	Drain	no
Providence	Road			1	Vista Bella 1	0.33	0	0.33	0	0.33	Paved	Dona Ana Rd	East End	yes
Pueblo	Trail			4	Mesa La Jolla	0	0.26	0.26	0.26	0.26	Unpaved	Westmoreland	Sunland Avenue	yes
Pueblo Gardens	Court			1	Pueblo Gardens	0	0	0	0	0	Unpaved	Picacho Hills Dr	cul-de-sac	no
Pueblo Vista	Court			1	Pueblo Vista Replat #1	0.15	0	0.15	0	0.15	Paved	Cuesta Tr.	end of road	yes
Puerta de Picacho	Lane			1	Old Picacho	0	0.05	0	0.05	0	Unpaved	Mira Montes	Cul-de-sac	no
Puerta de Esperanza				1	Ranchos de Picachos	0.04	0	0.04	0	0	Paved	Picacho Hills Dr	Vista De Loma	no
Puesta Mirador				2	Picacho Hills	0.07	0	0.07	0	0	Paved	Inca Dove	End of Pavement, Subdivisi	yes
Puffin	Street			4	El Mirador Subdivision	0.11	0	0.11	0	0.11	Paved	Anthony Dr	end of road	no
Pulaski	Way			2	Inspiration Heights, Phase 2	0.08	0	0.08	0	0.08	Paved	Berino/nm26	NM 140 (WEST)	yes
Pulis	Road			2	Pure Water Addition	0	0.13	0	0.13	0	Unpaved	Yucca Road	Three Hawks	no
Pure Water	Road			2		0	0.22	0	0.22	0.2	Unpaved	N. of organifi	Justin Lane	yes
Purewater	Road			2		0	0.2	0.2	0.2	0.2	Unpaved	Organ Mesa Loop	Cul de Sac	yes
Purify	Road			3		0	0.05	0.05	0.05	0.05	Unpaved	Organ Mesa Loop	Cul de Sac	yes
Purple Mountain	Avenue			1	Linda Vista Estates	0.44	0	0.44	0.44	0.44	Paved	Ridge Dr.	Ridge Dr.	yes
Pyramid Peak	Lane			3	Organ Mesa Subd, ph1	0.03	0	0.03	0.03	0.03	Paved	cul-de-sac	City Limits	yes
Pyramid Peak	Court			3	Organ Mesa Subd, ph1	0.16	0	0.16	0.16	0.16	Paved	Rincon rd	cul-de-sac	yes
Quail	Drive			2	Casas Linda	0.18	0	0.18	0.18	0.18	Paved	Joy Road	cul-de-sac	no
Quail Brush	Court			3	Desert Mirage	0	0.17	0	0.17	0.17	Paved	Holman	cul-de-sac	no
Quail Run	Avenue			3	Quail Run	0.33	0	0.33	0.33	0.33	Paved	Kings Way	Cul-de-sac	no
Quail Valley	Place			4	Quail Valley Esi.	0.08	0	0.08	0.08	0.08	Paved	Parrigin Way	Picacho	yes
Quannah Parker	Road			2	Vista Del Rey Subd.	0	0	0	0	0	Unpaved	Jeanne Ln	Lisa	yes
Quarterhorse	Road			2		0	0.24	0	0.24	0.24	Unpaved	Ollin	Vado Dr	yes
Quartz Mtn.	Road			4		0	0.47	0	0.47	0.47	Unpaved	NM 213	Finley Street	yes
Queen Ann	Court			4		0	0.09	0	0.09	0.09	Unpaved	Raasaf Cr.	Raasaf Cr.	yes
Queensryche	Court			4	Kissiah Parrigin #9	0	0.09	0	0.09	0.09	Unpaved	Mesilla Hills	Mesilla Hills	yes
Queensberry	Lane			1		0.68	0	0.68	0.68	0.68	Paved	D-067/Holman	Unknown Point	yes
Quiet Pine	Drive			2	Indigo Estate	0	0.24	0	0.24	0.24	Unpaved	US 80/85	Victory Ln.	no
Quinto Sol	Lane			2	Casa Del Quinto Sol	0.2	0	0.2	0.2	0.2	Unpaved	Taylor	Hwy 85	yes
Quitman	Street			1	Mountain View Estates	0	2.03	0	2.03	2.03	Unpaved	E. Organ Rd	Rincon Road	no
Raasaf	Drive			1	Raasaf Hills	0.35	0	0.35	0.35	0.35	Unpaved	A-017	A-008	no
Raasaf	Circle			1	Raasaf Hills	1.08	0	1.08	1.08	1.08	Paved	Quessenberry	C-105	yes
Rabbit Run	Road			4		0	2.18	0	2.18	2.18	Unpaved	Taylor Rd	End of lane	yes
Race Track	Road			2	Sunland Park	0.8	0	0.8	0.8	0.8	Unpaved	Westmoreland	Sunland	yes
Raevin	Court			1	Raevin Estates	0.12	0	0.12	0.12	0.12	Paved	NM28	end of road	no
Ragingbull	Place			1	Hatch	0	0.12	0	0.12	0.12	Unpaved	Highway 85	D-028	yes
Railroad	Avenue			1		0	13.41	0	13.41	13.41	Unpaved	Route 360	Culvert	yes
Rail Spike	Road			2		0	0.37	0	0.37	0.37	Paved	Rancho la Mesa Drive	cul-de-sac	no
Rainbow Ridge	Street			1	Raintree Estates	0.12	0	0.12	0.12	0.12	Paved	Esslinger	Ranchitos Lindos Ct	no
Raintree	Lane			1	Mesa La Jolla	0	0.26	0	0.26	0.26	Unpaved	W. Picacho	to gate	yes
Rails	Road			4		0	0.26	0	0.26	0.26	Unpaved	Stoney Brook Cir	cul-de-sac	no
Ranch	Road			2		0	0.92	0	0.92	0.92	Unpaved	San Andres Dr	Route 65	yes
Ranchitos Lindos	Court			1	Ranchitos Lindos Subd.	0	0.87	0	0.87	0.87	Paved	US185	Rusbeo	no
Rancho Algodones	Lane			1		0.87	0	0.87	0.87	0.87	Paved	Chonite Ave		no
Rancho Bonito	Lane			1		0.77	0	0.77	0.77	0.77	Paved			no
Rancho La Mesa	Court			1		0.08	0	0.08	0.08	0.08	Paved			no
Rancho La Mesa	Drive			1	Rancho La Mesa Summary	0.32	0	0.32	0.32	0.32	Paved			no
Ray Luchini	Dr			1		0	0.92	0	0.92	0.92	Unpaved			no
Rayado	Dr			3	Rios Encanados	0.03	0	0.03	0.03	0.03	Paved			no
Rayos De Luna	Dr			5	San Andres Estates	0.23	0	0.23	0.23	0.23	Paved			yes
Rayos de Sol				1		0	0.13	0	0.13	0.13	Unpaved			no
Recuerdos	Road			1		0.29	0	0.29	0.29	0.29	Paved			no



DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
Red Canyon Sage	Court				3 Desert Mirage	0.12	0	0.12		0.12	Paved			yes
<b>Red Cap</b>	<b>Court</b>				<b>5 Rancho Del Gallo Unit</b>	<b>0.03</b>		<b>0.03</b>		<b>0.03</b>	<b>Paved</b>	<b>Catalana Drive</b>	<b>Cul-de-sac</b>	<b>yes</b>
Red Deer	Court				4 Los Venados Estates						Paved	Fallow Deer Street	Cul-de-sac	no
Red Hills	Road				1	1.01	0	1.01		1.01	Paved	Hwy 187	Cedar Grove	yes
Red Legs	Court				2 Desert Shadow	0.14	0	0.14		0.14	Paved	Desert Sparrow Pl.	Willet Dr	yes
Red River	Drive				2 Desert Aire Estates	0.48	0	0.48		0.48	Paved	Shiprock	Sands Dr	yes
Red Rock	Court				2	0	0.27	0		0	Unpaved	Anthony Dr		no
Red Roof	Trail				4 Woodburn #4	0	0.24	0		0	Unpaved			no
Red Sun	Drive				2 Chaparral Comm. Subd. I	0.1	0	0.1		0.1	Paved	Chaparral Dr.	McCombs Dr.	no
Red Wolf	Lane				1	0	0.25	0		0	Paved	S. Weinnich	end of road	yes
Red Yucca	Court				3 Desret Mirage	0.05	0	0.05		0.05	Paved	Desert Sands		yes
Redbird	Court				3	0	0.12	0		0	Unpaved	Lost Padre Mine		no
Redfly	Road				4	0	0.24	0		0	Unpaved	Starfly	Sallee	no
Redman	Road				3 Summit Chase Unit6	0.81	0	0.81		0.81	Paved	Superstition Drive	Echo Canyon	yes
Redstone	Street				2 Desert Aire Estates	0	0.44	0		0.44	Unpaved	NM 213	End of road	yes
Redwood	Court				2 Riverside Subdivision	0	0	0		0	Unpaved			yes
Reed	Avenue				1 Archer Subdivision	0	0	0		0	Unpaved			no
Regal Mist	Court				4 Desert Mirage II	0.14	0	0.14		0.14	Paved	Desert Mirage Dr	east end	yes
Regala	Way				2 Galaway Subd	0.49	0	0.49		0.49	Paved	Lisa		yes
Regatta	Drive				2	0	0.06	0		0	Unpaved	Koogle		yes
Regency	Court				1 Coronado Ridge	0.25	0	0.25		0.25	Paved	Constitution	Cul de sac	no
Regis	Road				2 Regis Subd	0.12	0	0.12		0.12	Paved	Gato Road	Cul-de-sac	no
Rel	Lane				5	0	0.05	0		0.05	Unpaved	Hwy 28	End of road	no
Relic	Court				1	0	0.26	0		0.26	Unpaved	E. Organ		no
Remington	Road				3 Cassidy at Sundance Acres	1.9	0	1.9		1.9	Paved	AJ Miller	Tellbrook	yes
Renoir	Court				1 Fairway 18 Subdivision, Phase 1	0.07	0	0.07	0	0.07	Paved	Tuscan Drive	End of Pavement	yes
Renoir	Loop				1 Fairway 18 Subdivision						Paved			yes
Renteria	Street				3	0.3	0	0.3		0.3	Paved	Tortugas	Tile	no
Repollo	Lane				4 Inspiration Heights, Phase 2	0	0.11	0		0.11	Unpaved	Lechuaga	Mustang	yes
Rhea	Place				4 Woodburn Addition	0.06	0	0.06		0.06	Paved	Inca Dove	Cul-de-sac	no
Rhonda	Lane				3 Mesquite	0.07	0	0.07		0.07	Unpaved	Weisner Rd.	Evon	yes
Rice	Court				3 Charles F. Davis Subdivision	0	0.24	0		0.24	Unpaved	Hawthorne	Drain	no
Ricegrass	Drive				3	0	0.09	0		0.09	Unpaved	Amparo	Adrian	yes
Rich	Place				4	0.91	0	0.91		0.91	Paved	Kings Rd	Maholo Ct.	yes
Richardson	Road				2	0	0.13	0		0.13	Unpaved	Snow road	NM 478	no
Ricochet	Street				1	0	0.23	0		0.23	Paved	Desert Wind Way	End of Road	yes
Ridge	Court				2 The Bluffs Subdivision	0.23	0	0.23		0.23	Paved	Edgemont Road	Center of Court	yes
Ridge	Drive				2 Casas Linda	0.48	0	0.48		0.48	Paved	Casas Lindas Dr	Cul-de-sac	yes
Rigel	Street				4	0	0.15	0		0.15	Unpaved	Moongate		yes
Rim Rock	Drive				2 Alta Vista Estates	0	0.34	0		0.34	Unpaved	NM213	shirne	no
Rincocito	Court				1 Rinconcito Subd	0	0	0		0	Paved	NM Hwy 85		no
Rincon De Amigos	Court				4 El Rancho Grande	0.39	0	0.39		0.39	Paved	La Reina		no
Rio Bravo	Drive				3 Valle Del Rio Subdivision	0.22	0	0.22		0.22	Paved	Edge Pvmf/E. End of Proj.	Edge Pvmf/W. End of Proj.	yes
Rio Del Dorado	Court				3 Valle Del Rio Subdivision	0.03	0	0.03		0.03	Paved	Rio Dorado Drive	Center of Court	yes
Rio Dorado	Drive				3 Valle Del Rio Subdivision	0.42	0	0.42		0.42	Paved	NM 28	End of pavement	yes
Rio Grande	Road				2 Country Club Business Park	0.29	0	0.29		0.29	Paved	Edge of Asphalt	Santa Teresita Road	yes
Rio Hondo	Court				3 Valle Del Rio Subdivision	0.09	0	0.09		0.09	Paved	Rio Hondo	Center of Court	yes
Rio Hondo	Street				3 Valle Del Rio Subdivision	0.15	0	0.15		0.15	Paved	Rio Bravo Drive	Rio Dorado Drive	yes
Rio Mojado	Court				3 Valle Del Rio Subdivision	0.03	0	0.03		0.03	Paved	Rio DoradoDr.	Cul-de-sac	yes
Rio Norte	Drive				1 North Valley Estates	0.24	0	0.24		0.24	Paved	Hwy 185	Cul-de-sac	yes
Rio Seco	Court				3 Valle Del Rio Subdivision	0.04	0	0.04		0.04	Paved	Rio Dorado Dr.	Cul-de-sac	yes
Rio Viejo	Road				1	0.85	0	0.85		0.85	Paved	Walnut Grove Rd.	Highway 85	yes
Rio Vista	Drive				2 Meadow Vista Subdivision	0	0	0		0	Unpaved			no

DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main	
Ristra	Street			1	Town of Benno	0.24	0	0.24		0.24	Paved	NM 226	Private Property Gate	yes	
Rileway	Road		4	3	Mesilla Park	0	0.5	0			Unpaved	Outback Road	Leebary Road	no	
Ritter	Road			1	River Court Subdivision	0.27	0	0.1		0.1	Paved	Conway	End of road	yes	
River Walk	Road		1	1	Brentwood Estates	0	0.08	0		0.27	Paved	Northwind Rd	Cul de Sac	yes	
Rivera	Drive		4	1	Rivers Edge Subd	0	0.57	0			Unpaved	Sandstone	Gravel Pit	no	
Riverheight	Trail		1	1	Rivers Edge Subd	0.15	0	0.32		0.32	Paved	Picacho	Stop Sign	no	
Riverside	Lane		1	1	Riverwood	0.33	0	0.33		0.33	Paved	Westwind	End of road	yes	
Riverwood	Road		5	1	Robert Larson	1.22	0.46	1.22	0.46	1.68	Paved & Unpaved	NM 292	Burke Road D-014 Junction	yes	
Roadrunner	Lane		1	1	Robie	0	0.14	0			Paved	State Rd	B005	no	
Robert Larson	Road		1	2	Meadow Vista Subdivision	0	0	0			Unpaved	Riverside		no	
Robin	Drive		1	1	Robledo Vista	0.97	0	0.97		0.97	Paved	Fort Seldon	South Track	yes	
Robledo Vista	Road		4	1	Rociente	0.29	0	0.29		0.29	Paved	Ocotillo Road	End of Road	yes	
Rocca Secca	Drive		3	1	La Mancha Estates	0.75	0	0.75		0.75	Paved	Sandy Beach Road	cul-de-sac	yes	
Rock House	Road		1	1	Talavera Subdivision	0	0.96	0			Unpaved	C-052	Gate	no	
Rockey Acres	Trail		1	1	Rocky Acres	0	0.14	0		0.49	Paved	Stern	County Line	yes	
Rocky	Road		1	2	Chaparral N. Acres	0	0.09	0			Unpaved	La Quinta Lp.	Private prop	no	
Rocky Mtn.	Road		1	4	Cielo Dorado	0	0	0			Paved	Coues Deer Ave	cul-de-sac	no	
Rodeo	Court		1	4	Rolling Stone	0	0.08	0			Unpaved	Parrigin Way		no	
Roe Deer	Court		1	1	Romero	0.3	0	0.3		0.3	Paved	De Lao	Garcia	yes	
Rojo	Drive		1	1	Roosevelt	0.15	0	0.15		0.15	Paved	West Avenue	Enriquez Avenue	yes	
Rolling Stone	Drive		1	1	Rosales	0	0.13	0		0.36	Paved	Camino Real	End of road	yes	
Romero	Street		2	1	Rosario	0	0.27	0			Undeveloped	Start of prvmt by Cemetary	San Francisco	yes	
Roosevelt	Street		1	2	Rose	0	0	0			Unpaved	Westside Rd		no	
Rosales	Street		1	1	Rosebud	0.08	0	0.08		0.08	Paved	E. First	Mapwood/e.2nd st	yes	
Rosales Farm	Court		1	1	Roswell	0.28	0	0.29		0.29	Paved	Teak Lane	end of pavement	yes	
Rosario	Street		1	4	Roundup	0.15	0	0.15		0.15	Paved	N. end of road	S. End of road	no	
Rose	Lane		1	1	Royal Valley	0.15	0	0.15		0.15	Paved	Shadob Valley	King Edward	yes	
Rosebud	Lane		1	1	Royce	0	1.61	0		1.61	Unpaved	NM 28	B-010	yes	
Rosewood	Avenue		1	1	Ruby	0	2.24	0		2.24	Unpaved	Delara	State Line	yes	
Roswell	Road		1	1	Ruby Mine	0	0.97	0			Unpaved	Bales	La Sepita	no	
Round Table	Court		1	1	Run Along	0	0.21	0		0.2	Paved	Earhardt Way	Kithhawk Blvd	yes	
Roundup	Court		1	1	Runway	0	0.14	0			Unpaved	Watson		no	
Royal Valley	Drive		1	1	Rushayo	0	0.14	0			Unpaved	Elks Road	End of Road	no	
Ruby	Street		1	1	Russ	0	0.08	0		0.85	Unpaved	NM 28	Montes Road	yes	
Ruby Mine	Road		1	1	Rusty Spur	0.4	0	0.4		0.4	Paved	E-018	Route 140	yes	
Run Along	Road		1	1	Rulleidge	0	0.09	0		0.09	Unpaved	Country Club	Parkview	no	
Runway	Drive		1	1	S. Trevino	0	0.87	0			Unpaved	Mantooth	Retion Dam	yes	
Rushayo	Street		1	1	Sabertooth	0.14	0	0.14		0.14	Paved	McGuify Rd		no	
Russ	Lane		1	1	Saddle Mountain	0	0.2	0			Unpaved	Desert Wind Way	Private prop	yes	
Rusty	Lane		1	1	Saddle Ridge	0	0.39	0		0.39	Paved	Senna	Sotol	no	
Rulleidge	Road		1	1	Safari Lodge	0	0.39	0		0.39	Paved			yes	
S. Trevino	Road		1	1	Sage	0	0.39	0		0.39	Paved			yes	
Sabertooth	Lane		1	1											
Saddle Mountain	Road		1	1											
Saddle Ridge	Road		1	1											
Safari Lodge	Road		1	1											
Sage	Road		1	1											

DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Mail
Sagewood	Drive				2 Chaparral Subdivision	0.98	0	0.98		0.98	Paved	Lisa Dr	Wicker	yes
Saguaro	Court				3 Desert Mirage	0.04	0	0.04		0.04	Paved	Desert Sands		yes
Saint Elaine	Road				1	0	0.33	0.33	0.33	0.33	Unpaved	NM 140	E-009	yes
Sai Si Puentes	Avenue				4	0	0.54	0.54	0.54	0.54	Unpaved	La Reina	End of road	no
Salee	Road				3 Blair Canyon Acres	0	0.91	0.91	0.91	0.91	Unpaved	Baylor Canyon Road	St Michales	no
Salem	Street				1 Salem	0.5	0.4	0.5	0.4	0.9	Paved & Unpaved	Highway 85	Private Property	yes
Salida Del Sol	Court				3 Puerta de la Mesilla	0.05	0.05	0.05	0.05	0.05	Paved	Valdes Rd	east end	yes
Salidadel Sol	Court					0.05	0.05	0.05	0.05	0.05	Paved			yes
Salome Hernandez	Street				2 Town of La Union	0.28	0.06	0.28	0.06	0.34	Paved & Un	Rosales	Telles	yes
Salopek	Road				3	1.4	0	1.4	0	1.4	Paved	Snow Road	Highway 85	yes
Salsa	Street				2 Mountain View Estates	0	1	0.29	1	1	Unpaved	San Carlos	Desert Aire	yes
Saltbush	Drive				1	0.29	0.02	0.29	0.02	0.29	Paved	Berino Rd	Feathergrass	yes
Salt Springs	Court				3 Organ Mesa Ranc Phase 3	0.02	0	0.02	0	0.02	Paved	Lake Lucero Loop	end	yes
Samara	Road				1	0	0	0	0	0	Unpaved	HW 187		no
Sam's	Way				1	0	0.15	0.15	0.15	0.15	Unpaved	S. Fairacres		no
San Andres	Drive				5 San Andres Estates	0.85	0	0.85	0	0.85	Paved	Route 85 (north)	Route 85 (south)	yes
San Antonio	Street				2 Town of La Union	0	0.29	0.29	0.29	0.29	Unpaved	Virginia Street	West Avenue	yes
San Augustine	Street				4	1.4	0.12	1.4	0.12	1.52	Paved & Unpaved	Highway 70	Private Property	yes
San Benito	Drive				1 San Ben	0.18	0.18	0.18	0.18	0.18	Paved	S Fairacres	west end	yes
San Benito	Avenue				1 Town of Benito	0.24	0	0.24	0	0.24	Paved	NM 226	Fourth St	yes
San Bernardo	Street				2	0.19	0.19	0.19	0.19	0.19	Paved	Cemelary Street	East End	yes
San Carlos	Street				2 Rocket Valley	1	1.1	1	1.1	2.1	Paved & Unpaved	Finley	War Road	yes
San Fara	Avenue				2 Town of Chambrino	0	0.06	0.06	0.06	0.06	Unpaved	Medina	end of road	yes
San Felipe	Street				3	0.48	0	0.48	0	0.48	Paved	Tile	Stern	yes
San Francisco	Avenue				3	0.45	0	0.45	0	0.45	Paved	Eugenio	Stern	yes
San Francisco de Asis	Street				2 Town of Chamberino	0.56	0	0.56	0	0.56	Paved	Alpo Plant	Lopez Avenue	yes
San Jacinto	Road				2 Town of Chamberino	0.83	0	0.83	0	0.83	Paved	Medina Ave.	NM 28	yes
San Joaquin (was San	Street				2 Town of Chamberino	0.06	0	0.06	0	0.06	Paved	Medina	Perrea	yes
San Jose	Street				1	2.15	0	2.15	0	2.15	Paved	NM 28	NM 28/B-015 Junction	yes
San Luiz	Avenue				2 Town of Chamberino	0.31	0.12	0.31	0.12	0.43	Paved & Unpaved	Just North of A-465	San Francisco Street	yes
San Marcos	Court				1 Barcelona Ridge	0.15	0	0.15	0	0.15	Paved	Barcelona Ridge	Cul-de-sac	yes
San Miguel	Street				1 La Mesa Subdivision	0.22	0	0.22	0	0.22	Paved	NM 28	San Jose	yes
San Miguel	Street				1	0.87	0	0.87	0	0.87	Paved	NM 28	Cuivert W. of B-010	yes
San Pablo	Road				3	0.75	0	0.75	0	0.75	Paved	Avenida de Quintas	Carver	yes
San Pedro	Street				1 La Mesa Subdivision	0.53	0	0.53	0	0.53	Paved	Victoria St.	Nevarez St.	yes
San Savino	Court				1 Barcelona Ridge	0.13	0	0.13	0	0.13	Paved	Barcelona Ridge	Cul-de-sac	yes
San Ysidro	Road				1	1.64	0	1.64	0	1.64	Paved	Lopez Road	El Camino Real	yes
Sand Dunes	Way				3 Mission Bell	0.45	0	0.45	0	0.45	Paved	Wildwood Place	Mission Bell	yes
Sandallwood	Drive				1 Wildwind Estates	0.42	0	0.42	0	0.42	Paved	Sandollar Way	Cul-de-sac	yes
Sandollar	Court					0	0.13	0	0.13	0.13	Unpaved	Barrela Rd	Cul-de-sac	no
Sandollar	Way				1	0	0.13	0	0.13	0.13	Unpaved	Casas Lindas Dr	Killdeer	no
Sandring	Drive				2 Desert Shadow	0.44	0	0.44	0	0.44	Paved	D-026	D-030 Sign	yes
Sandhill	Road				4	0	1.12	0	1.12	1.12	Unpaved	Lincon St	Acostia Road	yes
Sandilla	Drive				2 Enchanted Hills Subdivision	0.19	0.37	0.19	0.37	0.56	Paved & Unpaved	Edgemont	Killdeer	yes
Sandpiper	Drive				2 Casas Lindas	0.65	0	0.65	0	0.65	Paved	Red River	Desert Aire	yes
Sands	Drive				2 Desert Air Est.	0.57	0	0.57	0	0.57	Paved	Riverwalk Rd		yes
Sandstone	Lane				1	0	0.24	0	0.24	0.24	Unpaved	Lisa Ln	Cliffhanger	no
Sandy	Lane				4	0	0.09	0	0.09	0.09	Unpaved	Tres Sandas	Cul-de-sac	yes
Sandy Beach	Road				1 La Mancha Estates	0.6	0	0.6	0	0.6	Paved	Alvarez Rd	end of road	no
Sandy Creek	Road				2	0	0.32	0	0.32	0.32	Unpaved	Linda Vista	Private Property	yes
Sandy Hill	Street				1	0.38	0	0.38	0	0.38	Paved	San Miguel A	St. Thomas A.	yes
Santa Barbara	Street				4 Mesquite	0	0.07	0	0.07	0.07	Unpaved	Dairympole		yes
Santa Clara	Lane				5	0	0.21	0	0.21	0.21	Unpaved			no



DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist.	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
Santa Cruz	Road					0	0.13				0 Unpaved			no
Santa Gertrudis	Drive				4 Cattlieland Estates	0.3	0	0.3	0		0.3 Paved	San Pablo Hereford Blvd.	Lonehorn Road	yes
Santa Maria	Lane					0	0.23				0 Unpaved	Hwy 480		no
Santa Rosa	Drive					0	0.07				0 Unpaved	St Michales		no
Santa Teresita	Drive				2 Santa Teresita Acres	1.18	0				0 Paved	Country Club	loop to Santa Teresita dr	no
Santiana	Road				2 High Valley Farms	0	0.24		0.24		0.24 Unpaved	High Valley Rd	Arapalio Road	yes
Santiago Peak	Road				1 Peaceful Valley Estates	0.07	0	0.07			0.07 Paved	Farm View Rd	Hwy 185	yes
Santo Ysidro	Court					0	0.14				0 Unpaved	Crawford Road	Center of Court	no
Santolina	Lane					0	0.06				0 Unpaved	Singh Rd		no
Saragossa	Court				1 Barcelona Ridge	0.1	0	0.1			0.1 Paved	Barcelona Ridge	Cul-de-sac	yes
Saraloga	Street					0.56	0.42	0.56	0.42		0.56 Paved & Unpaved	Route 390	Cattleguard	yes
Saromi	Lane					0	0.35				0 Unpaved	Cortez	End of lane	no
Salevo	Place					0	0.06				0 Unpaved	Yucca		no
Salum	Road				4 Pioneer Subdivision	0	0				0 Unpaved			no
Sauce	Lane					0	0				0 Unpaved	Bullock Rd		no
Saucedo	Avenue				2 Town of Chamberino	0.13	0.11	0.13	0.11		0.24 Paved & Unpaved	Tele Pole North of A-465	Lopez Avenue	yes
Sauco	Lane					0	0.04				0 Unpaved	NM28	gate	yes
Savannah	Road				1 San Miguel	0.65	0.52	0.65	0.52		1.17 Paved & Unpaved	NM28	Private Property	yes
Sayles	Road					0.5	0.6	0.5	0.6		1.1 Paved & Unpaved	River Frontage Road	NM 478	yes
Schaffner	Road				4 Moongate	0	0.37				0 Unpaved	Moongate	Gopher Rd	no
Schneberger	Road				2 Colquitt Subd. Section #6	0.2	0.32	0.2	0.32		0.52 Paved & Unpaved	Sequia Drive	State Line Drive	yes
School	Street					0	0				0 Paved			yes
Schultz						0	0				0 Unpaved			no
Scorpio	Loop					0	0				0 Unpaved			no
Scott	Lane					0	1.01				0 Unpaved	South Arries (North)	South Arries (South)	no
Scout	Lane				4	0	0.23				0 Unpaved	Arroyo Rd	Luna Vista	no
Scoutbuster	Lane				1 Buffalo Estates	0.12	0	0.12			0.12 Paved	LB Lindbeck	Cul-de-sac	yes
Secluded	Lane					0	0.12				0 Unpaved	Bullock Rd		no
Secluded Court	Lane					0	0.65				0 Unpaved	HWY 478	Secluded Court	no
Sea Pines	Drive				2 Viewpointe Subdivision	0.24	0	0.24			0.24 Paved	Secluded Lane	End of Cul-de-sac	no
Segovia	Road				1 Mountain Valley Acres	0	0.13		0.13		0 Unpaved	Country Club North	McNutt Road	yes
Selene	Court					0	0.07				0 Unpaved	Jarmen		no
Sells	Place					0	0				0 Unpaved	Valdes	Canel	yes
Selway	Road					0	0.12				0 Unpaved			yes
Seminole	Trail				4 Westmoreland Addition	0.26	0	0.26			0.26 Paved	NM 478	Private prop	no
Semper Fi	Avenue					0	0.23				0 Unpaved	Westmoreland	Sunland	yes
Serita	Drive				3 Las Alluras Subdivision	0.16	0	0.16			0.16 Paved	E-43		no
Senna	Drive				3 Las Alluras Subdivision	0.84	0	0.84			0.84 Paved	Senna	Tesola	yes
Sentemario	Street				2 Town of La Union	0.49	0	0.49			0.49 Paved	Las Alluras	Major Culvert	yes
Sentris	Way					0	0.04				0 Unpaved	Paloma	South	yes
Sequoia	Drive				4 Woodburn Addition	0.63	0	0.63			0.63 Paved	Paetz Ln.	Circuit Ln.	no
Sexton	Lane				1 Sunrize	0	0.15				0 Unpaved	NM 192	Minter	yes
Shadow Valley	Drive					0.22	0	0.22			0.22 Paved	Stanley	Hangier Lake	no
Shady	Place					0	0.17				0 Unpaved	Cul-de-sac		yes
Shady Brook	Court				3 Rios Encantado	0.05	0	0.05			0.05 Paved	W. of Shadywood		no
Shady Glen	Avenue				3 Rios Encantado	0.15	0	0.15			0.15 Paved	Turtle Creek Ave	Cul-de-sac	yes
Shady Grove	Lane					0	0.25				0 Unpaved	Willow Glen Drive	Turtle Creek Avenue	yes
Shadespear	Lane					0	0.14				0 Unpaved	Armstrong Road	end of road	no
Shalem Colony	Trail					0	0.21				0.21 Unpaved	Barela Rd	Shady Pl	no
Shanandoah	Trail				1 Nivot Addition	6.15	0	6.15	0.21		6.15 Paved	Derby Ln	Property line	yes
Sheep Springs	Road				3 Organ Mesa Ranch Phase 3	0.08	0	0.08			0.08 Paved	Highway 85	Picacho Avenue	yes
Shell	Road					0	0.33				0 Unpaved	Thorpe		no
						0.08		0.08			0.08 Paved	D Springs	Lake Lucero Loop	yes

# DAC Road Inventory 2017

3/10/2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
Shining Star	Court				4 Santa Rosa Acres Rep #1	0	0.09				0 Unpaved	St. Michales		no
Shiprock	Street				2 MountainView Est.	0	1.24		1.24		1.24 Unpaved	San Carlos	Hueco St.	no
Shirley	Lane				2 De Lara Est.	0	0.72		0.72		0.72 Unpaved	De Lara Est. Dr.	Dead End	yes
Shoestring Ranch	Road				4 Airport Acres #8	0	0.38				0 Unpaved	Holmen		yes
Short	Street				2 Town of La Union	0.09	0	0.09			0.09 Paved	Enriquez Avenue	West Street	no
Shorthorn	Drive				4 Cattiland Estates	0.36	0	0.36	0		0.36 Paved	Longhorn Road	West Street	yes
Shorly	Place				1	0	0.26				0 Unpaved	Avilar	Hereford Blvd.	yes
Shoshone	Road				2 Vista Del Rey Subd.	0	0				0 Unpaved			no
Shrode	Road				1	1.24	0	1.24			1.24 Paved	Anthony Dr	NM 478	yes
Sidewinder	Road				2 West Hills Subd.	0	0.15				0 Unpaved	Anthony Dr		no
Sierra Grande	Street				2	0	0.38				0 Unpaved	Koogle Rd	West Hills Dr	no
Sierra Madre	Drive				1 Valle De Oro	0.16	0	0.16	0.16		Paved	White Oaks	Cul-de-sac	yes
Sierra Vista	Drive				2 Meadow Vista Subdivision	0	0				0 Unpaved			yes
Sierra Vista	Road				2 Chaparral North Acres	0	0.22				0 Undeveloped			no
Siesta	Lane				1	0	0.07				0 Unpaved	Old Picacho	End of road	no
Silk Oak	Court				3 Desert Mirage	0.19	0	0.19			0.19 Paved			no
Silver Creek	Road				1	0.24	0	0.24			0.24 Paved	Hwy 185	Leeva	yes
Silver Feather	Road				1	0	0.16				0 Unpaved	Valles	end of road	yes
Silver King	Road				3 Talavera Subdivision	0.19	0	0.19			0.19 Paved	Solidad Canyon	1000' north	no
Silver King	Road				3	0.81	0	0.81			0.81 Paved	south of SCR and north of County section		yes
Silverado	Drive				2 Viewpointe Subdivision	0.14	0	0.14			0.14 Paved	Pinehurst Drive	St. Andrews Drive	no
SilverBell	Street				1	0.3	0	0.3			0.3 Paved	Highway 85	Route 390	yes
Silvermoon	Street				4 Woodburn Subd. No. 7	0	0.1				0 Paved			yes
Silverton	Court				3	0.09	0	0.09			0.09 Paved	Cripple Creek	cul de sac	no
Simpson Farm	Road				1	0	0				0 Unpaved			yes
Singer	Road				1 Saddle Creek Estates	0.34	0	0.34			0.34 Paved	Saddle Creek Estates Gate	End of Road	no
Singh	Road				1	0	0.4				0 Unpaved	Rincon		yes
Singh	Road				1	0	0				0 Unpaved	Rincon	Drain	no
Single Tree	Court				4	0	0.11				0 Unpaved	Double Tree St.		no
Sioux	Trail				4 Mesa La Jolla	0.26	0	0.26			0.26 Paved	D-032	Sunland Avenue	no
Siri	Lane				4	0	0.22				0 Unpaved	Saltee	Private Prop	yes
Sirus	Street				4 Moongate	0	0.15				0 Unpaved	Moongate		no
Silka Deer	Street				4 Los Venados Estates	0	0				0 Unpaved	Blacktail Deer Street	Fallow Deer Street	no
Six Mile	Road				1	0.53	0	0.53			0.53 Paved	NM 478	End of pavement	no
Sky View	Lane				5 Sky View Terrace	0.18	0	0.18			0.18 Paved	Bleimeyer	cul-de-sac	yes
Skyhigh	Road				2	0	0.25				0 Unpaved	Aldaz Rd	Drain	yes
Skyline	Drive				1 Paradise Hills	0.22	0	0.22			0.22 Paved	C-052	T-Intersection	no
Skyline	Court				2 Alta Vista Estates	0	0				0 Paved			yes
Sleepy Hollow	Way				1	0.28	0	0.28			0.28 Paved	Ma Bell Cable Box	D-058	no
Silverton	Court				3	0	0.08				0 Paved	Cripple Creek		yes
Smokeithron	Drive				1	0	0.11				0 Unpaved	Trails End Rd		no
Smokey	Road				3	1.24	0	1.24			1.24 Paved	Sales Road	NM 192	no
Smokey Acres	Road				1	0	0.22				0 Unpaved	SE Pajaro	Blue Sky Ln	yes
Snow	Road				1	7.1	0	7.1	0		7.1 Paved	West Union Ave	NM 478	no
Soaring Eagle	Drive				2 Santa Teresa #2A	0	0				0 Paved			yes
Socorro	Road				1 Brazito Acres	0.05	0	0.05			0.05 Paved	Bosque Farms Ct	Artesia Ct	no
Soldier	Court				1 Buffalo Estates	0.08	0	0.08			0.08 Paved	Fort Marcy Tr	cul-de-sac	yes
Soledad Canyon	Road				3	4.53	0	4.53			4.53 Paved	End of Pavement	C-077	yes
Sombra Verde	Avenue				1 Coronado Ridge	0	0.42				0 Unpaved	Hwy 28		no
Sonnet	Court				2	0.24	0	0.24			0 Paved	Constitution Rd	cul-de-sac	no
Sonoma Ranch	Boulevard				3 Tierra Escondida Phase 1	0.93	0	0.93			0.93 Paved	Telbrook	cul-de-sac	no
Sorrel	Drive				4	0	0.06				0 Unpaved	Saddle Mont. Rd.	Camino Escondida	yes
Sotal	Court				3 Las Alturas Subd. Phase #6	0.07	0	0.07			0.07 Paved	Sotal Road	Center of Court	no

DAC Road Inventory 2017

3/10/2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
Soto	Drive				3 Las Alturas Subd. Phase #6	0.87	0	0.87		0.87	Paved	Las Alturas	Tobosa Road	yes
Soukup	Road				2	0	0.49	0			Unpaved	NM 28	A-46	no
South	Street				2 Town of La Union	0.39	0	0.39		0.39	Paved	West Avenue	A-273	yes
South Arries	Avenue				1 W. Picacho Area	0	0.53	0			Unpaved	North Arries	S. Scorpio Loop	no
South Fairacres	Road				1	1.81	0	1.81		1.81	Paved	Masilla Hills Dr	N. Fairacres Rd	yes
South Track	Trail				1	0.2	0.35	0.2	0.35	0.55	Paved & Unpaved	Fort Selden	End of Road	yes
South Villita	Loop				1 Country Walk Estates	0.31	0	0.31		0.31	Paved	US HWY 85	North Villita Loop	yes
Southview	Avenue			1/5	1	0.13	0	0.13		0.13	Paved	Bamerf	Desert View	yes
Southwind	Road				4 Baylor Canyon Estates	1.52	0	1.52		1.52	Paved	Roadrunner/Burke Junction	Barrel Road	yes
Space Murals	Lane				4 Ligon Estates	0.25	0	0.25		0.25	Paved	Baylor Canyon	Cattleguard	no
Space Murals	Lane				4 Stone Austin	0.49	0	0.49		0.49	Paved	cattleguard turnaround	turnaround	no
Spanish Broom	Road				2	0.2	0	0.2		0.2	Paved	Haasville Road	cul-de-sac	no
Spanish Dagger	Road				3 Mission Bell	0.76	0	0.76		0.76	Paved	Falcon	Barricade	yes
Spanish Point	Road				1 Spanish Ridge Est	0.23	0	0.23		0.23	Paved	Barcelona Ridge	Mockingbird	yes
Sparrow	Road				2 West Hills Subd	0.24	0	0.24		0.24	Paved	Shalem Colony	private prop.	yes
Spirit Hill	Drive				3 Anasazi Estates 2	0	0.42	0			Unpaved	La Adobe Ln	End of road	no
Spirit Hunter	Lane				1 H Mountain Estates	0	0.27	0			Unpaved	Four Winds Ct	Cul de sac	no
Spirit Ridge	Court				1 North Valley Estates	0.08	0	0.08		0.08	Paved	Weinreich Road	End of Pavement	yes
Spirit Winds	Place				2 Riverside Subdivision	0.16	0	0.16		0.16	Paved	Lee Barry Rd	End of Road	no
Spring Canyon	Road				1	0	0.11	0			Unpaved	Route 26	Unknown point	no
Springfield	Court				1	0.03	0	0.03		0.03	Paved	Brahman	Water Tank	yes
Springs Canyon	Road				2	0	8.2	0	8.2	8.2	Unpaved	C-045 Sign	Picacho	no
Spruce	Drive				4	0	0.5	0			Unpaved	Sea Pines Drive	Silverado	yes
Squirrel	Lane				2 Viewpointe Subdivision	0.15	0	0.15		0.15	Paved & Unpaved	Hwy 70	Salle Rd	no
St. Andrews	Drive				4 Santa Rosa Acres Rep #1	0.12	0	0.12		0.12	Paved	End of Road	R & R Tracks	yes
St. Francis	Road				1 Mesquite	0	0.57	0			Unpaved	Paralela	Navares	yes
St. Michaels	Road				1 La Mesa Subd	0.16	0	0.16		0.16	Paved	Sales Rd.	drain	no
St. Thomas A	Avenue				4 Woodburn Addition	0.36	0	0.36		0.36	Paved	Holman Road	Kyle	yes
St. Valentine	Street				1 Powers Subdivision	0	0.33	0		0.33	Unpaved	Santa Teresa		no
Stallion	Road				4	0.47	0	0.47		0.47	Paved	Castillo		no
Stanley	Road				1	0	0	0		0	Unpaved	Nugget Pl	La Reina	no
Star	Avenue				2	0	0	0		0	Unpaved	Baylor Canyon	Red Fly	no
Star Spirits	Road				4	0	0	0		0	Unpaved	NM 460		no
Stardust	Road				2 Chaparral Subdivision	0	0.28	0		0.28	Unpaved	Otero County Line	Chaparral Drive	no
Stardust	Avenue				4 Paloma Knolls Subdivision #	1.86	0.12	1.86	0.12	1.98	Paved & Unpaved	Stanley		yes
Starly	Road				4 Galaway Subd	0	0.1	0		0.1	Unpaved			no
Starlight	Lane				3 Soledad Vista No. 3	0.13	0	0.13		0.13	Paved	Soladad Canyon	Cul-de-sac	yes
Starview	Road			1/2/3	1 Desert Stone Subdivision	0	0	0		0	Paved			no
State Line	Drive				3 South Park Subdivision	0.04	0	0.04		0.04	Paved	Egyptian Street	End of lane	no
Steeler	Lane				1 Rios Encantados	0.91	0	0.91		0.91	Paved	Willow Glen Drive	Willow Glen Drive	yes
Steller	Way				1 Rios Encantados	0.03	0	0.03		0.03	Paved	Stoney Brook Circle	End of Cul-de-sac	yes
Stern	Drive				1 Mountain View Add.	0.4	0	0.4		0.4	Paved	Thorne Road	Hare Road	yes
Stetson	Place				2	5.67	0	5.67		5.67	Paved	NM 136	UPRR Entrance	yes
Stone	Drive				1 Mellon Subd. #1, Replat #1	0	0.08	0		0.08	Unpaved	Carver	Walson	no
Stoneville	Court				1 Taylor Farms	0.08	0	0.08		0.08	Paved	Route 85	Center of Court	yes
Stoney Brook	Circle													
Stoney Brook	Court													
Strange	Road													
Strauss	Road													
Stryker	Road													
Sue	Court													



DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
Sugar Loaf	Road				3 Talavera Subdivision	0	0			0	Unpaved			no
Sugarsand	Trail				1	0	0.18				Unpaved		Sandstone	no
<b>Sultan</b>	<b>Court</b>				<b>5 Rancho Del Gallo Unit</b>	<b>0.04</b>		<b>0.04</b>			<b>Paved</b>	<b>Catalana Drive</b>	<b>Cul-de-sac</b>	<b>yes</b>
Summit	Lane				3 Summit Chase Subd. Unit 1	0.12	0	0.12		0.12	Paved	Remington	Cul-de-sac	yes
Summit Ridge	Court				4	0.09	0	0.09		0.09	Paved			yes
Sun	Court				3	0	0.08			0	Unpaved	Kissiah	Cul-de-sac	no
Sun Garden	Road				2 Santa Teresa #5	0	0			0	Paved			no
Sun Season	Road				2 Santa Teresa #7A	0	0			0	Paved			no
Sun Spirit	Lane				2 Santa Teresa #5	0	0			0	Paved			no
Sunbonnet	Lane				1 Country Acres Phase #1	0.17	0	0.17		0.17	Paved	End of Project	Hummingbird Drive	yes
Sundance	Court				2 Santa Teresa #4	0	0			0	Paved			no
Sunday	Drive				1	1.41	0.91	1.41	0.91	2.32	Paved & Unpaved	E-391	Levee Road	yes
Sunfish	Court				1	0	0.23			0	Unpaved	La Quinta Lp.		no
Sunflower	Place				1 Country Acres Phase #1	0.08	0	0.08		0.08	Paved	Hummingbird Drive	Sun Bonnet Lane	yes
Sunglow	Court				4 Kissiah-Pamigin/ ETZ Minor	0	0.09			0	Unpaved	Kissiah		no
Sunken Train	Place				1	0	0.18			0	Unpaved	Dona Ana Rd		no
Sunland	Avenue				4 Mesa La Jolla	0	0.86		0.66	0.66	Unpaved	D-103	Chincahua	yes
Sunlit Valley	Subd				2 Sunny Ridge Subd	0	0			0	Paved			no
Sunny	Lane				3	0	0.3		0.3	0.3	Unpaved	C-095	Las Alturas	yes
Sunny Sands	Drive				2 Chaparral North Acres	1	0.24	1		1	Paved	Lisa	Wicker	yes
Sunray	Street				4	0	0			0	Unpaved	Arroyo Rd	Corona	no
Sunrise	Street				4 Sunset Heights	0	0			0	Unpaved			no
Sunrise Vista	Lane				1	0	0.04			0	Unpaved	Robledo Vista		no
Sunrunner	Avenue				4	0	0.53			0	Unpaved	Holman		no
Sunset View	Place				1	0.04				0	paved			no
Sunshine Valley	Court				1	0.13				0	Paved	Wind Chime La	Cul desac	no
Supersition	Drive				3 Cassidy at Sundance Acres	1.55	0	1.55		1.55	Paved	Cul-de-sac	Remington	yes
Supreme	Court				1					0		Quesenberry		no
<b>Sussex</b>	<b>Court</b>				<b>5 Rancho Del Gallo Unit</b>	<b>0.09</b>		<b>0.09</b>			<b>Paved</b>	<b>Plymouth Rock Rd</b>	<b>Cul-de-sac</b>	<b>yes</b>
Swallow	Court				2 Desert Shadow	0.05	0	0.05		0.05	Paved		Sanderling	yes
Swannack	Road				2	0.99	0	0.99		0.99	Paved	Frontage Rd	drain	yes
Swartz	Road				5	0.72	0	0.72		0.72	Paved	Route 85	End of Road	yes
Sweetwater					4	0	0.09			0	Unpaved	Kissiah		yes
Swift	Court				2 Desert Shadow	0.04	0	0.04		0.04	Paved		Sanderling	no
T H Benlon	Road				3	0.17	0	0.17		0.17	Paved	Georgia O'keefe		yes
Tafi	Avenue				1	0	0.23		0.23	0.23	Unpaved	South Edge of Cemetary	Ford Rd	yes
Talavera	Avenue				3	0	3.03			0	Unpaved	Soledad Canyon	Lost Padre Mine	no
Tall Tree	Court				4	0	0.09			0	Unpaved	White Fox	Cul-de-sac	no
Tamarisk	Drive				3 Las Alturas Subdivision	0.25	0	0.25		0.25	Paved	Las Alturas	Tale Pole Before 90° Turn	no
Tamariz	Court				1	0	0.14			0	Unpaved	Fairview	Canal	yes
Tarmy	Lane				4 Woodburn Addition	0	0.47			0	Unpaved	Wiesner	Cul-de-sac	no
Tarmory	Lane				4 Del Norte Country Estates	0.19	0	0.19		0.19	Paved	Elks Road	End of Road	yes
Tanglewood	Place				4 Sagewood Hills	0	0			0	Unpaved	Deserthwind Way		no
Tannahill	Drive				1 Lyons Country Estates	0.15	0	0.15		0.15	Paved	Romero	De Lao	yes
Taos	Lane				1	0	0.08			0.36	Unpaved	Calle Las Margra	Cul-de-sac	no
Tapir	Road				1 Vado Area	0.36	0	0.36		0.36	Paved	Vado Drive	Pressa	yes
Tarrin	Road				1	0	0.17			0	Unpaved	Ward St	Drain	yes
Tarrin	Court				1	0	0.09			0	Unpaved	Tarrin Ct	Dead End	no
Tarmac	Drive				2 Santa Teresa Ind. Park	0.42	0	0.42		0.42	Paved	Harrier Dr	Dead End	no
Tasmania	Ave				4	0	0.24			0	Unpaved	Holman	Lindbergh	yes
Taurus	Drive				1	0	0.13			0	Unpaved	South Aries	End of Road	no
Tawa	Ave				1	0	0.21			0	Unpaved	Hwy 478	canal	no

DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
Taylor	Road			1/4		2.4	0	2.4	0	2.4	Paved	Northwind	Elks Road	yes
Teak	Lane				1 Brazito Acres Subdivision, P	0	0.18	0	0.18	0.18	Paved	Roswell	Teakland	yes
Teak Timber	Road					0	0.12	0	0.12	0	Unpaved	Teakwood	end of road	no
Teakland	Road					0	0.17	0	0.17	0	Unpaved	Teak	Teakwood	no
Teakwood	Road					0	0.22	0	0.22	0	Unpaved	Teakland	end of road	no
Tectona	Road					0	0.13	0	0.13	0	Unpaved	Teakwood	end of road	no
Ted Brown	Road					0	0.64	0	0.64	0	Unpaved	Rancho Bonito	end of road	no
Tea Pee	Road					0	11.23	0	11.23	11.23	Unpaved	A-011	A-003	yes
Tejano	Trail				1 Valle Escondido Subdivision	0	0.1	0	0.1	0	Unpaved	Hwy 185	Zorro	yes
Tel High	Road				5 Fort Selden	0.32	0	0.32	0	0.32	Paved	Desert Edge	Hurt	yes
Telcolote	Road			4		0	0.27	0	0.27	0	Unpaved	Del Rey	End of road	no
Telbrook	Road				3 Tierra Escondida Phase 1	1.67	0	1.67	0	1.67	Paved	City limits (Ontole)	S Sonoma Ranch	yes
Telles	Street				2 Town of La Union	0.37	0	0.37	0	0.37	Paved	Vismaga	Alvarez	yes
Tepache	Street					0.21	0	0.21	0	0.21	Paved	Recuerdos Rd	east end	yes
Tepayac	Street				3 Tortugas	0.35	0	0.35	0	0.35	Paved	Stern	South	yes
Tequila	Lane					0	0.14	0	0.14	0	Unpaved	Lopez	South	yes
Teresa Paseo	Drive				2 Santa Teresa	0	0	0	0	0	Paved			no
Teresita	Drive					0	0	0	0	0	Paved			no
Tescala	Drive				3 Las Alluras Subdivision	0.32	0	0.32	0	0.32	Paved	Calabazilla	Ocotillo	yes
Tetakawi	Court				1 Barcastle Subdivision	0.14	0	0.14	0	0.14	Paved	Westwind Road	Cul de sac	yes
Thielman	Drive					0	0.46	0	0.46	0	Unpaved	Mesilla Hills Dr	Winterset	no
Third	Street				2 Sunland Park	0	0	0	0	0	Unpaved			no
Thomas Moran	Road					0.63	0	0.63	0	0.63	Paved	George Catlin	Charles Russell	yes
Thombstone	Road					0	0	0	0	0	Unpaved	Del Rey		no
Thompson	Street				1 Town of Bermo	0.21	0.03	0.21	0.03	0.24	Paved/Unpaved	NM 226	Private Property Gate	yes
Thorn	Way			1/4		0	0.06	0	0.06	0	Unpaved	Singh	End of road	no
Thorpe	Road					1.93	0	1.93	0	1.93	Paved	US 85	I-25	no
Three D Farm	Road					0	0.18	0	0.18	0	Unpaved	NM 28	End of road	no
Three Hawks	Road					0	0.23	0	0.23	0	Unpaved	Pure Water	End of road	no
Three Saints	Road			1/2		4	0	4	0	4	Paved	Six Mile	NM 404	yes
Three Saints	Street				2 Green Meadow Estates	0	0.23	0	0.23	0.23	Unpaved	Willow Ave	Whispering Dove	yes
Three Sons	Road					0	0.06	0	0.06	0	Unpaved	NM 228		no
Threawn	Court				4 Galaxy MH Subd.	0	0.08	0	0.08	0	Unpaved	Englehardt		no
Thunder	Way				4 EBL&T "C" rep #15	0	0.09	0	0.09	0	Unpaved	Sand Hill		no
Thurmond	Road					0	0	0	0	0	Paved & Unpaved	Mount Baldie	Calle Pico Gemelo	no
Tierra	Road				1 W. Picacho Area	0	0.76	0	0.76	0	Unpaved	Aires	Leeve	no
Tierra Alta	Drive					0	0.61	0	0.61	0.61	Unpaved	Highway 70 West	Highway 70 East	yes
Tierra Blanca	Road				3 Talavera Subdivision	0	0.69	0	0.69	0	Unpaved			no
Tierra Bonita	Court					0	0.16	0	0.16	0	Unpaved	NM 28	End of road	no
Tierra Del Sol	Court				1 Valle Del Sol	0.06	0	0.06	0	0.06	Paved	Tierra Del Sol	Center of Court	yes
Tierra Del Sol	Drive				1 Valle Del Sol	0.25	0	0.25	0	0.25	Paved	Route 85 North	Route 85 South	yes
Tierra Olmecca	Road				2 Tierra Encantada ph 2	0	0.09	0	0.09	0	Paved			no
Tierra Roja	Court				4 Kissiah Parrigin Re. Plt #4	0	0.87	0	0.87	0	Unpaved	Kissiah Dr	runs n/s off Koogle	no
Tierra Visia	Drive				2 West Hills Subd	0.34	0	0.34	0	0.34	Paved	Koogle	South St	no
Tigua	Drive				3 Tortugas	0.23	0.22	0.23	0.22	0.45	Paved & Unpaved	Stern	End of Pavement	yes
Tile	Street					0	0.05	0	0.05	0	Unpaved	Fence Line So. San Migue		yes
Timentane	Circle				1 Shalem Acres Subdivision	0	0	0	0	0	Paved	Dusty Prints	private property	no
Tingo	Circle				1 Caliente Ridge Subd	0.22	0	0.22	0	0.22	Paved	Constitution	cul-de-sac	no
Titania	Court				1 Coronado Ridge	0.72	0	0.72	0	0.72	Paved	Senna Drive/Major Culvert	Noche Bella Loop	yes
Tobosa	Road				3 Las Alluras Subdivision	0	0.65	0	0.65	0	Unpaved	E-9	Inca Rd	no
Toilec	Road					0	0.09	0	0.09	0	Undeveloped		Pinos Altos	no
Tomahawk	Court					0	0.54	0	0.54	0	Unpaved			no
Tobaz	Road			4		0	0	0	0	0	Unpaved			no

DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
Topoka Ave	Avenue			1	Placitas	0.21	0	0.21		0.21	Paved	Route 26	Bianes Street	yes
Tornado	Drive			4	Chaparral Subdivision	0	0.09				Unpaved	Whirwind	End of road	no
Tornillo Flats	Court			2	Alta Vista Estates	0	1.24		1.24	1.24	Unpaved	Oasis Drive	State Line Drive	yes
Torrey Pines	Drive			2	Viewpointe Subdivision	0.12	0	0.12		0.12	Unpaved	Sea Pines Drive	Silverado Drive	yes
Townview	Lane			1		0.14	0	0.14		0.14	Paved	N Hwy185	Fence On Top Of Hill	yes
Trails End	Road			1		0.52	0	0.52	0	0.52	Unpaved	Hwy185	Zorro Trail	yes
Tranguilo	Lane			4		0	0.98				Unpaved	Holmen	Prop. line	no
Tree Anri	Court			4		0	0.08				Unpaved	Engelhardt		no
Tres Caballos	Place			1		0	0.5				Unpaved	NM 228		no
Tres Hijos	Place			1		0	0.5				Unpaved	US 85	Leeve	no
Tres Pinos	Lane			1		0	0.21				Unpaved	NM 28		no
Tres Sendas	Road			4	Moongate	0.5	0	0.5		0.5	Paved	S Fairacres	end	yes
Tres Yucca	Street			1		0	0.49				Unpaved	McArthur	Brahman	no
Trestle View	Street			1		0	0.49				Unpaved	NM 154	Autumn Fire Rd	no
Triplet	Loop			4	Hacienda Acres	0	0.1				Unpaved	Private Property Fence	Nopalillo Road	no
Trojan	Loop			5		0.23	0	0.23		0.23	Paved	C-064 (West)	C-064 (East)	yes
Trotter	Court			2		0	0.26				Unpaved	Westside Dr		no
Trucha	Drive			1		0.25	0	0.25	0.2	0.2	Unpaved	Ladera C53	End of Road	yes
Trujillo	Road			1	Placitas	0.25	0	0.25		0.25	Paved	Route 26	8th Street	yes
Truman	Street			1	Salem	0	0.21		0.21	0.21	Unpaved	E-44	Washington	yes
Tucson	Avenue			4		0	0.74				Unpaved	Del Rey	Private prop	no
Tularosa	Drive			1	Tularosa Estates Subdivision	0	0.11				Unpaved			no
Tumbleweed	Court			2	Tumbleweed Estates	0.1	0	0.1			Paved	Tumbleweed Trail	East End	yes
Tumbleweed	Trail			2		0	1.04		1.04	1.04	Unpaved	Lisa	Sagewood	yes
Tuna	Street			2	Colquit Subdivision	0	0.15		0.15	0.15	Unpaved	Autumn Sage	Tornillo Flats	yes
Turn Here	Road			4		0	0.1				Unpaved	El Centro		no
Turtle Creek	Avenue			1	Rios Encantados	0.42	0	0.42		0.42	Paved	Carver Road	Stoney Brook Circle	yes
Turtle Dove	Place			1	White Wing Farms	0	0.17				Paved			no
Tuscanay	Dr			1	Fairway 18 Subdivision, Pha	0.52	0	0.52		0.52	Paved	Barcelbina Ridge	End of Road 270' north of R	yes
Trusti	Lane			2		0	0				Unpaved			no
Twilight	Road			1		0	0.12		0.12	0.12	Unpaved	Castillo Rd		no
Twin Cities	Avenue			2		0.7	0	0.7		0.7	Paved	Pete Domenici	Industrial	yes
Twin Peaks	Road			1		0	0.27				Unpaved	Jornada	End of Road	no
Two Counties	Road			1		2.53	0	2.53		2.53	Paved	Hwy 85	River	yes
Ulysses	Avenue			1	Salem	0.17	0.24	0.17	0.24	0.41	Paved & Un	E-45	E-49	yes
Underwood	Avenue			1	Vista Del Sol Subdivision	0	0				Unpaved	El Centro		no
Unicorn	Lane			4		0	0.07				Unpaved			no
Union	Avenue			1	Pure Water Addition	0	0				Unpaved	West of Saltbush R.O.W.		no
Unnamed Street	Way			1	Kilgore Subdivision	0.02	0	0.02		0.02	Paved			yes
Uranium	Road			2	Sun Country Est. Unit #1	0	0				Undeveloped			no
Uvas Springs	Road			1		2.84	1.31	2.84	1.31	4.15	Paved & Unpaved	NM 26	Luna County Line	yes
Vajillo	Lane			1		0	0.24				Unpaved	Hwy 28	Apodaca Road	yes
Valdes	Road			3		1.06	0	1.06		1.06	Paved	373 W. Union	Mirasol	yes
Valle Alegre	Road			4	Mirasol Subdivision	0.04	0	0.04		0.04	Paved	Center of Court		yes
Valle Bonito	Drive			1		0	0.1				Unpaved	Dona Ana School	South end	no
Valle Calmado	Street			2	Valle Hermoso II	0.14	0	0.14		0.14	Paved	Calie Delphia	Center of Court	yes
Valle Del Rio	Court			3	Valle Del Rio Subdivision	0.03	0	0.03		0.03	Paved	Valle del Rio	Rio Brivo	yes
Valle Del Rio	Drive			3	Valle Del Rio Subdivision	0.3	0	0.3		0.3	Paved	Snow Rd		yes
Valle Grande	Drive			1		0	0.49				Unpaved			no
Valle Lindo	Avenue			2		0	0.12				Unpaved	Optiz Rd	End of road	no
Valle Plano	Road			2	Valle Hermoso II	0.17	0	0.17		0.17	Paved	Mercantill Ave	North End	yes
Valle Somisa	Road			4	Mirasol Subdivision	0.04	0	0.04		0.04	Paved	Center of Court	Mirasol	yes



DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
Valle Verde	Court				5 Shalem Colony Estates	0.19	0	0			Paved	Shalem Trail	End of Cul-de-sac	no
Valle Vista	Drive				2 Meadow Vista Subdivision	0	0	0			0 Paved			no
Valle Vistoso	Loop				2 Valle Vistoso Subdivision									no
Valles	Road				3	0.32	0	0.32			Paved	E. Organ	End of Road	yes
Valley View	Avenue				4	0.61	0	0.61			0 Paved	Elks	Cul-de-sac	no
Valley Vista	Drive				2	0.78	0	0.78			0 Unpaved	Koogole Rd		no
Vanegas	Drive				1 Ranchos De Dona Ana	0.44	0	0.44			0.44 Paved	End of pavement	Thorpe	yes
Varquero	Place				1 Los Caballeros						Paved	San Ysidro	Private Property Fence	yes
Vargas	Street				1 Town of Benno	0.24	0	0.24			0.24 Paved	Soledad		yes
Ventanan View	Cr.				4	0	0.5	0			0 Unpaved	Englehardt	End of drive	no
Verbenia	Street				4 Fritch's Mobile Manor	0	0.24	0			0.24 Paved	Center of Court	Amarillo del Sol	yes
Vereda Granate	Street				4 Mirasol Subd. Phase #2A	0.18	0	0.18			0.18 Paved	Indian Head Rd		no
Verona	Court				1 Coronado Ridge Ph III	0.1	0	0.1			0 Paved	Constitution	Cul-de-sac	no
Vervain	Road				2	0	0.12	0			0.12 Paved	Teakwood	end of road	no
Veterans	Road				1	1.19	0	1.19			1.19 Paved	Montes Road	NM 28	yes
Via Campestre	Road				1 Picacho Hills	0.34	0	0.34			0.34 Paved	Via Norte	Picacho Hills Club House	yes
Via De Pancho Papen	Road				1	0	0	0			0 Paved	Cattlemans		yes
Via De Ville	Court				5 De Ville Estates	0.11	0	0.11			0.11 Paved	Dairympole	cul-de-sac	yes
Via Diamante	Street				1 Alto Estates	0.06	0	0.06			0.06 Paved	Vista del Reino	cul-de-sac	yes
Via Emma	Street				1 Alto Estates Unit 1	0.07	0	0.07			0.07 Paved			yes
Via Emma	Street				1 Via Emma Subdivision	0.39	0	0.39			0.39 Paved	Via Norte	Vista del Cerro	yes
Via Norte	Street				2	0.04	0	0.04			0.04 Paved	S. San Louis Ave	S. Lopez Rd	yes
Via Norte	Street				1 Picacho Hills	0.86	0	0.86			0.86 Paved	Pueblo Vista	Vista Del Reino	yes
Via Plamante	Street				1 Alto Estates	0	0	0			0 Paved			no
Via Rubi	Street				1 Alto Estates	0.09	0	0.09			0.09 Paved	Vista Del Reino	Cul-de-sac	yes
Via Sombra	Court				3 Estancias Del Yalle	0.15	0	0.15			0.15 Paved	Vaides Rd	cul de sac	yes
Via Turquesa	Court				1	0.06	0	0.06			0.06 Paved	Vista Del Reino	Cul-de-sac	yes
Vichis	Street				1	0	0.08	0			0 Unpaved	LaMar Rd.	private prop	no
Victor Duran	Avenue				1	0.17	0	0.17			0.17 Paved	Jesus Silva	End of road	yes
Victoria	Street				1 La Mesa Subdivision	0	0.24	0		0.24	0.24 Unpaved	Fence Line N of Orchard	NM 28	yes
Victoria	Trail				4	0.26	0	0.26			0.26 Paved	Westmoreland	north end	yes
Vigil	Road				1	0	0.17	0		0.17	0.17 Unpaved	Juncn of Snow and Glass	Vigil Hog Farm	yes
Villa Chiquita	Street				1 Picacho Hills	0.15	0	0.15			0.15 Paved	Via Norte (North)	Via Norte (South)	yes
Villa Emma	Street				1 Alto Estates	0.39	0	0.39			0.39 Paved	Vista de Oro	Villa Norte	yes
Villia	Loop				1	0.6	0	0.6			0.6 Paved	NM 185	NM 185	yes
Vine	Avenue				2	0	0.39	0			0 Unpaved	CR B-43	Private road	no
Vintage	Court				1 Coronado Ridge	0.1	0	0.1			0 Paved	Constitution	Cul-de-sac	no
Vinton	Road				2	0.43	0	0.43			0.43 Paved	Wastside Rd	TX line	yes
Vinton	Road	north			2	0.72	0	0.72			0.72 Paved	TX line	TX line	yes
Vinton	Road	mid			2	0.76	0	0.76			0.76 Paved	HWY 28	TX Line	yes
Violet	Way				3 Pecan Valley Acres	0.16	0	0.16			0.16 Paved	Pecan	Astor	yes
Virgo	Loop				1	0	0.16	0			0 Unpaved	S. Arles	Scorpio	yes
Visnaga	Street				2 Town of La Union	0.74	0	0.74			0.74 Paved & Unpaved	South st	Enriquez St	no
Vista Claro	Street				1 Alto Estates Unit 3	0	0	0			0			yes
Vista de Amanecer	Street				1 Las Casitas	0.11	0	0.11			0.11 Paved	Puertas De Esperanza	end of street	no
Vista de Dios	Street				1	0	0.19	0			0 Unpaved	Raasaf Cr		no
Vista de Loma	Street				1 Picacho Hills	0.08	0	0.08			0.08 Paved	Vista Del Cielo	Vista De Amanecer	yes
Vista De Oro	Street				1 Alto Estates Unit 2	0.09	0	0.09			0.09 Paved & Unpaved	Via Norte	Picaho Hills Dr	yes
Vista del Cerro	Street				1 Alto Estates Unit 2	0.65	0	0.65			0.65 Paved	Via Campestre	End of Road	yes
Vista del Cielo	Street				1 Picacho Hills	0.06	0	0.06			0.06 Paved	Picacho Hills Dr.	Vista De Loma	yes
Vista Del Monte	Street				1 Picacho Hills	0.15	0	0.15			0.15 Paved	Via Norte	Via Norte	yes
Vista Del Reino	Street				1 Alto Estates & Mansiones de	0.67	0	0.67			0.67 Paved	Arco de Goya	Cul-de-sac	yes

DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
Vista Del Rey	Road				2 Vista Del Rey Subd.	0	0.7				0 Unpaved	Santiana		no
Vista Del Valle					1 Picacho Hills	0.21	0	0.21		0.21	0 Paved	Via Norte (North)	Via Norte (South)	yes
Vista Elegante	Court				2	0	0.13				0 Unpaved	Camunez Rd		no
Vista Esirella	Court				3 La Jolla del Monte	0.09	0	0.09		0.09	0 Paved	Desert Mirage Dr		yes
Vista Hermosa					1 Picacho Hills	0.5	0	0.5		0.5	0 Paved	Via Norte	Cul de Sac	yes
Vista Montana	Road				1	0	0.23				0 Unpaved	S. Hwy 28	Vista Hermosa	yes
Vista Real	Drive				1	0.25	0	0.25		0.25	0 Paved	Weinrich	Private Property	yes
Vista Robledo	Street				1 Vista Robledo 1	0.06	0	0.06		0.06	0 Paved	Apache Canyon	N Valley Dr	yes
Vista Sierra	Court				1	0.13	0	0.13		0.13	0 Paved	Las Vistas Dr	Cul de Sac	yes
Vista Valley	Trail				1 Shann Doren Estates Replac	0	0.18				0 Unpaved			no
Vistoso	Loop				2	0	1.06				0 Unpaved	First St.		no
Vollera	Way				5	0.11	0	0.11			0 Paved	Northwind	cul de sac	no
Voyageur	Street				1 Alto De Las Flores	0.11	0	0.11		0.11	0 Paved	Alagro	South	yes
W. Barela					1	0.87	0	0.87		0.87	0 Paved	Northwind	cul-de-sac	yes
W. Benino	Road				2	3.19	0	3.19		3.19	0 Paved	nm 28	Railroad Tracks	no
W. Lisa	Drive				2 Chaparral Subd	0	0.36		0.36	0.36	0 Paved	McCombs	NM 213	yes
Wagon Mound	Road				2 Desert Aire Estates	0	0.36		0.36	0.36	0 Paved	Desert Aire	Golden Sun	yes
Wagon Trail	Road				2 Indian Hills Subdivision	0.36	0	0.36		0.36	0 Paved	State Line Drive	Schneberger Road	yes
Wagon Wheel	Trail				1	0	0.2		0.2	0.2	0 Unpaved	Fairacres	Culvert	yes
Wagons Court	Court				4 Wagons East	0.05	0	0.05		0.05	0 Paved	Weisner	Wagons East	yes
Wagons East	Trail				4 Wagons East .	0.64	0	0.64		0.64	0 Paved	n end	s end	yes
Walker	Trail				1	0	0.1				0 Unpaved	Elks Road	Prop. line	no
Wallace	Road				2	2.04	0	2.04		2.04	0 Paved	NM 28	Casad Road	yes
Walnut	Court				2 Riverside Subdivision	0	0				0 Unpaved			no
Walnut Grove	Road				1	0.95	0	0.95		0.95	0 Paved	NM436	Highway 85	yes
Walter	Lane				2	0	0.05				0 Unpaved	Dailymple	end of road	no
Wannabe	Road				2	0	0.19				0 Unpaved	Segovia	leave	no
Ward	Road				2	0	0.47				0 Unpaved	Meyers Rd	Cebolla Ln	no
Ward	Place				1 Archer Subdivision	0	0				0 Paved			no
Warning	Road				4/5 Golden Valley Acres	0.01	0.11	0.01	0.11	0.12	0 Paved & Unpaved	Dona Ana Road	Culvert	no
Warrior	Lane				1 Buffalo Estates	0.12	0	0.12		0.12	0 Paved	Fort Marcy Tr	Cul-de-sac	yes
Warthen	Road				1	0	0.68		0.68	0.68	0 Unpaved	Links	Private property	yes
Wasakie	Road				2 Vista Del Rey Subd.	0	0				0 Unpaved	Organ Mesa Loop	Cul-de-sac	yes
Waterfall Canyon	Lane				3 Organ Mesa Subd. ph1	0.05	0	0.05		0.05	0 Paved	O'hara	gate	yes
Waterfront	Street				2	1.03	0	1.03		1.03	0 Unpaved	Organ Mesa Loop	Cul-de-sac	yes
Waterhole Canyon	Court				3 Organ Mesa Subd. ph2	0.15	0	0.15		0.15	0 Paved	O'hara	gate	yes
Watson	Lane				3 Watson	1.31	0	1.31		1.31	0 Paved	HWY 28	NM 478	yes
Watson	Place				3	0	0.34				0 Unpaved	Watson Ln.	End of road	no
Weaver	Trail				1	0	0				0 Unpaved	Del Rey		no
Webb	Road				4	0.88	0.32	0.88	0.32	1.2	0 Paved & Unpaved	Del Rey	Center of Circle	yes
Webb	Road				2	0.58	0	0.58		0.58	0 Unpaved	Dairy Farms Road	Ma Bell Cable Box	yes
Weinrich (north)	Road				1	0.4	0	0.4		0.4	0 Paved	Quisenberry	Picacho	yes
Weinrich (south)	Road				4 Woodburn Addition	0.56	0	0.56		0.56	0 Paved	Picacho	Spirit Ridge Ct.	yes
Weisner	Road				1	1.03	0	1.03		1.03	0 Paved	Highway 70	Dirt Road	yes
Wendy	Lane				1 Keelo	0.08	0	0.08		0.08	0 Paved	Dona Ana Road	Center of Court	yes
Wertherm	Ave				1	0.17	0	0.17		0.17	0 Paved	Ladesma Dr	Vanegas Dr	yes
West Hadley	Drive				1	0.23	0	0.23		0.23	0 Paved	C-292	Motel Blvd.	yes
West Hills	Street				2	0	0.52				0 Paved	Sierra Grande	Koogle	no
West Main	Street				1 Salem	0.24	0	0.24		0.24	0 Paved	E-043	E-049	yes
West Tundra	Road				1	0	0				0 Unpaved	Merv's		no
West Valley	Street				2 West Valley Farms Subd.	0	0.06				0 Unpaved	McNitt Road	Private Property	no
Westen	Court				1	0.16	0				0 Paved	W Picacho		no
Western View	Road				1	0	0.68		0.68	0.68	0 Unpaved	Hill Rd	Holcomb	yes

DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co.
Westmoreland	Avenue	north		4	Mesa La Jolla	0.66	0	0.66	0	0.66	Paved	D-103	Chiricahua Trail	no
Westside	Road	mid		2		3.8	0	3.8	0	3.8	Paved	NM 28	S. Vinton	yes
Westside	Road	south		2		1.72	0	1.72	0	1.72	Paved	S. Vinton	TX line	yes
Westwind	Avenue			1		0.86	0	0.86	0	0.86	Paved	TX line	Long River	yes
Westwind	Road			1		1.06	0	1.06	0	1.06	Paved	Private Driveway	Highway 85	yes
Wheatstone	Road			2		0	0.44	0	0.44	0	Unpaved	Red River	Luna	no
Whitwind	Avenue			4		0	0.08	0	0.08	0	Unpaved	Holman	Tornado	no
Whispering Dove	Avenue			2		0.37	0	0.37	0	0.37	Paved	State Rd. 478	Green Meadow Rd	yes
Whispering Pines	Court			1	Westwind Pines Estates	0.03	0	0.03	0	0.03	Paved	Whispering Pines Lane	Dead End	yes
Whispering Pines	Lane			1	Westwind Pines Estates	0.22	0	0.22	0	0.22	Paved	Westwind Road	Forest Park Drive	yes
Whispering Sands	Drive			2	Santa Teresa #7A	0	0	0	0	0	Paved			yes
White Fox	Road			4		0	0.24	0	0.24	0	Unpaved	Flatland Rd	End of road	no
White Oaks	Road			1	Valle De Oro	0.09	0	0.09	0	0.09	Paved	Lost Dutchman Dr	cul-de-sac	yes
White Opal	Road			1		0	0.18	0	0.18	0	Unpaved	NM 478		no
White Thorn	Road			1		0	0.25	0	0.25	0	Unpaved	Webb	Westmoreland	no
White Wing	Road			4		0	0.17	0	0.17	0	Unpaved	Hwy 70	End of road	no
Whittington	Place			2		0	0.27	0	0.27	0	Paved	Westside		no
Wicker	Road			2	Chaparral Subdivision	1.01	0	1.01	0	1.01	Paved	Etna Drive	Finley	no
Wild Horse	Road			3	Talavera Subdivision	0	0.11	0	0.11	0	Unpaved			yes
Wildflower	Ave			4	Butterfield Park	0.35	0	0.35	0	0.35	Paved	Berrypatch/smith lane	Easy Lane	no
Wildrose	Way			1		0	0.11	0	0.11	0	Unpaved	Singh		yes
Wildwind(was Barela)	Road			1		0.88	0	0.88	0	0.88	Paved	End of Pavement	Northwind Road	no
Wildwood	Road			3	Mission Bell	0.13	0	0.13	0	0.13	Paved	Falcon	Center of Court	yes
Wiley	Avenue			1	Mountain View Add.	0.18	0	0.18	0	0.18	Paved	D-037	End of Road	yes
Williet	Drive			2	Desert Shadow	0.2	0	0.2	0	0.2	Paved	Casas Lindas	Edgemont	yes
William Bonney	Road			1		0	0.18	0	0.18	0	Unpaved	US 185		no
Willow	Avenue			2	Green Meadow Estates	0	0.4	0	0.4	0.4	Unpaved	East Drain Drive	Three Saints	yes
Willow Brook	Court			1	Rios Encantados	0.08	0	0.08	0	0.08	Paved	Turtle Creek Ave	Cul-de-sac	yes
Willow Creek	Lane			1		0	0.1	0	0.1	0	Unpaved	Lost Ln	Happy Place	no
Willow Glen	Drive			1	Rios Encantados	0.39	0	0.39	0	0.39	Paved	Carver Road	Stoney Brook Circle	yes
Wilson	Street			1		0	0	0	0	0	Paved	Las Alturas	Center of Court	yes
Winchester	Road			3	Tellbrook Subdivision	0.71	0	0.71	0	0.71	Paved	Northwind	Center of Court	yes
Wind	Lane			1		0	0.14	0	0.14	0	Unpaved	Eagles Nest	End of Road	no
Wind Chime	Lane			1		0	0.18	0	0.18	0	Unpaved	Soladad Canyon	Luna Sermo Ct	no
Wind Dancer	Trail			3	Soledad Vista Subdivision	0	0	0	0	0	Paved	Grant	Bear Claw	yes
Wind Silver	Drive			2	Santa Teresa #7A	0	0.29	0	0.29	0.29	Unpaved	Taylor Rd.	Private prop	no
Windflyer	Lane			1		0	0.08	0	0.08	0	Unpaved	Argus Rd.		no
Windrose	Court			1		0	0.08	0	0.08	0	Unpaved	Burke Road	Winterhaven	yes
Windsong	Lane			4		0	0	0	0	0	Unpaved	Thielman Rd	Winterset	no
Winster	Street			1		0	0	0	0	0	Unpaved	NM478		no
Winterhaven	Drive			5	Winterhaven	0.41	0	0.41	0	0.41	Paved	cul-de-sac	Sanderling	yes
Winterset	Road			1		0	0.15	0	0.15	0	Unpaved	Snow Rd		no
Wonder	Lane			1	S. of Mesilla Park	0	0.1	0	0.1	0.09	Paved	B-051 Sign	NM 478	yes
Yellowlegs	Lane			2	Desert Shadow	0.09	0	0.09	0	0.09	Paved	Private prop		no
Yeso	Lane			1		0	0.13	0	0.13	1.33	Paved	Omega	Private prop	no
Yucca	Road			1	Meadow Vista Subdivision	1.33	0	1.33	0	1.33	Paved	Westmoreland	Higgins Lane	yes
Yucca	Drive			2		0	0	0	0	0	Unpaved	Smith Lane		no
Yucca Heights	Road			4		0	0.09	0	0.09	0	Unpaved	Millard		no
Yuma	Street			4	Mesa La Jolla	0	0.38	0	0.38	0.13	Paved			no
Zeus	Avenue			4	Butterfield Park	0.13	0	0.13	0	0.13	Paved			yes
Zircon	Court			4	Amber Mesa	0	0.09	0	0.09	0	Unpaved			no
Zorro	Trail			1	Valle Escondido Subd. #2	0	0.15	0	0.15	0	Unpaved			no



DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
Zule	Plaza				1 Martinez Farm Acres	0.13	0	0.13		0.13	Paved	Missionary Ridge Rd	Cul-de-sac	yes
	A	1				0	3.2		3.2		Unpaved	A-003	Mexico Border	yes
	A	2				0	2.3		2.3		Unpaved			yes
	A	4				0	1.2		1.2		Unpaved			yes
	A	5				0	10		10		Unpaved	A-003	Unknown Point	yes
	A	6				0	2.83		2.83		Unpaved	A-003	Mexico Border	yes
	A	7				0	9.8		9.8		Unpaved	A-005	JCJ Ranch Road	yes
	A	9				0	3.03		3.03		Unpaved	A-008	A-003	yes
	A	10				0	1.3		1.3		Unpaved	A-007	A-008	yes
	A	11				0	12.33		12.33		Unpaved	A-010	A-017	yes
	A	12				0	1.15		1.15		Unpaved	A-011	Past House	yes
	A	13				0	8.62		8.62		Unpaved	JCJ Ranch Road	A-014	yes
	A	15				0	5.67		5.67		Unpaved	A-014	A-014	yes
	A	16				0	5.77		5.77		Unpaved	A-014	A-014	yes
	A	17				2.88	14.97	2.88	14.97		Paved & Un	McNutt	JCJ Ranch	yes
	A	18				0	1.19		1.19		Unpaved	B-002	JCJ Ranch	yes
	A	19				0	2.28		2.28		Unpaved	JCJ Ranch A-018 Jncn	B-002	yes
	A	25			2 Sunland Park	0	0		0		Unpaved			no
	A	26			2 Sunland Park	0	0		0		Unpaved			no
	A	38			2 Town of La Unión	0.16	0.07	0.16	0.07		Paved	Telles Street	Main Street	yes
	A	49				0	1.54		1.54		Unpaved	Westside Road	A-049 Sign	yes
	A	74				0	1.16		1.16		Unpaved	NM213	Bowen Ranch Fence	yes
	A	89				0	0.14		0.14		Unpaved	A-020	Gate	yes
	A	465			2 Town of Chamberino	0	13.42		13.42		Unpaved	Medina Avenue	Sauceda Avenue	yes
	A	3A				0	0.04		0.04		Unpaved	A-017	A-003	yes
	A	34A				0	0.42		0.42		Unpaved	McNutt Road	Casad Road	yes
	A	67A				0	0.42		0.42		Unpaved	I-10 Frontage Road	Dairy	yes
	B	1				0	1.91		1.91		Unpaved	B-002	Unknown Point	yes
	B	2				0	18.94		18.94		Unpaved	Int of B5 and B2	CRA 17	yes
	B	3				0	5.9		5.9		Unpaved	B-002 NW	B-002 SE	yes
	B	4				0	22		22		Unpaved	I-10 Frontage Road	Douglas Munro Rd	yes
	B	5				0	10.08		10.08		Unpaved	Road Type Change	Junction B-002/B-004	yes
	B	6				0	16.94		16.94		Unpaved	Mesilla Dam	B-004	yes
	B	7				0	11.36		11.36		Unpaved	B-004	B-004	yes
	B	9				0	4.84		4.84		Unpaved	B-008	Unknown Point	yes
	B	10				0	6.75		6.75		Unpaved	Afton	North end	yes
	B	31				0	0.26		0.26		Unpaved	Hwy 478	Sunshine Lane	yes
	B	32				0	0.25		0.25		Unpaved			yes
	B	40				0	0.4		0.4		Unpaved	NM 28	Westside Road	yes
	B	42				0	0.33		0.33		Unpaved	B-041 Sign	NM 228	yes
	B	50				0.42	0	0.42	0		Paved	Snow Rd	B 48	yes
	B	58				0	0.35		0.35		Unpaved	I-10 Frontage Road	Mission. Ridge Cem. Gate	yes
	B	59				1.3	3.83	1.3	3.83		Paved & Unpaved	I-10 Frontage Road	Unknown Point	yes
	B	66				0	0.16		0.16		Unpaved	B-051	Telephone Pole	yes
	B	4A				0	0.25		0.25		Unpaved	Fence Line N. of RR Track	B-004	yes
	B	30A				0.43	0	0.43	0		Paved	NM 228	End of Road	yes
	B	59A				0	0.25		0.25		Unpaved	B-059	Landfill Gate	yes
	C	1				0.3	7.6	0.3	7.6		Paved & Unpaved	NM 549 I-10 Junction	Lazy E Ranch Gate	yes
	C	2				0	1.03	1.03	1.03		Unpaved	C-001	Private Property Gate	yes

DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
C		3	1	1		0	11.53		11.53	11.53	Unpaved	I-10 Frontage Road	C-003 Sign	yes
C		3	1	1		3.71	5.63	3.71	5.63	9.34	Paved & Unpaved	Underpass	Private Property Gate	yes
C		4	1	1		0	7.15		7.15	7.15	Unpaved	C-008	C-003	yes
C		5	1	1		0	4		4	4	Unpaved	Frontage Road Gate	C-003	yes
C		6	1	1		0	9.3		9.3	9.3	Unpaved	D-007	C-005	yes
C		7	1	1		3.66	5.68	3.66	5.68	9.34	Paved & Unpaved	Underpass	Gate	yes
C		8	1	1		0	11.08		11.08	11.08	Unpaved	C-007	C-004	yes
C		43	1	1		0	0.12		0.12	0.12	Unpaved	Fairacres	Underpass	yes
C		76	1	1		0	0.34		0.34	0.34	Unpaved	Access Road	Cemetary	yes
C		101	1	1	Raasaf Hills	0	0.13		0.13	0.13	Unpaved	Mesilla Hills Drive	C-101 Sign	yes
C		292	1	1		0.87	0	0.87	0	0.87	Paved	Picacho	Motel Blvd.	yes
C		1A	1	1		0.9	0	0.9	0	0.9	Paved	NM-549	Gate	yes
C		1B	1	1		0	5.21		5.21	5.21	Unpaved	C-001	Luna County Line	yes
C		92A	1	1	Old Picacho	0	0.04		0.04	0.04	Unpaved	Main Street	Private Property Gate	yes
C		105A	1	1		0	0.19		0.19	0.19	Unpaved	Weinreich Road	Private Property	yes
D		1	1	1		0	12.3		12.3	12.3	Unpaved	C-001	Unknown Point	yes
D		2	1	1		0	2.2		2.2	2.2	Unpaved	D-001	C-01A	yes
D		3	1	1		0	3.64		3.64	3.64	Unpaved	D-001	C-001	yes
D		4	1	1		0	1.12		1.12	1.12	Unpaved	D-001	D-003	yes
D		5	1	1		0	4.5		4.5	4.5	Unpaved	D-011	C-003	yes
D		6	1	1		0	7.16		7.16	7.16	Unpaved	D-011	C-003	yes
D		7	1	1		0	4.5		4.5	4.5	Unpaved	D-008	D-011	yes
D		8	1	1		0	2.9		2.9	2.9	Unpaved	D-006	Cattle Pond	yes
D		9	1	1		0	0.34		0.34	0.34	Unpaved	D-008	D-006	yes
D		10	1	1		0	3.09		3.09	3.09	Unpaved	D-006	D-011	yes
D		11	1	1		0	8.17		8.17	8.17	Unpaved	D-012	Cattle Pond	yes
D		12	1	1		15.5	0	15.5	0	15.5	Paved	C-007	AT & T Tower	yes
D		42	1	1	Lyons Country Estates	0	0.28		0.28	0.28	Unpaved	Ledesma (West)	Ledesma (East)	yes
D		43	1	1		0	0.34		0.34	0.34	Unpaved	Thorpe Road	Thorpe Road	yes
D		60	1	1	Radium Springs	0.1	0.1	0.1	0.1	0.2	Paved & Unpaved	Route 85	D-062A	yes
D		61	1	1	Radium Springs	0.17	2.62	0.17	2.62	2.79	Paved & Unpaved	E-070	D-062	yes
D		62	1	1	Radium Springs	0	6.81		6.81	6.81	Unpaved	Hill Bridge	Private-Property Gate	yes
D		63	4	4		0	6.81		6.81	6.81	Unpaved	D-064	E-079	yes
D		87	1	1		0	4.11		4.11	4.11	Unpaved	D-064	Gate	yes
D		65	4	4		0	0.22		0.22	0.22	Unpaved	D-107	Private Property	yes
D		108	1	1		0.17	0	0.17	0	0.17	Paved	Dona Ana School Rd	El Camino Real	yes
D		110	1	1		0.05	0	0.05	0	0.05	Paved	D-109	D-110 Sign	yes
D		147	1	1	Paradise Hills	0.06	0	0.06	0	0.06	Paved	C-052	Center of Circle	yes
D		62A	1	1	Radium Springs	0.17	0	0.17	0	0.17	Paved	Route 85	End of Road	yes
D		10A	1	1		0	0.52		0.52	0.52	Unpaved	D-012A	D-011	yes
D		12A	1	1		0	9		9	9	Unpaved	D-012	Magdalena Peak-3 mi. sign	yes
D		66A	4	4		0	2.3		2.3	2.3	Unpaved	D-066	Unknown Point	yes
E		2	1	1		0	4.66		4.66	4.66	Unpaved	E-001	Unknown Point	yes
E		3	1	1		0	1.16		1.16	1.16	Unpaved	E-002	Unknown Point	yes
E		6	1	1		0	7.67		7.67	7.67	Unpaved	NM 85	Unknown Point	yes
E		8	1	1		1.07	0	1.07	0	1.07	Paved	NM 140 (NW)	NM 140 (SE)	yes
E		10	1	1		0.43	0.29	0.43	0.29	0.72	Paved & Unpaved	NM 140	E-010	yes
E		16	1	1		0	0.73		0.73	0.73	Unpaved	Cattleguard	Unknown Point	yes
E		28	1	1		0.32	0	0.32	0	0.32	Paved	Edge of Pavement	E-027	yes
E		35	1	1		0	0.28		0.28	0.28	Unpaved	E-005	Water Tank	yes

DAC Road Inventory 2017

Road Name	Road Suffix	Road Dist.	Road Number	Comm. Dist	Subdivision Name	Paved Miles	Unpaved Miles	Co. Paved Miles	Co. Unpaved Miles	Co. Maint. Miles	Road Type	Beginning Intersection	Ending Intersection	Co. Main
E			36	1		0.38	0.29	0.38	0.29	0.67	Paved & Unpaved	E-039	Route 26	yes
E			38	1		0.52	0	0.52	0	0.52	Paved	Route 26	Center of Court	yes
E			54	1		2.05	2.05	2.05	2.05	2.05	Unpaved	E-042	Major Arroyo	yes
E			57	1		0.26	0	0.26	0	0.26	Paved	Route 390	Highway 85	yes
E			58	1		0.38	0	0.38	0	0.38	Paved	East Side of Bridge	Route 390 (Elm Road)	yes
E			61	4		0.13	0	0.13	0	0.13	Paved	E-061 Sign	End of Pavement	yes
E			68	4		0	2.19	0	2.19	2.19	Unpaved	E-067	Unknown Point	yes
E			69	4		0	1.41	0	1.41	1.41	Unpaved	NM 140	Arroyo	yes
E			70	4		0	21.6	0	21.6	21.6	Unpaved	I-25 Radium Springs Exit	Sierra County Line	yes
E			71	4		0.22	4.36	0.22	4.36	4.58	Paved & Unpaved	E-072 I-25 Junction	I-25 Underpass	yes
E			72	1		0.33	5.3	0.33	5.3	5.63	Paved & Unpaved	E-071/I-25 Interchange	E-070	yes
E			73	4		0	5.3	0	5.3	5.3	Unpaved	E-074	Unknown Point	yes
E			74	4		0	10.53	0	10.53	10.53	Unpaved	E-076	E-070	yes
E			75	4		0	12.31	0	12.31	12.31	Unpaved	E-074	Unknown Point	yes
E			76	4		0	16.05	0	16.05	16.05	Unpaved	E-075	County Line	yes
E			77	4	Jomada exper. Range	0	13.2	0	13.2	0	Unpaved	E-074	E-086	no
E			78	4		0	7.71	0	7.71	7.71	Unpaved	E-086	Jomada Range Gate	yes
E			79	4		0	10.29	0	10.29	10.29	Unpaved	D-064	E-070	yes
E			80	4		0	16.19	0	16.19	16.19	Unpaved	E-077	E-086	yes
E			81	4		0	2.84	0	2.84	2.84	Unpaved	E-082	D-065	yes
E			82	4		0	6.95	0	6.95	6.95	Unpaved	D-064	U.S. Gov't. Gate	yes
E			83	4		0	4.93	0	4.93	4.93	Unpaved	E-082	E-086	yes
E			84	4		0	4.28	0	4.28	4.28	Unpaved	E-086	E-080	yes
E			85	4		0	11.1	0	11.1	11.1	Unpaved	E-080	E-078	yes
E			86	4		0	4.7	0	4.7	4.7	Unpaved	E-082	Unknown Point	yes
E			87	4		0	3.76	0	3.76	3.76	Unpaved	E-086	Unknown Point	yes
E			88	4		0.64	0	0.64	0	0.64	Paved	E-077 (SE)	E-077 (NW)	yes
E			90	1		0	0.1	0	0.1	0.1	Unpaved	NM 140	Levee Maintenance Road	yes
E			91	1	Vest Ranch	0	0.1	0	0.1	0.1	Unpaved			yes
E			92	1		0	0.1	0	0.1	0.1	Unpaved			yes
E			93	4		0	0.1	0	0.1	0.1	Unpaved			yes
E			94	4		0	0.75	0	0.75	0.75	Unpaved	E-075	Unknown Point	yes
E	1A		1	1		0	2.98	0	2.98	2.98	Unpaved	NM 26	E-001A	yes
E	1B		1	1		0	2.04	0	2.04	2.04	Unpaved	E-001A	Fence Line	yes
E	1C		1	1		0	1.59	0	1.59	1.59	Unpaved	E-001A	E-001B	yes
E	5A		1	1		0	1.52	0	1.52	1.52	Unpaved			yes
E	5B		1	1		0	1.65	0	1.65	1.65	Unpaved			yes
E	5C		1	1		0	4.47	0	4.47	4.47	Unpaved			yes
E	5D		1	1		0	0.4	0	0.4	0.4	Unpaved			yes
E	6A		1	1		0	4.43	0	4.43	4.43	Unpaved			yes
E	6A		1	1		0	0.42	0	0.42	0.42	Unpaved	E End E56A	E56	yes
E	64A		4	4		0	0.15	0	0.15	0.15	Unpaved	E-064	Unknown Point	yes
E	64B		4	4		0	0.5	0	0.5	0.5	Unpaved	E-064	Unknown Point	yes
E	64E		4	4		0	0.13	0	0.13	0.13	Unpaved	E-064	Unknown Point	yes
E	66A		4	4		0.6	0	0.6	0	0.6	Paved	Cemetery	End of Pavement	yes
E	67A		4	4		0	0.48	0	0.48	0.48	Unpaved	E-067	Landfill	yes
E	72A		4	4		0	0.18	0	0.18	0.18	Unpaved	E-072	E-073	yes
E	74A		4	4		0	1.56	0	1.56	1.56	Unpaved	E-074 (SW)	E-074 (NE)	yes
E	75A		4	4		0	3.52	0	3.52	3.52	Unpaved	E-075	County Line	yes
E	75B		4	4		0	1.43	0	1.43	1.43	Unpaved	E-070	E-075	yes
E	78A		4	4		0	7.57	0	7.57	7.57	Unpaved	E-073	Jomada Range Gate	yes
E	82A		4	4		0	0.23	0	0.23	0.23	Unpaved	Junction E-081 E-082	D-064	yes





## **Appendix M**

# **Doña Ana County Contract for Goods and Services (Sample)**

CONTRACT # \_\_\_\_\_  
Effective Date: \_\_\_\_\_

**DOÑA ANA COUNTY CONTRACT FOR GOODS AND SERVICES**

This Contract is entered into between Doña Ana County, hereinafter referred to as the "County," and "Contractor" described below, collectively the "Parties", to provide services on behalf of Doña Ana County.

**Contractor Legal Name:** \_\_\_\_\_

**Services Summary Description:** \_\_\_\_\_

**Initial Period of Performance shall be through:** \_\_\_\_\_

**Pre-GRT, Total Annual Charges to this contract may not exceed:** \_\_\_\_\_

This Contract complies with New Mexico and County procurement requirements as follows:

- RFP # \_\_\_\_\_,  Under \$50,000/yr **or**  BOCC approval date \_\_\_\_\_
- Bid # \_\_\_\_\_,  Under \$50,000/yr **or**  BOCC approval date \_\_\_\_\_
- "Qualified" Professional Service, Under \$50,000 annually. Qualifications attached.
- Three Written Quotes under \$30,000 annually.  Quotes under \$10,000 annually.
- Other: Revenue; non-financial MOA; or \_\_\_\_\_

**No services shall be rendered nor shall any goods be provided until this contract has been executed by all parties, regardless of the indicated effective date.**

**NOTICES:** All correspondence regarding this contract shall be sent to:

Doña Ana County Government	Contractor:
Department:	ATTN:
ATTN:	Title:
Street:845 N. Motel Blvd.	Street:
City, State, Zip: Las Cruces, NM 88007	City, State, Zip:
Phone:	Phone:
Fax:	Fax:
Cell:	Cell:
Email:	Email:

**ARTICLE 1 - SERVICES AND/OR GOODS TO BE PROVIDED:** For RFP or Professional Services contracts, the Contractor shall provide services to the County on matters relating to the contractor's specialized areas of expertise as defined in this Contract and its referenced or incorporated Attachments. Negotiated fees are fixed for the first year. Price adjustments thereafter are subject to review and written determination on an individual contract basis.



For Sealed Bid / Indefinite Quantity contracts, the Contractor shall have the item(s) or service(s) available, as defined in this contract, on an "as ordered" basis. No funds are obligated under Sealed Bid / Indefinite Quantity contracts. Funds for Sealed Bid / Indefinite Quantity contracts are obligated by purchase orders on an "as needed" basis. Prices are fixed for the first year of a Sealed Bid / Indefinite Quantity contract. Thereafter, in the event of a product cost increase an escalation request will be reviewed by the County on an individual basis. Escalation requests are only to compensate for an actual cost increase and will not be considered for an increase in profit margin.

All Contractors shall secure and remain current on all insurances, licenses, permits, certificates, fees, etc., required for the performance of this contract.

**ARTICLE 2 - CONTRACT DOCUMENTS:** The Contract shall be comprised of this contract document, its Attachments and all documents referenced herein. As applicable, the Contract shall also include all Proposal or Bid documents, including the Contractor's responses, Reference Specifications, Special Conditions, Technical Specifications, Standard Details, any addenda thereto, and all negotiation records, all of which are incorporated herein and made a part of the Contract.

In instances where there exists a conflict between any of the Contract documents described above, this Contract plus attachments hereto, negotiation records, the County's solicitation documents, and the Contractor's response to the solicitation, in that order, shall control the interpretation of the parties' respective rights and obligations.

**ARTICLE 3 - PERIOD OF PERFORMANCE:** The period of performance of this Contract shall commence \_\_\_\_\_ or date of last signature, whichever is later, and continue through the Initial Period of Performance date detailed above. If stipulated in a formal Proposal or Bid solicitation by the County, this Contract may be renewed for up to \_\_\_\_\_ additional years, not to exceed a total of \_\_\_\_\_ years.

**ARTICLE 4 - PLACE OF PERFORMANCE:** The Contractor shall provide the required services or goods for Doña Ana County when and where appropriate or as required by the County.

**ARTICLE 5 - COST AND PAYMENT:** The Contractor shall be paid for services rendered satisfactorily per the negotiated fee(s) and payment schedules incorporated hereto in applicable attachments, including Attachments A and B. All payments will be in arrears. Payment shall be made per request upon receipt of a detailed invoice that shall include description of work completed or goods delivered pursuant to the deliverable(s) agreements and measures of attainment of this contract for the period covered by the invoice. The invoice submitted shall note the purchase order number and this Contract number and may be delivered to the Department contact specified in "Notices" above. The County shall pay to the Contractor the New Mexico Gross Receipts Tax on labor and services only as levied on the amounts invoiced and payable under this contract. The Contractor will pay the New Mexico Gross Receipts Tax levied on the amounts payable under this contract and remitted to them by Doña Ana County to the appropriate state agency.

**ARTICLE 6 - AMENDMENTS:** This Contract shall not be altered, changed, or amended except by written instrument signed by both parties.

**ARTICLE 7 - ASSIGNMENT:** The Contractor shall not assign nor delegate specific duties as part of this Contract nor transfer any interest nor assign any claims for money due or to become due under this Contract without the written consent of the County.

**ARTICLE 8 - BINDING EFFECT OF CONTRACT:** Both Parties agree that the terms of this Contract and any extension or renewal thereof shall extend to and be binding upon the administrators, assigns, successors, and transferees of the contracting parties.

**ARTICLE 9 - COMPLIANCE WITH GOVERNING LAW:** This Contract shall be construed in agreement with New Mexico law. The Contractor shall keep fully informed of and shall also comply with all applicable federal, state, and local laws, ordinances, and regulations and all orders and decrees of bodies or tribunals having any jurisdiction or authority, which in any manner affect those engaged or employed, or the work, or which in any way affect the conduct of the work. By way of illustration, but not of limitation, the Contractor shall comply with laws relating to employment eligibility including: the Immigration Reform and Control Act of 1986 (Public Law 99-603) and the Immigration Act of 1990 (Public Law 101-649) regarding employment verification and retention of verification forms for any individual(s) hired on or after November 6, 1986, that will perform any labor or services under this Contract. The Contractor shall comply with all federal statutes relating to non-discrimination including, but not limited to: Title VI and VII of the Civil Rights Act of 1964 (Public Law 88-352), which prohibits discrimination on the basis of race, color, or national origin; Title IX of the Education Amendments of 1972, as amended [20 U.S.C.A. Section 504 of the Rehabilitation Act of 1973 (Public Law 93-112)], which prohibits discrimination on the basis of handicap; the Age Discrimination in Employment Act of 1967 (Public Law 90-202), as amended; the Americans with Disabilities Act of 1990 (Public Law 101-336); and all amendments to each, and all requirements imposed by the regulations issued pursuant to these acts, especially 45 CFR Part 80 (relating to race, color, and national origin), 45 CFR Part 84 (relating to handicap), 45 CFR Part 86 (relating to sex), and 45 CFR Part 91 (relating to age).

**ARTICLE 10 - CONFIDENTIAL INFORMATION:** Any confidential information, not subject to disclosure under the Inspection of Public Records Act, given to or developed by the Contractor, its officers, directors, employees, agents, or sub-consultants in the performance of this Contract will be kept confidential and will not be made available to any individual, organization, or other entity by the Contractor without prior written approval of the County.

**ARTICLE 11 - CONFLICT OF INTEREST:** The Contractor warrants that it presently has no interest and shall not acquire any interest during the term of this Contract which would have the potential to conflict with the performance of the services required under this Contract. In the event such a conflict arises, it shall immediately be brought to the attention of the County and appropriate action acceptable to the County shall be taken. The Contractor's failure to inform the County of the existence of a potential conflict of interest constitutes default and shall be grounds for immediate termination of Contract by the County.

**ARTICLE 12 - CONFLICTS OF LAW:** If any provision of this contract conflicts with governing federal or state law or County ordinances, then that law or ordinance shall supersede the conflicting provision of this contract.

**ARTICLE 13 - HIPAA COMPLIANCE:** As applicable, the parties agree to comply with the provision of the Health Insurance Portability and Accountability Act of 1996, and related regulations, as amended (“HIPAA”) in the event the Contractor receives patient records or information (Protected Health Information as defined by HIPAA).

**ARTICLE 14 - INDEMNIFICATION AND HOLD HARMLESS AGREEMENT:**

**Non-Governmental Entity** The Contractor shall hold harmless, indemnify and defend the County and its “public employees” as defined in the New Mexico Tort Claims Act, Sections 41-4-1 to 41-4-29, NMSA 1978, as amended, against and from any and all claims, losses, demands, judgments, damages, liabilities, lawsuits, expenses, attorneys fees, costs or actions of any kind resulting from or related to the Contractor’s intentional acts, errors or omissions in the Contractor’s performance under this contract. The Contractor’s agreement to hold harmless, indemnify and defend shall not be affected or terminated by the cancellation, expiration of the term or any renewal or any other modification of the Contract for any reason and shall survive the cancellation, expiration of the term or any renewal or any other modification of this contract, acts, errors or omissions to act occurring during the term of this contract.

**Governmental Entity:** Neither party shall be responsible for liability incurred as a result of the other party’s acts or omissions in connection with this Contract. Any liability incurred in connection with this Contract is subject to the immunities and limitations of the New Mexico Tort Claims Act, NMSA, 1978 § 41-4-1 et. seq. and its amendments, where applicable.

**ARTICLE 15 - INDEPENDENT CONTRACTOR:** Nothing in this Contract is intended or should be construed in any way to create or establish a partnership relationship between the Parties or to establish the Contractor as an agent, representative, or employee of the County for any purpose or any manner whatsoever. Contractor and its employees shall not accrue leave, retirement, insurance, or any other benefits afforded to employees of the County. Contractor is an independent contractor of the County. The Contractor, its officers, directors, employees, servants, agents, or representatives are not and shall not be deemed employees of the County and shall not bind the County in any respect.

**ARTICLE 16 - INSURANCE:** For the duration of the contract and until all work specified in the contract is completed, the Contractor shall maintain in effect current Certificates of all insurance as required below and comply with all limits, terms and conditions stipulated therein. The County shall be named as an additional insured as stipulated. Contractor’s who are required to provide Certificate(s) of Insurance, must provide a new current Certificate(s) no less than annually. As applicable, work under this contract shall not commence until evidence of all required insurance is provided to the respective County Department for inclusion with this Contract. All insurance shall be written to conform to the requirements stipulated. Evidence of such insurance shall consist of a completed certificate of insurance, signed by the insurance agent for the Contractor and returned to the County attesting that all required insurance is in effect. If for any reason any material change occurs in the coverage during the course of the contract such change will not become effective until 30 days after the County has received written notice of such change.

**Required Insurance:** As specified in the **RFP, BID documents or Attachment A.**



**ARTICLE 17 - KEY PERSONNEL:** The Contractor shall identify all key personnel assigned to the performance of this Contract in Section II, Attachment H of this Contract. Key personnel may not be changed without prior written approval of the County Manager and inclusion of that written approval in the official Contract File in the County Purchasing Department.

**ARTICLE 18 - MEDIATION:** In the event that a dispute arises with respect to any of the provisions contained in this Contract or any other matter affecting this contractual relationship between the County and the Contractor, the Parties agree that prior to filing any court action to enforce the Contract or rights under the Contract, they will use the services of a mediator. The mediator shall either be certified as a mediator or shall have experience as a mediator. The parties shall mutually agree upon the choice of mediator. In the event the Parties have not agreed to a mediator within three days of written notice to the other regarding the dispute, then a list of seven potential mediators will be obtained from the Court or other professional association, and the Parties shall use a striking process until a mediator is agreed upon. Each party shall be responsible for their respective mediation costs.

**ARTICLE 19 - MERGER OF PRIOR CONTRACTS:** This Contract incorporates all the conditions, contracts, agreements, and understandings of the Parties concerning the subject matter of this Contract. All such conditions, understandings, and agreements have been merged into this written Contract. No prior condition, contract, agreement, or understanding, verbal or otherwise, shall be valid or enforceable unless embodied in this Contract, either explicitly or by reference.

**ARTICLE 20 - NON-APPROPRIATION:** The County's obligation to make payment under the terms of this Contract is contingent upon its appropriation of sufficient funds to make those payments and the NM Department of Finance's (DFA) final approval of the County's budget. If the County does not appropriate sufficient funds or DFA does not approve the County's final budget, this Contract will terminate upon written notice of that effect to the Contractor. The County Board's determination that sufficient funds have not been appropriated, through Board of County Commissioners or DFA action, is firm, binding, and not subject to review.

**ARTICLE 21 - NON-WAIVER OF RIGHTS:** No failure of either party to exercise any power given to it hereunder or to insist upon strict compliance by the other party with its obligations hereunder, and no customer or practice of the parties at variance with the terms hereof, not any payment under this Agreement shall constitute a waiver of either party's right to demand exact compliance with the terms hereof.

**ARTICLE 22 - NOTICE TO PROCEED OR COMMENCEMENT OF WORK:** It is expressly understood that this Contract is not binding upon the County until approved and signed by the County and, further, that the Contractor shall not proceed with its obligations until the Contract has been signed by all Parties.

**ARTICLE 23 - PARAGRAPH HEADINGS:** Paragraph headings are for convenience and reference and are not intended to limit the scope of any provision of this Contract.

**ARTICLE 24 - PERSONAL LIABILITY:** No elected or appointed official, employee, servant, agent, or law enforcement officer of the County shall be held personally liable under this Contract or any extension or renewal thereof because of its enforcement or attempted enforcement, provided they are acting within the course and scope of their employment or governmental duty and responsibility.

**ARTICLE 25 - PROCUREMENT CODE:** The Procurement Code, § 13-1-25 through § 13-1-199, NMSA 1978 as amended, imposes civil and criminal penalties for its violation. In addition, New Mexico Criminal Statutes impose felony penalties for illegal bribes, gratuities and kickbacks. Pursuant to the above, it is unlawful for any Contractor to engage in bribery, offering gratuities with the intent to solicit business, or offering or accepting kickbacks of any kind. All other similar act(s) of bribes, gratuities, and/or kickbacks are likewise prohibited.

**ARTICLE 26 - PROPRIETARY INFORMATION:** All documents, writings, electronic formats, drawings, designs, specifications, notes, project manuals, or related documents and other work developed in the performance of this Contract by the Contractor shall become the sole property of the County whether the activity for which they are developed is implemented or not. The Contractor shall provide the County with a complete set of all such proprietary information as requested by the County, but no later than the effective termination date of the contract. Contractor is strictly prohibited from reproducing, duplicating or printing any such proprietary information in any format for personal or monetary recognition, use or gain without the advance written permission of the County.

**ARTICLE 27 - RECORD KEEPING AND AUDITS:** The Contractor shall compile, maintain, and make available for inspection all records relating to the services to be provided under this Contract. These records shall be subject to inspection by the County or designated auditor. The County shall have the right to audit billings both before and after payment; payment under this Contract shall not foreclose the right of the County to be reimbursed any excessive or illegal payment amounts made to the Contractor during the term of this Contract. Pursuant to State of New Mexico General Records Retention requirements, Contractor will retain all original, source and supporting documents and records related to this contract for a minimum of six (6) years after the ending date of this contract.

**ARTICLE 28 - RELEASE:** The Contractor, upon final payment of amounts due under this Contract for work completed and accepted by the County, releases the County, its officers and employees from all liabilities, claims, and obligations whatsoever arising from or under this Contract. The Contractor agrees not to bind the County to any obligation not assumed in this Contract by the County, unless the Contractor has express written authority from the County Manager to do so, and then only within the limits of the expressed written authority.

**ARTICLE 29 - SEVERABILITY:** If any clause or provision of the Contract is held to be illegal, invalid, or unenforceable by a court of competent jurisdiction, then it is the intention of the parties hereto that the remainder of the Contract shall remain in full force and effect. However, in the event that either Party can no longer reasonably perform pursuant to the remaining Contract terms, or if the purpose of the Contract can no longer be carried out by either Party, the Contract may be voided and no damages shall accrue to either party.

**ARTICLE 30 - SOVEREIGN IMMUNITY:**

**Non-Governmental Entity:** By entering into this Contract, the County and its "public employees" as defined in the New Mexico Tort Claims Act, NMSA 1978, Sections 41-4-1 through 41-4-29, as amended, do not waive sovereign immunity, do not waive any defense, and do not waive any limitations of liability pursuant to law. No provision in this Contract modifies or waives any provision of the New Mexico Tort Claims Act, *supra*.

**Governmental Entity:** By entering into this Contract, the County and the Governmental Entity Contractor do not waive sovereign immunity, do not waive any defense and do not waive any limitations of liability pursuant to law. No provision in this Contract modifies or waives any provision of the New Mexico Tort Claims Act, supra.

**ARTICLE 31 - SUBCONTRACTING:** This Contract is based on the personal skills and reliability of the Contractor as known by the County at the time of execution of this Contract. The Contractor shall not subcontract out or hire any new employee to perform any portion of the services to be performed under this Contract without the prior written approval of the County Manager and inclusion of that written approval in the official Contract File in the County Purchasing Department. The written approval shall minimally include disclosure of the name of the individual(s) to be hired or contracted, a statement of the individual(s) qualifications and a justification of the request to hire or subcontract.

**ARTICLE 32 - TERMINATION:** The County may terminate this contract for convenience, in whole or in part, by providing written notice to the Contractor thirty (30) days prior to termination. In the event of contract termination, the Contractor shall be paid for work completed to the date of termination. In no event shall the dollar amount to be paid upon termination exceed a total of the maximum contracted amount and any additional amount provided for by amendment(s).

- a. Where a Party to this Contract has committed a major breach that is capable of remedy, the Party who is not in breach may serve a written notice, with a fixed period in which to remedy the breach. The period given shall be determined at the sole discretion of the Party serving the notice but subject to a minimum period of two weeks.
- b. The County and Contractor shall have the right, such right being exercised at their absolute discretion, to terminate this Contract, in writing, if a major breach has been committed that can not be remedied. Further, the Parties may terminate this contract, in writing, if a breach has not been remedied to the reasonable satisfaction of the Party serving the notice of breach within the period specified in any such notice.

**ARTICLE 33 - THIRD PARTY BENEFICIARY:** It is agreed between the Parties executing this Contract that it is not intended by any of the provisions of this Contract to create on behalf of the public or any member thereof the status of third party beneficiary nor to authorize anyone not a party to the agreement to maintain a suit based upon this Contract.

**ARTICLE 34 - WAIVER:** Any waiver by the County of any breach of any covenant, term, condition, or agreement in this Contract to be kept and performed by Contractor shall not be deemed or considered as a continuing waiver and shall not operate to bar or prevent County from declaring a default for any succeeding breach either of the same covenant, term, condition, or agreement or another. All remedies afforded in this Contract shall be taken and construed as cumulative, that is, in addition to every other remedy provided herein or by law.

**ARTICLE 35 - DUPLICATE ORIGINALS:** This document shall be executed in no less than two (2) counterparts, each of which shall be deemed an original.



**SIGNATURES:**

**IN WITNESS WHEREOF, the parties have caused this instrument to be executed by their duly authorized representatives.**

**DOÑA ANA COUNTY:**

\_\_\_\_\_  
 Charles McMahon  
 Interim County Manager

Date: \_\_\_\_\_

Date: \_\_\_\_\_

\*\*\*\*\*

Contractor's NM Taxation and Revenue Department ID Number: \_\_\_\_\_

The following Attachments and Addenda have been reviewed and approved by the County Contract Officer or approved designee:

Document Name	Approved	Comments	Notes
Attachment A - Scope of Work			Required all Contracts
Attachment B - Cost per Unit Service			Required all Contracts
Attachment C - Contribution Disclosure			Required all Contracts
Attachment D - Related Party Disclosure			Required all Contracts
Attachment E - Debarment Certification			Required all Contracts
Attachment F - Non Collusion Affidavit			Required all Contracts
Attachment G - Insurance Certificates			By Attachment A Specifications
Attachment H - 1. Business License(s) 2. Professional Licenses 3. Staff Resumes			1. Required All Contracts 2. Required Licensed Professionals 3. Required all contracts
Attachment I - Procurement Method			Purchasing Dept. Determines
Attachment J - Other			Purchasing Dept. Determines

## **Section I, Appendix A**

### **Title VI Plan Compliance**

#### **Title VI Policy Statement**

Doña Ana County is committed to compliance with Title VI of the Civil Rights Act of 1964, 49 CFR, part 2, and all related regulations and directives. Doña Ana County assures that no person shall on the grounds of race, color, national origin, gender, age, or disability be excluded from participation in, be denied the benefits of, or be subjected to discrimination under any program or activity under any Doña Ana County program, activity or service.

Prohibited discrimination may be intentional or unintentional. Seemingly neutral acts that have disparate impacts on individuals of a protected group and lack a substantial legitimate justification are a form of prohibited discrimination. Harassment and retaliation are also prohibited forms of discrimination.

Examples of prohibited types of discrimination based on race, color, national origin, sex, disability, or age include: Denial to an individual any service, financial aid, or other benefit; Distinctions in the quantity, quality, or manner in which a benefit is provided; Segregation or separate treatment; Restriction in the enjoyment of any advantages, privileges, or other benefits provided; Discrimination in any activities related to highway and infrastructure or facility built or repaired; and Discrimination in employment.

#### **CONTRACTOR COMPLIANCE:**

During the performance of this contract, the contractor, for itself, its assignees and successors in interest (hereinafter referred to as the "contractor") agrees as follows:

- 1. Compliance with Regulations:** The contractor (hereinafter includes consultants) will comply with the Regulations relative to Non-discrimination in Federally-assisted programs of the U.S. Department of Transportation, Title 49, Code of Federal Regulations, Part 21, as they may be amended from time-to-time, (hereinafter referred to as the "Regulations"), which are herein incorporated by reference and made a part of this contract.
- 2. Non-discrimination:** The contractor, with regard to the work performed by it during the contract, will not discriminate on the grounds of race, color, or national origin in the selection and retention of subcontractors, including procurements of materials and leases of equipment. The contractor will not participate either directly or indirectly in the discrimination prohibited by THE Acts and the Regulations, including employment practices when the contract covers any activity, project, or program set forth in Appendix B of the 49 CFR Part 21.
- 3. Solicitations for Subcontracts, Including Procurements of Materials and Equipment:** In all solicitations, either by competitive bidding or negotiation made by the contractor for work to be performed under a subcontract, including procurements of materials or leases of equipment, each potential subcontractor or supplier will be notified by the contractor of the contractor's obligations under this contract and the Acts and the Regulations relative to Non-discrimination on the grounds of race, color, or national origin.
- 4. Information and Reports:** The contractor will provide all information and reports required by the Acts, the Regulations, and directives issued pursuant thereto and will permit access to its books, records, accounts, other sources of information, and its facilities as may be

determined by the New Mexico Department of Transportation or the Federal Highway Administration to be pertinent to ascertain compliance with such Acts, Regulations, and instructions. Where any information required of a contractor is in the exclusive possession of another who fails or refuses to furnish this information, the contractor shall so certify to Doña Ana County or the Federal Highway Administration, as appropriate, and will set forth what efforts it has made to obtain the information.

5. **Sanctions for Noncompliance:** In the event of the contractor's non-compliance with the nondiscrimination provisions of this contract, Doña Ana County will impose such contract sanctions as it or the Federal Highway Administration may determine to be appropriate, including, but not limited to:
  - a. withholding payments to the contractor under the contract until the contractor complies; and/or
  - b. cancelling, terminating or suspending the contract, in whole or in part.
6. **Incorporation of Provisions:** The contractor will include the provisions of paragraphs one through six in every subcontract, including procurements of materials and leases of equipment, unless exempt by the Acts, the Regulations and directives issued pursuant thereto. The contractor shall take such action with respect to any subcontract or procurement as Doña Ana County or the Federal Highway Administration may direct as a means of enforcing such provisions including sanctions for noncompliance. Provided, that if the contractor becomes involved in, or is threatened with litigation by a subcontractor, or supplier because of such direction, the contractor may request Doña Ana County to enter into any litigation to protect the interests of Doña Ana County. In addition, the contractor may request the United States to enter into the litigation to protect the interests of the United States.

#### **CONTRACTOR COMPLIANCE WITH STATUTES AND AUTHORITIES:**

During the performance of this contract, the contractor, for itself, its assignees, and successors in interest (hereinafter referred to as the "contractor") agrees to comply with the following non-discrimination statutes and authorities; including but not limited to:

##### **Pertinent Non-Discrimination Authorities:**

- Title VI of the Civil Rights Act of 1964 (42 U.S.C. § 2000d *et seq.*, 78 stat. 252), (prohibits discrimination on the basis of race, color national origin); and 49 CFR Part 21.
- The Uniform Relocation Assistance and Real Property Acquisition Policies Act of 1970, (42 U.S.C. § 4601), {prohibits unfair treatment of persons displaced or whose property has been acquired because of Federal or Federal-aid programs and projects};
- Federal-Aid Highway Act of 1973, {29 U.S.C. § 324 *et seq.*}, (prohibits discrimination on the basis of sex);
- Section 504 of the Rehabilitation Act of 1973, {29 U.S.C. § 794 *et seq.*}, as amended, {prohibits discrimination on the basis of disability}; and 49 CFR Part 27;
- The Age Discrimination Act of 1975, as amended, (42 U.S.C. § 6101 *et seq.*), (prohibits discrimination on the basis of age);
- Airport and Airway Improvement Act of 1982, (49 U.S.C. § 471, Section 47123), as amended, (prohibits discrimination based on race, creed, color, national origin, or sex);



- The Civil Rights Restoration Act of 1987, (PL 100-209), (Broadened the scope, coverage and applicability of Title VI of the Civil Rights Act of 1964, The Age Discrimination Act of 1975 and Section 504 of the Rehabilitation Act of 1973, by expanding the definition of the terms "programs or activities" to include all of the program or activities of the Federal-aid recipients, sub-recipients and contractors, whether such programs or activities are Federally funded or not);
- Titles II and III of the Americans with Disabilities Act, which prohibit discrimination on the basis of disability in the operation of public entities, public and private transportation systems, places of public accommodation, and certain testing entities (42 U.S.C. §§ 12131 - 12189) as implemented by Department of Transportation regulations at 49 C.F.R. parts 37 and 38;
- The Federal Aviation Administration's Non-discrimination statute (49 U.S.C. §47123) (prohibits discrimination on the basis of race, color, national origin, and sex);
- Executive Order 12898, Federal Actions to Address Environmental Justice in Minority Populations and Low-Income Populations, which ensures discrimination against minority populations by discouraging programs, policies, and activities with disproportionately high and adverse human health or environmental effects on minority and low-income populations;
- Executive Order 13166, Improving Access to Services for Persons with Limited English Proficiency, and resulting agency guidance, national origin discrimination includes discrimination because of limited English proficiency (LEP). To ensure compliance with Title VI, you must take reasonable steps to ensure that LEP persons have meaningful access to your program (70 Fed. Reg. at 74087 to 74100);
- Title IX of the Education Amendments of 1972, as amended, which prohibits you from discriminating because of sex in education programs or activities (U.S.C. 1681 *et seq.*

## **Appendix N**

# **Doña Ana County 2018 List of Voting Convenience Centers**

2018 VCC's

	VCC	PRECINCTS	COMMISSION DISTRICT
1	ANTHONY ELEMENTARY SCHOOL	11, 80	2
2	BERINO ELEMENTARY SCHOOL	9, 10	1
3	CAMINO REAL MIDDLE SCHOOL	61, 102, 109	4
4	CHAPARRAL MIDDLE SCHOOL	74, 75, 76	2
5	CORBETT CENTER-NMSU	54, 58	3
6	DEL CERRO COMMUNITY CENTER	8, 120	1
7	DESERT HILLS ELEMENTARY SCHOOL	67, 103, 106, 113	4
8	DESERT VIEW ELEMENTARY SCHOOL	13, 97	2
9	DOÑA ANA COMMUNITY CENTER	4, 115	5
10	DOÑA ANA COUNTY GOVERNMENT CENTER	38, 40, 88, 108	1
11	EAST PICACHO ELEMENTARY SCHOOL	86, 87, 100	5
12	FAIRACRES ELEMENTARY SCHOOL	19, 21, 107	1
13	FRANK O'BRIEN PAPER CENTER (MESILLA PARK RECREATION CENTER)	55, 56, 57	1
14	GADSDEN MIDDLE SCHOOL	16, 12	2
15	GARFIELD ELEMENTARY SCHOOL	1	5
16	GOOD SAMARITAN SOCIAL CENTER	68, 69, 70, 71, 72	3
17	HATCH VALLEY HIGH SCHOOL	2,3,60	
18	JORNADA ELEMENTARY SCHOOL	24, 25, 26, 83, 89, 99	5
19	LA MESA FIRE STATION	17	1
20	LA UNION ELEMENTARY SCHOOL	15, 81	2
21	LAS ALTURAS FIRE STATION	104, 114	3
22	LAS CRUCES HIGH SCHOOL	41, 42, 47, 48, 49	3
23	LYNN MIDDLE SCHOOL	43, 44, 45, 46, 94, 93	3
24	MAYFIELD HIGH SCHOOL	22, 23, 30, 31, 84, 90	5



25	MESILLA ELEMENTARY SCHOOL	18, 98	1
26	MESQUITE ELEMENTARY SCHOOL	79	1
27	NEW MEXICO FARM AND RANCH HERITAGE MUSEUM	73, 77, 110	3
28	NORTH VALLEY ELEMENTARY SCHOOL	82	1
29	OÑATE HIGH SCHOOL	62, 66, 117	4
30	ORGAN FIRE STATION	6, 64	4
31	RADIUM SPRINGS COMMUNITY CENTER	63, 111	5
32	RINCON FIRE STATION	95	5
33	SANTA TERESA MIDDLE SCHOOL	14	2
34	SIERRA MIDDLE SCHOOL	27, 28, 33, 34, 91	3
35	SONOMA ELEMENTARY SCHOOL	59, 116, 112	4
36	SUNRISE ELEMENTARY SCHOOL	5, 65, 118, 119	4
37	BRANIGAN LIBRARY	29, 32, 35, 36, 37, 39, 92	1
38	TOMBAUGH ELEMENTARY SCHOOL	7, 96, 101, 78	1
39	UNIVERSITY HILLS ELEMENTARY SCHOOL	50, 51, 52, 53	3
40	VISTA MIDDLE SCHOOL	20, 85, 105	5